

Vacant Lot

84-88 Grove Street
Meriden, Connecticut 06451

Prepared for: **City of Meriden**
c/o Juliet Burdelski
Director of Economic Development
142 East Main Street
Meriden, Connecticut 06451

Prepared by: **VHB/ Vanasse Hangen Brustlin, Inc.**
100 Great Meadow Road, Suite 200
Wethersfield, CT 06109

May 2014

Vacant Lot

84-88 Grove Street
Meriden, Connecticut 06451

Prepared for: **City of Meriden**
c/o Juliet Burdelski
Director of Economic Development
142 East Main Street
Meriden, Connecticut 06451

Prepared by: **VHB/Vanasse Hangen Brustlin, Inc.**

Project Engineer: 
Shelby A. Miller

Project Manager: 
Peter J. Chiarizio, LEP

May 2014



Table of Contents

Executive Summary.....1

1.0 Introduction3

 1.1 Purpose.....3

 1.2 Scope of Services.....3

 1.3 Significant Assumptions.....4

 1.4 Limitations and Exceptions.....4

 1.5 Special Terms and Conditions.....5

 1.6 User Reliance5

2.0 Site Description6

 2.1 Location and Legal Description.....6

 2.2 Site and Vicinity General Characteristics.....6

 2.3 Current Use(s) of the Property.....6

 2.4 Structures, Roads, and Other Improvements on the Site.....6

 2.5 Current Uses of Adjoining Properties.....7

3.0 User Provided Information8

 3.1 Title Records.....8

 3.2 Environmental Liens or Activity and Use Limitations8

 3.3 Specialized Knowledge.....8

 3.4 Commonly Known or Reasonable Ascertainable Information.....8

 3.5 Valuation Reduction for Environmental Issues.....9

 3.6 Owner, Property Manager and Occupant Information.....9

 3.7 Reason for Performing Phase I ESA.....9

 3.8 Other/Previous Environmental Reports.....9

4.0 Records Review10

 4.1 Standard Environmental Records.....10

 4.1.1 Federal Environmental Records.....11

 4.1.2 State Environmental Records.....11

 4.1.3 Summary of State and Federal File Records for Subject Property.....11

 4.1.4 Summary of State and Federal File Records for Sites within Search Radii.....12

 4.2 Additional Record Sources.....12

 4.2.1 Assessor's Office.....12

 4.2.2 Building Department/Planning Division.....13

 4.2.3 Water Division.....14

 4.2.4 Public Works Engineering Services.....14

 4.2.5 Fire Marshal's Office.....14

 4.2.6 Environmental Health.....15

 4.3 Physical Setting Source(s).....15



- 4.3.1 Topography..... 15
- 4.3.2 Soils/Surficial Geology 15
- 4.3.3 Bedrock Geology..... 15
- 4.3.4 Groundwater 16
- 4.3.5 Wetlands 16
- 4.3.6 Surface Water 16
- 4.3.7 Flood Plains 16
- 4.3.8 Threatened and Endangered Species 17
- 4.4 Historical Use Information on the Property 17
 - 4.4.1 Sanborn Maps..... 17
 - 4.4.2 City Directories..... 18
 - 4.4.3 Aerial Photographs..... 18
- 4.5 Historical Use Information on Adjoining Properties..... 19
- 5.0 Site Reconnaissance20**
 - 5.1 Methodology and Limiting Conditions..... 20
 - 5.2 Site Inspection 20
 - 5.2.1 Interior Observations..... 20
 - 5.2.2 Exterior Observations..... 20
 - 5.3 Summary of Environmental Site Features 21
 - 5.3.1 Hazardous Substances and Petroleum Products (Drums and Other Containers)..... 21
 - 5.3.2 Underground and Aboveground Storage Tanks 22
 - 5.3.3 Wells, Drywells (Underground Injection Control), Floor Drains, Sumps, Manholes and Catch Basins 22
 - 5.3.4 Odors 22
 - 5.3.5 Pools of Liquid..... 22
 - 5.3.6 Polychlorinated Biphenyls (PCBs) 22
 - 5.3.7 Pits, Ponds and Lagoons 23
 - 5.3.8 Staining – Exterior Soil and Pavement..... 23
 - 5.3.9 Stressed Vegetation..... 23
 - 5.3.10 Solid Waste, Debris and Disposal 23
- 6.0 Non-Scope Considerations24**
 - 6.1 Lead-Based Paint (LBP) 24
 - 6.2 Asbestos-Containing Materials 24
- 7.0 Interviews25**
 - 7.1 Interview with Owner..... 25
 - 7.2 Interview with Site Manager/Occupants..... 25
 - 7.3 Interviews with Local Government Officials 25
- 8.0 Findings.....26**
- 9.0 Opinion27**
- 10.0 Conclusions.....28**
- 11.0 Data Gaps/Deviations.....29**
- 12.0 Signature of Environmental Professionals.....30**

13.0 References.....31

Figures

Figure No.	Title
1	Site Locus Map
2	Site Plan

Appendices

Appendix	Description
A	Limitations
B	Environmental Data Resources, Inc. (EDR) FirstSearch Report
C	CTDEEP List of Contaminated or Potentially Contaminated Sites
D	List of Significant Environmental Hazards Reported to the CTDEEP
E	City of Meriden File Review Information
F	CTDEEP Natural Diversity Data Base Map – City of Meriden, CT
G	EDR Certified Sanborn® Map Report
H	EDR City Directory Image Report
I	Site Photographs

Executive Summary

The City of Meriden (the Client) engaged Vanasse Hangen Brustlin, Inc. (VHB) to conduct a Phase I Environmental Site Assessment (ESA) of the two vacant lots identified by the City of Meriden Tax Assessor's Office as Parcel ID 0102-0010-0036-0000 and 0102-0010-0037-0000 (the Site). A Site Locus Map is provided as **Figure 1**. This assessment was prepared in general accordance with the American Society of Testing and Materials (ASTM) Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process (ASTM Designation: E1527-13), All Appropriate Inquiry (AAI) except as stated specifically herein or in the Significant Data Gaps section of this report. Work was conducted in accordance with VHB's Proposal for services between VHB and the Client dated March 21, 2014. This report contains all of the limitations inherent in these methodologies in addition to those limitations presented in **Appendix A** of this report. No other warranties, expressed or implied, are made as to the professional services provided under the terms of our contract and included in this report.

The purpose of this Phase I ESA was to identify, to the extent feasible, recognized environmental conditions (RECs) in connection with the Site. This assessment included a Site reconnaissance as well as research and interviews as described herein.

The Site is zoned as Two- or Three-Family Residential District (R-2). Lot 0102-0010-0036-0000 is approximately 0.21 acres in size. Lot 0102-0010-0037-0000 is approximately 0.10 acres in size. The combined acreage of the two lots is approximately 0.31 acres. Both of the lots are currently vacant. The Site is bounded on the north by a residential property, on the south by a residential property, on the east by Grove Street and beyond by the Saint Mary School and a parking lot, and to the west by a residential property.

The Site is not serviced by any underground or overhead utilities.

An environmental database search conducted by Environmental Data Resources, Inc. (EDR) revealed that the Site was not listed on any state or federal databases.

VHB inspected the Site on April 10, 2014 as described in **Section 5.0**. The Site is a vacant lot. The remnants of a former building foundation remain in the hillside on the west side of lot 0102-0010-0036-0000. The ground surface is covered with grass. VHB observed some solid waste debris on the Site.

VHB did not observe any bedrock outcrops at the time of the Site Reconnaissance.

The results of this assessment have revealed the following known or suspect **recognized environmental conditions (RECs)** associated with the subject property:

- ▶ Historic presence and demolition of a building potentially finished with lead-based paint (LBP).

The results of this assessment have not revealed any known **controlled recognized environmental conditions (CRECs)** associated with the subject property.

The results of this assessment have not revealed any known **historical recognized environmental conditions (HRECs)** associated with the subject property:

The results of this assessment have not revealed any **de minimis conditions** associated with the subject property. Note that while de minimis conditions must be indicated under the ASTM guidance, they are *not* considered RECs.

Legal consultation is recommended to confirm the Site's status relative to the Transfer Act. No automatic or threshold hazardous waste indicators were identified as part of this study.

1.0 Introduction

The City of Meriden (the Client) engaged Vanasse Hangen Brustlin, Inc. (VHB) to conduct a Phase I Environmental Site Assessment (ESA) of the two vacant lots identified by the City of Meriden Tax Assessor's Office as Parcel ID 0102-0010-0036-0000 and 0102-0010-0037-0000 (the Site). A Site Locus Map is provided as **Figure 1**. This assessment was prepared in general accordance with the American Society of Testing and Materials (ASTM) Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process (ASTM Designation: E1527-13), All Appropriate Inquiry (AAI) except as stated specifically herein or in the Significant Data Gaps section of this report. Work was conducted in accordance with VHB's Proposal for services between VHB and the Client dated March 21, 2014. This report contains all of the limitations inherent in these methodologies in addition to those limitations presented in **Appendix A** of this report. No other warranties, expressed or implied, are made as to the professional services provided under the terms of our contract and included in this report.

1.1 Purpose

The purpose of the Phase I ESA was to identify, to the extent feasible, recognized environmental conditions in connection with the property. This assessment included a site reconnaissance as well as research and interviews with representatives of public agencies, property management firms/ agencies, and regulatory agencies as noted herein.

1.2 Scope of Services

The scope of work for this assessment was in general accordance with the American Society of Testing and Materials (ASTM) Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process (ASTM Designation: E1527-13), All Appropriate Inquiry (AAI) except as stated specifically herein or in the Significant Data Gaps section of this report. Work was conducted in accordance with the Proposal for Services between VHB and the Client dated March 21, 2014. In preparation of the Phase I Environmental Site Assessment, it is assumed that information provided within the Environmental Database, regulatory agency

records, municipal agency records, as well as information obtained from the user is accurate.

1.3 Significant Assumptions

While this report provides an overview of potential environmental concerns, both past and present, the environmental assessment is limited by the availability of information at the time of the assessment. It is possible that unreported disposal of waste or illegal activities impairing the environmental status of the property may have occurred which could not be identified. The conclusions and recommendations regarding environmental conditions that are presented in this report are based on a scope of work authorized by the Client. Note, however, that virtually no scope of work, no matter how exhaustive, can identify all contaminants or all conditions above and below ground.

1.4 Limitations and Exceptions

The report has been prepared in accordance with generally accepted environmental methodologies referred to in ASTM 1527-13, and contains all of the limitations inherent in these methodologies in addition to those limitations presented in **Appendix A** of this report. No other warranties, expressed or implied, are made as to the professional services provided under the terms of our contract and included in this report. This Phase I ESA is limited to Parcel IDs 0102-0010-0036-0000 and 0102-0010-0037-0000 as identified by the City of Meriden's Tax Assessor's Office.

The conclusions of this report are based in part, on the information provided by others. The possibility remains that unexpected environmental conditions may be encountered at the Site in locations not specifically investigated, or for which state records are incomplete or missing. Should such an event occur, VHB must be notified in order that we may determine if modifications to the conclusions are necessary.

The services performed and outlined in this report were based, in part, upon visual observations of the Site and associated structures. The opinion(s) presented herein cannot be extended to portions of the Site that were unavailable for direct observation and were reasonably beyond the control of VHB.

The objective of this report was to assess environmental conditions at the Site, within the context of our contract and existing environmental regulations within the applicable jurisdiction. Evaluating compliance of past or future owners with applicable local, provincial and federal government laws and regulations was not included in our contract for services.

Our observations relating to the condition of environmental media at the Site are described in this report. It should be noted that compounds or materials other than those described could be present in the Site environment.

1.5 Special Terms and Conditions

No special terms and conditions were applied to this project. Project limitations are provided in **Appendix A**.

1.6 User Reliance

This report may be distributed and relied upon by the Client, its successors and assigns. Reliance on the information and conclusions in this report by any other person or entity is not authorized without the written consent of VHB. VHB assumes no liability for use of this report by any person or entity other than the Client, for which it was prepared.

2.0 Site Description

2.1 Location and Legal Description

The Site consists of two lots located at 84-88 Grove Street in Meriden, Connecticut and the lots are further identified as the City of Meriden Tax Assessor's Parcel ID 0102-0010-0036-0000 and 0102-0010-0037-0000. Lot 0102-0010-0036-0000 is approximately 0.21 acres in size. Lot 0102-0010-0037-0000 is approximately 0.10 acres in size. The combined acreage of the two lots is approximately 0.31 acres. The Site is bounded on the north by a residential property, on the south by a residential property, on the east by Grove Street and beyond by the Saint Mary School and a parking lot, and to the west by a residential property. The current owner of the Site is listed as the City of Meriden. The Site is zoned as Two- or Three-Family Residential District (R-2). A Site Plan is depicted in **Figure 2**.

2.2 Site and Vicinity General Characteristics

According to the City of Meriden GIS tool, the Site is zoned as Two- or Three-Family Residential District (R-2). The Site is surrounded by a combination of transit-oriented development and commercial properties. The areas to the north, the south and the west of the Site are zoned as Site is zoned as Two- or Three-Family Residential District (R-2). The areas to the east of the Site are zoned as Transit-Oriented Development – Historic/ Commercial (TOD – Historic/ Commercial).

2.3 Current Use(s) of the Property

The property is currently vacant. Specific historic tenant uses are described in **Section 4.4**.

2.4 Structures, Roads, and Other Improvements on the Site

There are currently no buildings on the Site. There are no paved areas of the Site. The ground surface of the Site is completed with grass.

2.5 Current Uses of Adjoining Properties

The current adjoining property uses are:

Adjoining Properties	
North	Residential properties
South	Residential properties
East	School and parking garage
West	Residential properties

3.0 User Provided Information

The User of this Phase I ESA is the City of Meriden. As such, they are subject to the terms, conditions and limitations referenced herein and as issued in connection with the Agreement and the provisions thereof. Any use or reliance upon information provided in this report, without the specific written authorization of VHB, shall be at the Users' sole risk. Ms. Juliet Burdelski provided information on behalf of the User relative to this Phase I ESA.

3.1 Title Records

VHB is not aware of any title company or professional engaged by the Client to review recorded land title records and lien records.

3.2 Environmental Liens or Activity and Use Limitations

VHB was not informed by the Client of any environmental clean-up liens, engineering controls, land use restrictions or institutional controls against the property that are filed or recorded under federal, tribal, state or local law.

3.3 Specialized Knowledge

The Client does not have any specialized knowledge or experience related to the property or nearby properties.

3.4 Commonly Known or Reasonable Ascertainable Information

The Client has not provided VHB with any commonly known or reasonable ascertainable information.



3.5 Valuation Reduction for Environmental Issues

The Client has provided no information regarding valuation reduction for environmental issues associated with the Site.

3.6 Owner, Property Manager and Occupant Information

The property owner information was obtained from the Client and confirmed at the City of Meriden Tax Assessor's Office.

3.7 Reason for Performing Phase I ESA

The Phase I ESA was performed in support of potential brownfields redevelopment activities.

3.8 Other/Previous Environmental Reports

VHB was not provided with any additional environmental reports pertaining to the Site.

4.0 Records Review

The purpose of the records review was to obtain and review records that will help identify recognized environmental conditions in connection with the properties. Some records reviewed pertained not only to the properties, but also to properties within an additional approximate minimum search distance in order to help assess the likelihood of problems from migrating hazardous substances or petroleum products. Unless stated otherwise the approximate minimum search distances used below were as specified in the ASTM Standard 1527-13.

4.1 Standard Environmental Records

A search of available federal and state environmental records was obtained from Environmental Data Resources, Inc. (EDR) of Milford, Connecticut on April 10, 2014. A copy of this search is provided in **Appendix B**. While it is not possible for VHB to verify the accuracy and/ or completeness of information contained in the database report and the files reviewed, the use and reliance of this information is an accepted practice in the performance of environmental assessments and due diligence reviews.

A summary of the regulatory information from the database search is provided in the Federal and State sections below.



4.1.1 Federal Environmental Records

Record Source	Search Radii	Subject Property Listed	Number Sites Within Search Distance
Federal National Priorities List (NPL) Sites	1.0 mile	No	0
Federal Delisted NPL Sites	0.5 miles	No	0
Federal CERCLIS Sites	0.5 miles	No	1
Federal CERCLIS NFRAP Sites	Property & Abutting	No	0
Federal RCRA CORRACTS Sites	1.0 mile	No	2
Federal RCRA Non-CORRACTS TSD Sites	0.5 miles	No	1
Federal RCRA Generators	Property & Abutting	No	0
Federal Engineering/Institutional Control Sites	Property & Abutting	No	0
Federal Emergency Release Notification System (ERNS)	Property	No	N/A



4.1.2 State Environmental Records

Record Source	Search Radii	Subject Property Listed	Number Sites Within Search Distance
State and Tribal Equivalent CERCLIS Sites	1.0 miles	No	27
State and Tribal Landfill or Solid Waste Disposal Sites	0.5 miles	No	0
State and Tribal Leaking Storage Tank Sites	0.5 miles	No	15
State and Tribal Registered Storage Tank Sites (UST)	Property & Abutting	No	1
State and Tribal Engineering/Institutional Control Sites	Property	No	0
State and Tribal Voluntary Cleanup Sites	0.5 miles	No	3
State and Tribal Brownfield Sites	0.5 miles	No	2



4.1.3 Summary of State and Federal File Records for Subject Property

VHB reviewed relevant files at the CTDEEP for the Site and other relevant properties on April 17, 2014. The Site was not identified in any of the databases in the EDR Report dated April 10, 2014.

VHB also reviewed the CTDEEP List of Contaminated or Potentially Contaminated Sites (CPCS) and the List of Significant Environmental Hazards Reported to the CTDEEP. The Site was not listed on the CPCS. There is an abundance of properties listed in the City of Meriden. VHB reviewed the list to determine if any of the listed properties had the potential to impact the subject Site. A copy of the CTDEEP CPCS for Meriden is included in **Appendix C**. The Site was not listed as a Significant Environmental Hazard. There were no Significant Environmental Hazards listed for

the City of Meriden. A copy of the List of Significant Environmental Hazards Reported to the CTDEEP is included in **Appendix D**.



4.1.4 Summary of State and Federal File Records for Sites within Search Radii

Based upon a review of the surrounding properties in the EDR Report, the distance and the likely direction of groundwater flow in the vicinity of the Site, and the regulatory status of any petroleum and/ or hazardous material releases, none of these properties appear to present a significant environmental hazard to the Site.

4.2 Additional Record Sources

For historical information, VHB visited the Meriden City Hall, reviewed aerial photographs, historic Sanborn Maps, topographic maps, historic city directories, and interviewed people knowledgeable of the Site as discussed herein. If available/ applicable, we have also incorporated historical information obtained from environmental reports on the Site prepared by others.

Various municipal offices were visited on April 24, 2014 to obtain information regarding Site history and use; zoning; and OHM us, storage, release, and/ or disposal practices that may have occurred at the Site. Information obtained during the review is summarized below.



4.2.1 Assessor's Office

VHB verified the lot information, property owner, and other relevant information at the Tax Assessor's office. The City Clerk's Office is responsible for the land records. Copies of files obtained during the municipal visit are provided in **Appendix C**. Relevant information obtained from the assessor's office and the clerk's office included the following:

Site Address	84 Grove Street
Map ID	0102-0010-0036-0000
Current Owner	City of Meriden

Site Address	88 Grove Street
Map ID	0102-0010-0037-0000
Current Owner	City of Meriden

Some of the chain of title cards and land evidence records appeared out of place or did not have a logical flow of dates and sales. Chain of titles that could be interpreted as logical and relevant are detailed below:



84 Grove Street

Transfer Date	Deed Reference	Grantee
06/06/1997	2269/78	Assembly of Christian Churches of Meriden
04/23/2008	4242-111	City of Meriden

88 Grove Street

Transfer Date	Deed Reference	Grantee
02/18/1987	1378/1	Montada, Angela Montada, Felix Jr.
12/17/1987	1491/216	Montada, Felix Sr.
10/25/1993	1967/130	Montada, Felix Sr.
11/09/1993	1971/273	Montada, Felix Sr. Montada, Felix Jr.
06/01/1994	2026/49	Montada, Felix Sr.
08/18/1994	2043/317	Sousa, Angela
12/02/1994	2065/244	Montada, Senen J.
12/17/1996	2228/135	Montada, Felix Sr.
02/10/1999	2436/268	Assembly of Christian Churches of Meriden
06/29/2005	3604/126	City of Meriden



4.2.2 Building Department/Planning Division

The City of Meriden Building Department receives and reviews applications for permits relating to building, electrical, plumbing, etc. The Planning Division enforces land use regulations relating to zoning, subdivision and wetlands. There was no file available for 84 Grove Street. Copies of files obtained for 88 Grove Street during the municipal visit are provided in **Appendix E**. Relevant information obtained from the Building Department and Planning Division included the following:

84 Grove Street

Zoning	Two- or Three-Family Residential District (R-2)
Date of Construction	Not Applicable
Heat Source	Not Applicable



88 Grove Street

Zoning	Two- or Three-Family Residential District (R-2)
Date of Construction	Prior to 1955
Heat Source	Not Applicable
Of Interest From the File	<ul style="list-style-type: none"> • 2005 – Demolition permit starting in November • 2005 – Asbestos abatement site monitoring in December successfully completed



4.2.3 Water Division

The Water Division is in charge of obtaining, treating, and delivering a public water supply of satisfactory quality under adequate pressure to the residents of Meriden. The water supply includes six surface water reservoirs and six groundwater wells. Relevant information obtained from the Division included the following:

Water Supply	City of Meriden Water Division
Water Source	Six surface water reservoirs and six groundwater wells

VHB spoke to a representative of the Water Division who stated that the Site has been razed; therefore, there is currently no water service at the property.



4.2.4 Public Works Engineering Services

The Engineering Services portion of the Public Works Department is in charge of issuing storm and sanitary sewer permits.

Sewage Disposal	Meriden Sewer
Date of Sewer Connection	Unknown

VHB spoke to a representative of the Water Division who stated that the building has been razed so therefore there is no current sewer connection at the property. The representative was unable to confirm if a prior connection existed and when that connection was originally made.



4.2.5 Fire Marshal's Office

VHB contacted the Fire Marshal for the City of Meriden, Mr. Steve Trella, on April 28, 2014. Mr. Trella informed VHB that there was no folder, and therefore no files, for the Site.



4.2.6 Environmental Health

Mr. Scott Bryden, the Environmental Health Administrator for the City of Meriden, informed VHB that there were a few files for the Site relating to bulky waste and garbage issues.

4.3 Physical Setting Source(s)



4.3.1 Topography

The surface elevation of the Site is approximately 182 feet above the National Geodetic Vertical Datum (Environmental Data Resources FirstSearch Report, April 10, 2014). Topography across the Site, according to topographic maps, generally slopes to the south and to the east. Based on visual observations during the Site inspection, it appears that the topography was altered at the Site during development. The Site is now mainly flat. There is still a building foundation or retaining wall built into the hill on the western side of the Site, indicating original topography.



4.3.2 Soils/Surficial Geology

According to the U.S. Department of Agriculture (USDA) Web Soil Survey Map, the majority of the soil at the Site, approximately 64 percent, is mapped as 263C, or Cheshire-Urban land complex, 8 to 15 percent slopes. This soil type is composed of 40 percent Cheshire and similar soils, 35 percent urban land, and 25 percent minor components. 263C is described as till plains and hills, and is well drained.

The remainder of the soil at the Site is mapped as 287C, or Wethersfield-Urban land complex, 8 to 15 percent slopes. This soil type is composed of 40 percent Wethersfield and similar soils, 35 percent urban land, and 25 percent minor components. 287C is described as hills and drumlins, and is well drained.



4.3.3 Bedrock Geology

According to the Connecticut GIS Data distribution page, the underlying bedrock is characterized as the New Haven Arkose formation. The New Haven Arkose formation consists of reddish, poorly sorted arkose.

During the site reconnaissance, VHB did not observe bedrock outcrops at the Site.



4.3.4 Groundwater

Groundwater in the vicinity of the Site is classified by the CTDEEP as GB. Groundwater resources classified as GB are those whose designated uses are industrial process water and cooling waters and baseflow for hydraulically-connected water bodies, and is presumed not suitable for human consumption without treatment. The nearest GA groundwater classification is located approximately 200 feet to the north/ northwest of the Site. GA groundwater is groundwater whose designated uses are existing private and potential public or private supplies of water suitable for drinking without treatment and baseflow for hydraulically-connected surface water bodies. All ground waters not specifically classified are considered Class GA. The Site does not lie within an aquifer protection area. The nearest aquifer protection area is located approximately 200 feet to the north/ northwest of the Site.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology and characteristics of the soil. Based on topography and hydrology of the area, groundwater flow is expected to be generally to the south and east, towards Harbor Brook.



4.3.5 Wetlands

A wetland survey was not part of the scope of services for this ASTM Phase I Environmental Site Assessment; however, based upon visual observations during the Site reconnaissance, wetland resource areas do not appear to be present at the Site.



4.3.6 Surface Water

Surface water bodies have not been identified on-Site. The closest surface water body, Harbor Brook, is located just approximately 825 feet to the southeast of the Site. According to the CTDEEP Surface Water Quality Classes, Harbor Brook is classified as B. The classification B is considered by the CTDEEP to be waters whose designated uses are "habitat for fish and aquatic life and wildlife; recreation; navigation; and industrial and agricultural water supply."



4.3.7 Flood Plains

According to the Federal Emergency Management Agency Flood Insurance Rate Map for the New Haven County, Connecticut (Community Panel No. 09009C0166H, dated December 17, 2010), the Site is located within Zone X, which is defined as areas determined to be outside the 0.2% annual chance floodplain.



4.3.8 Threatened and Endangered Species

VHB personnel reviewed the CTDEEP Natural Diversity Data Base (NDDB), which identifies general areas of concern with regard to state and federally listed Endangered, Threatened, and Special Concern Species and significant natural communities. The Site is not located in an NDDB area. The NDDB map for the City of Meriden is included in **Appendix F**.

4.4 Historical Use Information on the Property

The objective of consulting historical sources is to develop a history of the previous uses of the properties in order to help identify the likelihood of past uses having led to recognized environmental conditions in connection with the property back to first developed use. VHB reviewed various historical information sources and conducted interviews as described in this report. Typical historical sources include Sanborn Maps, city directories, aerial photographs, topographic and other maps, and municipal records. Based on VHB's research the Site appears to have been first developed in the 1880s. The Site appeared to originally be used for residential purposes and was then developed for commercial purposes on the 84 Grove Street parcel in the 1950s.



4.4.1 Sanborn Maps

Environmental Data Resources, Inc. provided VHB with copies of certified Sanborn Maps for the Site. VHB reviewed the Sanborn Maps for the following years to identify any potential RECs: 1884, 1891, 1896, 1901, 1950, 1953, and 1971. Copies of the maps provided by EDR can be found in **Appendix D**:

Year	Use	Issues Noted	Observations
1884	There is one small building, likely residential, located on the 84 Grove Street parcel.	None noted.	Surrounding: The surrounding area consists of mainly small buildings that appear to be residential.
1891	There are two buildings located on the Site. Neither is labeled, but they appear residential.	None noted.	Surrounding: Same as above.
1896	Same as above.	None noted.	Surrounding: Same as above.
1901	One of the two buildings on Site is now labeled as a tenement.	None noted.	Surrounding: Same as above.
1950	The 84 Grove Street parcel is now completely covered by a building. The front portion of the building is labeled bowling.	None noted.	Surrounding: The St. Mary's School & Covenant has been built to the east of the Site.
1953	Same as above.	None noted.	Surrounding: Same as above.
1971	Same as above.	None noted.	Surrounding: Same as above.



4.4.2 City Directories

EDR provided a City Directory summary in their report prepared as part of this ESA. According to the summary in the EDR report, 84 Grove Street was occupied by commercial tenants from at least 1963 to 1990. The address is no longer listed after the 1990 directory. Tenants of note included Automatic Music Co. Inc. (1963) and Meriden Bowling Alleys (1970-1977). 88 Grove Street was occupied by residential tenants from at least 1963 to 1999. After 1999, the address is no longer listed. A copy of the City Directory search is provided in **Appendix H**.



4.4.3 Aerial Photographs

VHB reviewed aerial photographs dated 1934, 1951-1952, 1965, 1970, 1985-1986, 1990, and 1995 for the Site and vicinity provided by the University of Connecticut Libraries Map and Geographic Information Center. A summary of this review is provided below:

Year	Observations
1934	Site: The 84 Grove Street parcel appears to be vacant. There is one building on the 88 Grove Street parcel. It appears to be residential
	Surrounding: The surrounding area appears to be mostly residential. The building immediately to the south of the Site may be for commercial purposes.
1951-1952	Site: The 84 Grove Street parcel has been developed with a building on the entire parcel. This building appears to be commercial. The 88 Grove Street parcel appears the same as above.
	Surrounding: A large building has been built to the east of the Site across Grove Street. The remainder of the surrounding areas appears the same as in 1934.
1965	Site: Same as above.
	Surrounding: Same as above.
1970	Site: Same as above.
	Surrounding: Same as above.
1985-1986	Site: Same as above.
	Surrounding: Same as above.
1990	Site: Same as above.
	Surrounding: Same as above.



Year	Observations
1995	<p>Site: Same as above.</p> <p>Surrounding: A parking structure appears to have been built to the east of the Site across Grove Street, just south of Church Street.</p>

4.5 Historical Use Information on Adjoining Properties

The objective of consulting historical sources is to develop a history of the previous uses of the surrounding properties in order to help identify the likelihood of past uses having led to recognized environmental conditions in connection with the property. The historical uses of adjoining properties to the Site are summarized below. These uses were determined using the standard historical sources noted above.

- Land to the north of the Site appears to have been developed for residential use since at least 1884.
- Land to the east of the Site has been developed since at least 1884, originally for residential use. In the 1950s, the area was developed as a church/ school. In the 1990s, a parking garage was developed south of Church Street.
- Land to the south of the Site has been developed since at least 1884, originally for residential use. It appears that the Site was developed for commercial use around the same time that the 84 Grove Street parcel was developed for commercial use.
- Land to the west of the Site has been developed since at least 1884 with residential homes.

5.0 Site Reconnaissance

5.1 Methodology and Limiting Conditions

The Site was inspected by Ms. Shelby Miller and Mr. Peter Chiarizio of VHB on April 10, 2014. The weather on April 10, 2014 was sunny and approximately 50 degrees Fahrenheit. No areas of the subject property were inaccessible during the day of the inspection.

During the Site reconnaissance, an exterior inspection of the Site was performed. The exterior of adjoining properties were visually evaluated for any RECs.

5.2 Site Inspection

VHB representatives inspected the Site on April 10, 2014. A Site Plan depicting pertinent Site features is provided as **Figure 2**. Photographs taken during the Site visits are provided in **Appendix I**.



5.2.1 Interior Observations

VHB did not conduct an interior inspection as there are no buildings on the Site.



5.2.2 Exterior Observations

VHB inspected the exterior portions of the Site on April 10, 2014. All exterior portions of the Site were accessible during the Site inspection. In general, exterior areas of the Site were in fair condition. The Site consists of two adjacent vacant lots.

A building foundation or retaining wall is still present in the hillside on the western side of the 84 Grove Street parcel. The foundation appears to be concrete and brick construction. Portions still appear to be painted. There is a chain-link fence along the top of the foundation. Some black material was observed near the top of the foundation wall that appeared to be sealant. The southern property line for 84 Grove Street abuts the building on the adjoining Site.

A stone wall, or partial building foundation, is present on the northern and western sides of the 88 Grove Street parcel. There is a chain-link fence along the top of the wall/ foundation.

The ground surface of the Site is covered with grass. Some solid waste debris such as cups, wrappers, cigarette butts, and plastic bags were observed throughout the Site. It appeared that the debris had collected mostly along the southern portion of the 84 Grove Street parcel.

VHB did not observe any bedrock outcrops during the Site reconnaissance.

The following table identifies specific ASTM conditions of concern that were or were not noted during the exterior inspection and where in this report they are described further.

EXTERIOR INSPECTION			
Condition	Observed		Further Described
	Yes	No	
Hazardous Substances or Petroleum Products in Containers		X	Report Section 5.3.1
Unidentified Substances in Containers		X	Report Section 5.3.1
Storage Tanks		X	Report Section 5.3.2
Wastewater/Storm Water Discharges		X	Report Section 5.3.3
Catch Basins		X	Report Section 5.3.3
Septic Systems/Cesspools		X	Report Section 5.3.3
Wells (Drinking Water, Monitoring, Etc.)		X	Report Section 5.3.3
Odors (strong, pungent, noxious)		X	Report Section 5.3.4
Pools of Liquid		X	Report Section 5.3.5
Potential PCB Containing Equipment		X	Report Section 5.3.6
Pits, Ponds, Lagoons		X	Report Section 5.3.7
Stained Soil or Pavement		X	Report Section 5.3.8
Stressed Vegetation		X	Report Section 5.3.9
Solid Waste/Debris	X		Report Section 5.3.10

5.3 Summary of Environmental Site Features



5.3.1 Hazardous Substances and Petroleum Products (Drums and Other Containers)

VHB did not observe any evidence of storage of petroleum products or hazardous substances at the Site at the time of the Site inspection.



5.3.2 Underground and Aboveground Storage Tanks

VHB did not observe any evidence of aboveground or underground storage tanks at the time of the Site inspection.



5.3.3 Wells, Drywells (Underground Injection Control), Floor Drains, Sumps, Manholes and Catch Basins

VHB did not observe any wells, drywells, manholes or catch basins on the property at the time of the Site inspection.

VHB did observe one catch basin on the eastern side of the Site, beyond the property line in Grove Street.



5.3.4 Odors

No unusual odors were noted during the Site inspections on April 10, 2014.



5.3.5 Pools of Liquid

VHB did not observe any pools of liquid at the time of the Site inspection.



5.3.6 Polychlorinated Biphenyls (PCBs)

PCBs were used until 1978 and are a group of compounds formed by the chlorination of biphenyl. PCBs have extremely high physical and chemical stabilities which led to their being used in many applications, including heat transfer fluids, hydraulic fluids, and dielectrics. PCBs are often found in transformers, capacitors and hydraulic systems. PCBs were also added as a plasticizer in caulking used to seal joints between masonry units and around windows, in addition to other building materials such as paints, mastics, sealants, adhesives, and specialty coatings. According to the U.S. EPA PCBs were used in some buildings primarily between 1950 and 1980.

Electrical equipment containing PCBs are still in use and can pose a serious health hazard if fluids come in direct contact with humans, soil or groundwater. Fires involving electrical equipment containing PCBs can cause the material to be dispersed over a large area and potentially expose many people to a health risk. Because of the health hazard associated with PCBs, they are regulated under the Toxic Substances Control Act ("TSCA"), and sometimes by state agencies.

While there is no building currently standing at the Site, it is possible that due to the age of the former building, some PCB impacted building materials may still be present at the Site if demolition debris was buried at the Site. The disposal of PCB impacted building materials resulting from renovation or demolition activities may be subject to federal and State regulations.

The Site inspection did not identify the presence of any transformers, hydraulic or other equipment at the Site.



5.3.7 Pits, Ponds and Lagoons

No pits, ponds, or lagoons were observed at the Site during the Site inspection.



5.3.8 Staining – Exterior Soil and Pavement

VHB did not observe any staining of surficial soils at the Site on April 10, 2014.



5.3.9 Stressed Vegetation

No stressed vegetation was noted at the Site during the Site inspection.



5.3.10 Solid Waste, Debris and Disposal

VHB observed several areas of debris on the Site, specifically along the southern property line of the 84 Grove Street parcel. The debris appeared to be litter from passersby including fast food packaging, cigarette butts, bottles, cans and plastic bags.

6.0 Non-Scope Considerations

6.1 Lead-Based Paint (LBP)

In 1978, the U.S. Product Safety Commission issued a ban on paints or surface coatings that contain greater than 0.06 percent lead. Many structures built before 1978 have paint that contains lead (LBP). Lead from paint, chips, and dust can pose serious health hazards if not taken care of properly.

While there is no building currently standing at the Site, it is possible that due to the age of the former building, some LBP may have been used during the construction. If not properly handled at the time of the building demolition, it is possible that LBP remnants may still be present at the Site. The disposal of lead paint waste resulting from renovation or demolition activities may be subject to federal and State regulations and the User is advised that prior to building renovations they should retain an expert to evaluate any previously unevaluated areas (such as the basements) and advise beforehand on how to demolish, dispose of, and renovate LBP.

6.2 Asbestos-Containing Materials

Asbestos is the name given to a group of fibrous silicate minerals, typically those of the serpentine group. The tensile strength, flexibility, and non-flammability of asbestos have led to many uses including structural materials, brake linings, insulation, and pipe manufacture. Asbestos is of concern as an air pollutant because when inhaled it may cause asbestosis, mesothelioma, and bronchogenic carcinoma. The 1973 National Emission Standards for Hazardous Air Pollutants partially banned the use of spray-applied asbestos containing building materials (ACBM) in new buildings. The government expanded these regulations in 1975 and 1978 to ban the use of all types of ACBM in new buildings. In 1989, the USEPA announced regulations that would phase out most uses of asbestos by 1996.

Based on information obtained from the building department, asbestos was present in the former Site building. As part of demolition activities, asbestos abatement activities were successfully implemented at the Site.

7.0 Interviews

7.1 Interview with Owner

The Site is currently owned by the City of Meriden, who is also the Client. VHB did not specifically interview the City of Meriden; however, discussions about the property with Ms. Juliet Burdelski occurred via phone calls and emails.

7.2 Interview with Site Manager/Occupants

The Site is currently vacant, therefore there is no Site Manager and there are no Site Occupants.

7.3 Interviews with Local Government Officials

Local government officials were contacted through the municipal office research although not specifically interviewed. Information obtained from the officials is included in the municipal file review portion (**Section 4.2**) of this report.

8.0 Findings

The results of this assessment have revealed the following known or suspect **recognized environmental conditions (RECs)** associated with the subject property:

- Historic presence and demolition of a building potentially finished with lead-based paint (LBP).

The results of this assessment have not revealed any known **controlled recognized environmental conditions (CRECs)** associated with the subject property.

The results of this assessment have not revealed any known **historical recognized environmental conditions (HRECs)** associated with the subject property:

The results of this assessment have not revealed any **de minimis conditions** associated with the subject property. Note that while de minimis conditions must be indicated under the ASTM guidance, they are *not* considered RECs.

Legal consultation is recommended to confirm the Site's status relative to the Transfer Act. No automatic or threshold hazardous waste indicators were identified as part of this study.

9.0 Opinion

It is VHB's opinion that the Phase I Environmental Site Assessment identified conditions indicative of releases or threatened releases of petroleum, hazardous substances, and/ or hazardous materials to soil, groundwater, and soil gas at the Site. This opinion is based on the history of commercial activities conducted at the Site, and the demolition of a multi-story commercial building constructed prior to 1980s which likely contained hazardous building materials such as lead-based paint (LBP).

A Phase II Environmental Site Assessment is recommended to assess the quality of the surficial soils and groundwater at the Site.

10.0 Conclusions

We have performed a Phase I Environmental Site Assessment in general conformance with the scope and limitations of ASTM Practice E 1527-13, the scope of work outlined in our proposal to the Client, and the limitations provided in the text of this report and Appendix A on the property located at 84-88 Grove Street in Meriden, Connecticut as described in **Section 1** of the report. Any exceptions to, or deletions from, this practice are described in **Section 11** of this report.

During this Phase I Environmental Site Assessment, VHB has identified recognized environmental conditions at the Site.

11.0 Data Gaps/Deviations

Based upon VHB's research in an attempt to satisfy all the requirements set forth in the above-referenced standards, the following data gaps were encountered:

- VHB did not interview the previous property owners.

12.0 Signature of Environmental Professionals

VHB, declares that, to the best of its professional knowledge and belief, that Peter J. Chiarizio meets the definition of “Environmental Professional” as set forth in 312.10 of 40 CFR 312 and he/ she has the specific qualifications based on education, training and experience to assess a property with respect to the nature, history and setting of the subject property.

VHB has developed and performed the “All Appropriate Inquiries” in conformance with the standards and practices set forth in 40 CFR Part 312, except as otherwise noted in Section 10.0 and elsewhere in this report. Section 10.0 contains specific data gaps and deviations of the research data identified by VHB during preparation of this report and **Appendix A** contains limitations to the work performed by VHB associated with this assessment.

I have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

I declare that, to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined in 312.10 of this part.

Environmental Professional:



Peter J. Chiarizio, LEP

Date

13.0 References

Connecticut Department of Energy and Environmental Protection, Aquifer Protection Areas - Meriden, CT Map, April 2014.

Connecticut Department of Energy and Environmental Protection, List of Contaminated or Potentially Contaminated Sites, April 2014.

Connecticut Department of Energy and Environmental Protection, List of Significant Environmental Hazards Reported to the DEP, April 2014.

Connecticut Department of Energy and Environmental Protection, Natural Diversity Data Base Maps - Meriden, CT Map, April 2014.

Connecticut Department of Energy and Environmental Protection, Water Quality Classifications - Meriden, CT Map, April 2014.

Environmental Data Resources, Inc. Certified Sanborn® Map Report (No. 3907845.17), April 10, 2014.

Environmental Data Resources, Inc. City Directory Image Report (No. 3907845.19), April 11, 2014.

Environmental Data Resources, Inc. FirstSearch Report (No. 3907845.16s), April 10, 2014.

Federal Emergency Management Agency Flood Insurance Rate Map, New Haven County, Connecticut, Community Panel No. 09009C0166H, December 17, 2010.

Meriden Building Division, April 2014.

Meriden City Clerk, April 2014.

Meriden Health and Human Services, April 2014.

Meriden Neighborhood Preservation Program, April 2014.

Meriden Planning Division, April 2014.

Meriden Public Works, April, 2014.



Meriden Tax Assessor, April 2014.

United States Department of Agriculture & Natural Resources Conservation Service,
Soil Survey of the State of Connecticut, 2003.

University of Connecticut – Connecticut GISData, Connecticut Bedrock Geology –
Polygon Features Map, 2000.



Figures

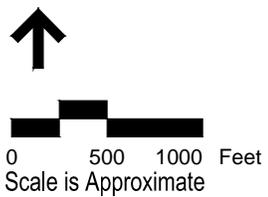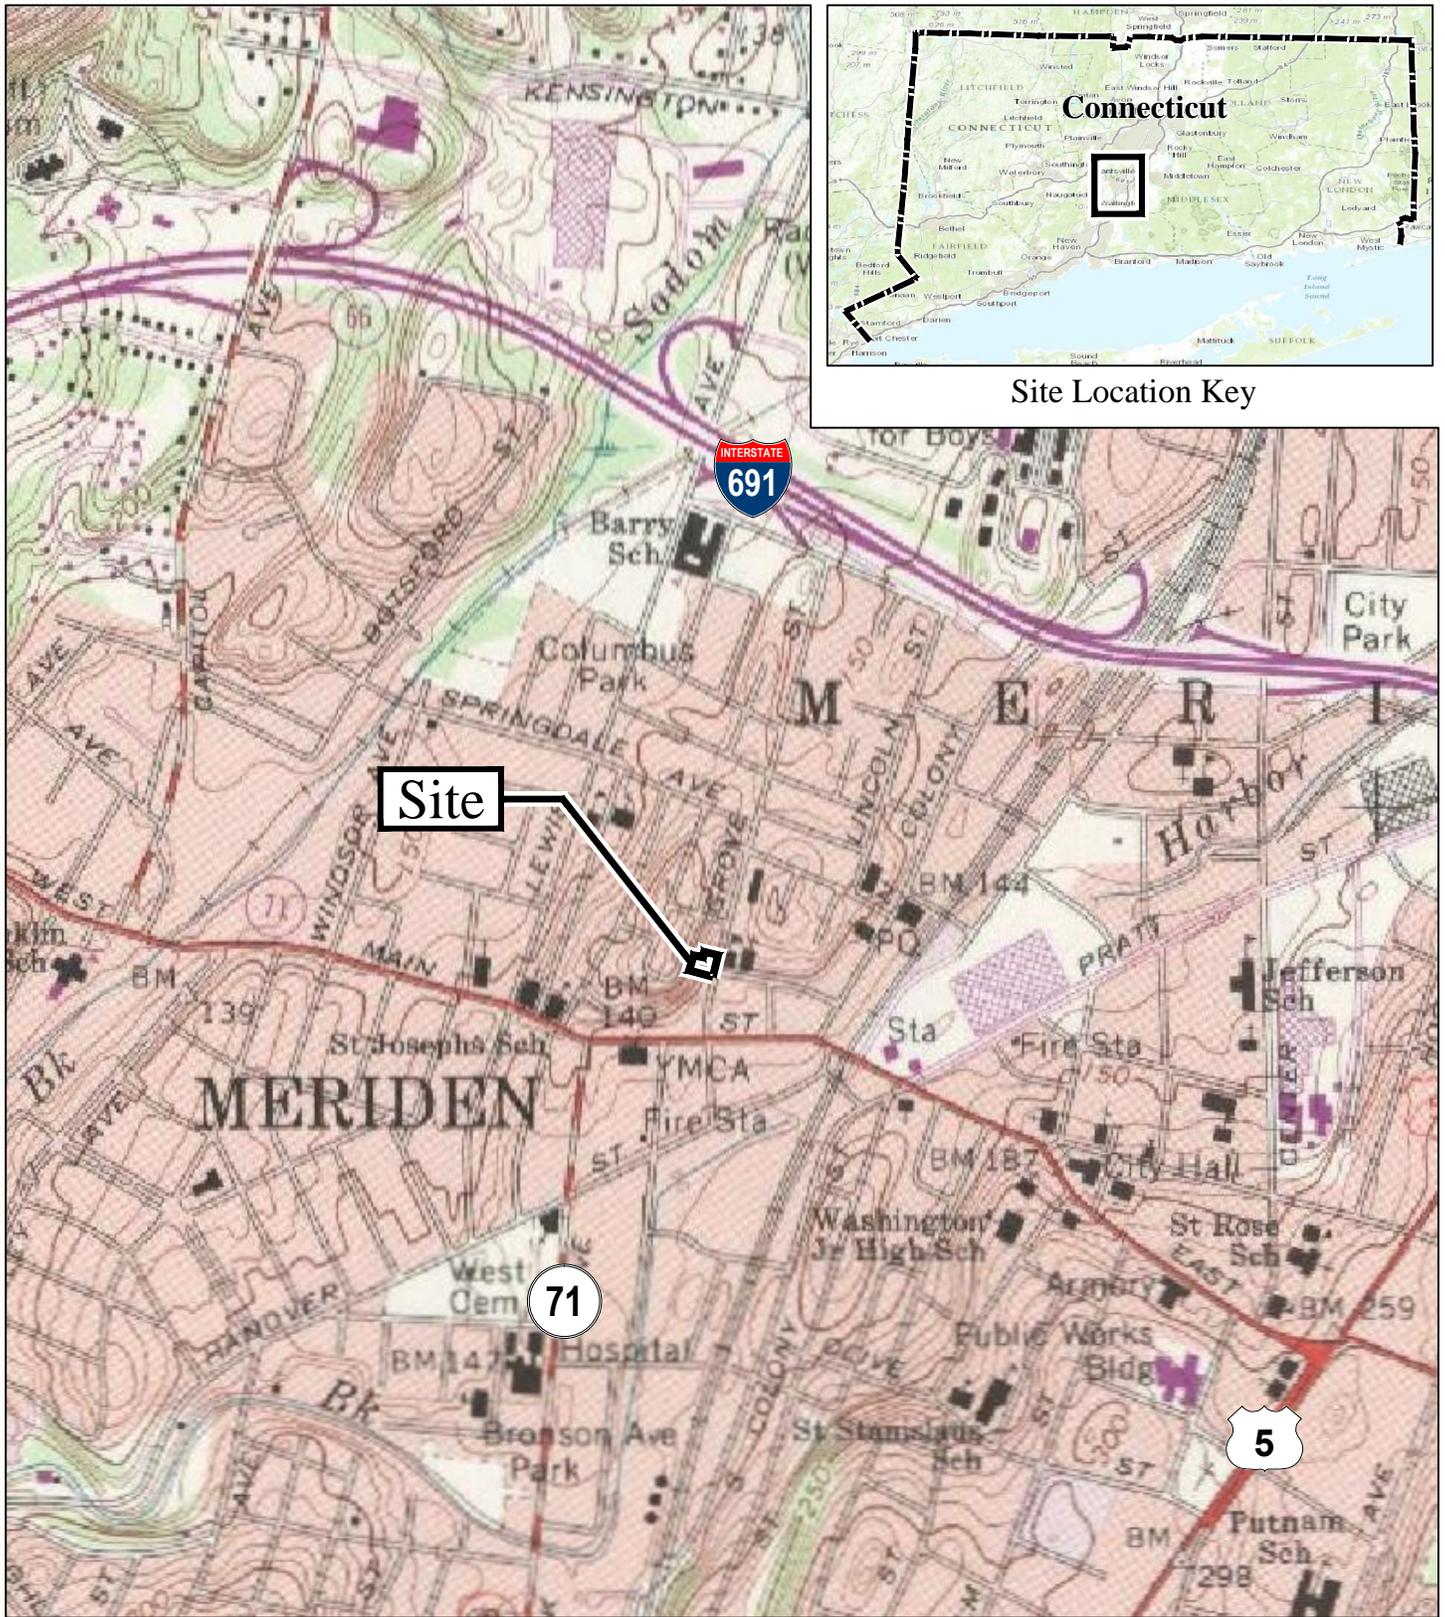

Site Location Map
88 Grove Street
Meriden, Connecticut


Vanasse Hangen Brustlin, Inc.

Figure 1
April 2014



Source: 2012 CTECO Aerial Photography

Vanasse Hangen Brustlin, Inc.

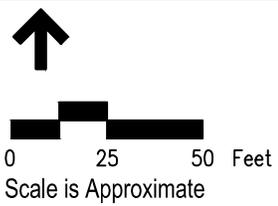

Site Plan
88 Grove Street
Meriden, Connecticut

Figure 2



Appendix A: Limitations



Limitations



**84-88 Grove Street
Meriden, CT**

The City of Meriden (the Client) engaged Vanasse Hangen Brustlin, Inc. (VHB) to conduct a Phase I Environmental Site Assessment (ESA) of the two vacant lots identified by the City of Meriden Tax Assessor's Office as Parcel ID 0102-0010-0036-0000 and 0102-0010-0037-0000 (the Site). This assessment was prepared in general accordance with the American Society of Testing and Materials (ASTM) Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process (ASTM Designation: E1527-13), All Appropriate Inquiry (AAI) except as stated specifically herein or in the Significant Data Gaps section of this report. No other warranties, expressed or implied, are made as to the professional services provided under the terms of our contract and included in this report.

- In conducting this assessment, VHB has obtained and relied upon information from multiple sources to form certain conclusions regarding potential environmental issues at and in the vicinity of the subject property. Except as otherwise noted, no attempt has been made to verify the accuracy or completeness of such information.
- The objectives of the assessment described in this report were to assess the physical characteristics of the subject property with respect to overt evidence of past or present use, storage, and/ or disposal of oil or hazardous materials, as defined in applicable state and federal environmental laws and regulations, and to gather information regarding current and past operations and environmental conditions at and in the vicinity of the subject property.
- Where access was denied or conditions obscured, VHB makes no report on such areas.
- No attempt has been made to assess the compliance status of any past or present Owner or Operator of the Site with any federal, state, or local laws or regulations.
- The findings, observations, and conclusions presented in this report are limited by the scope of services outlined in our Proposal between VHB and the Client dated March 21, 2014. No other warranties, expressed or implied, are made as to the professional services provided under the terms of our contract and as included in this report.



- The assessment presented in this report is based solely upon information gathered to date. Should further environmental or other relevant information be developed at a later date, the Client should bring the information to the attention of VHB as soon as possible. Based upon an evaluation, VHB may modify the report and its conclusions.

- The EDR was conducted under the Notice of Disclaimer/ Waiver of Liability included in the summary report.

■

Appendix B: Environmental Data Resources, Inc. (EDR) FirstSearch Report

88 Grove Street
88 Grove Street
Meriden, CT 06451

Inquiry Number: 3907845.16s
April 10, 2014

FirstSearch Report

Search Summary Report

**TARGET SITE 88 GROVE STREET
MERIDEN, CT 06451**

Category	Sel	Site	1/8	1/4	1/2	> 1/2	ZIP	TOTALS
<i>NPL</i>	Y	0	0	0	0	0	0	0
<i>NPL Delisted</i>	Y	0	0	0	0	0	0	0
<i>CERCLIS</i>	Y	0	0	0	1	-	0	1
<i>NFRAP</i>	Y	0	0	0	1	-	0	1
<i>RCRA COR ACT</i>	Y	0	0	0	1	1	0	2
<i>RCRA TSD</i>	Y	0	0	0	1	-	0	1
<i>RCRA GEN</i>	Y	0	0	0	-	-	0	0
<i>Federal IC / EC</i>	Y	0	0	0	0	-	0	0
<i>ERNS</i>	Y	0	-	-	-	-	0	0
<i>State/Tribal CERCLIS</i>	Y	0	1	3	7	16	7	34
<i>State/Tribal SWL</i>	Y	0	0	0	0	-	0	0
<i>State/Tribal LTANKS</i>	Y	0	0	5	10	-	3	18
<i>State/Tribal Tanks</i>	Y	0	2	7	-	-	1	10
<i>State/Tribal IC / EC</i>	Y	0	0	0	0	-	0	0
<i>State/Tribal VCP</i>	Y	0	0	1	2	-	0	3
<i>ST/Tribal Brownfields</i>	Y	0	0	0	2	-	0	2
<i>US Brownfields</i>	Y	0	1	4	7	-	1	13
<i>Other Haz Sites</i>	Y	0	-	-	-	-	0	0
<i>Local Land Records</i>	Y	0	1	2	-	-	0	3
<i>Spills</i>	Y	0	-	-	-	-	0	0
<i>Other</i>	Y	0	4	26	-	-	11	41
- Totals --		0	9	48	32	17	23	129

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2014 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Search Summary Report

**TARGET SITE: 88 GROVE STREET
MERIDEN, CT 06451**

Category	Database	Update	Radius	Site	1/8	1/4	1/2	> 1/2	ZIP	TOTALS
NPL	NPL	10/25/2013	1.000	0	0	0	0	0	0	0
	Proposed NPL	10/25/2013	1.000	0	0	0	0	0	0	0
NPL Delisted	Delisted NPL	10/25/2013	1.000	0	0	0	0	0	0	0
CERCLIS	CERCLIS	10/25/2013	0.500	0	0	0	1	-	0	1
NFRAP	CERC-NFRAP	10/25/2013	0.500	0	0	0	1	-	0	1
RCRA COR ACT	CORRACTS	03/11/2014	1.000	0	0	0	1	1	0	2
RCRA TSD	RCRA-TSDF	03/11/2014	0.500	0	0	0	1	-	0	1
RCRA GEN	RCRA-LQG	03/11/2014	0.250	0	0	0	-	-	0	0
	RCRA-SQG	03/11/2014	0.250	0	0	0	-	-	0	0
	RCRA-CESQG	03/11/2014	0.250	0	0	0	-	-	0	0
Federal IC / EC	US ENG CONTROLS	12/17/2013	0.500	0	0	0	0	-	0	0
	US INST CONTROL	12/17/2013	0.500	0	0	0	0	-	0	0
ERNS	ERNS	09/30/2013	TP	0	-	-	-	-	0	0
State/Tribal CERCLIS	SHWS	04/23/2010	1.000	0	0	0	1	0	0	1
	SDADB	04/23/2010	1.000	0	1	3	6	16	7	33
State/Tribal SWL	SWF/LF	08/14/2013	0.500	0	0	0	0	-	0	0
State/Tribal LTANKS	LUST	02/11/2014	0.500	0	0	5	10	-	3	18
	INDIAN LUST	02/01/2013	0.500	0	0	0	0	-	0	0
State/Tribal Tanks	UST	03/03/2014	0.250	0	2	7	-	-	1	10
	AST	07/01/2013	0.250	0	0	0	-	-	0	0
	INDIAN UST	02/01/2013	0.250	0	0	0	-	-	0	0
State/Tribal IC / EC	AUL	02/11/2014	0.500	0	0	0	0	-	0	0
State/Tribal VCP	VCP	02/11/2014	0.500	0	0	1	2	-	0	3
ST/Tribal Brownfields	BROWNFIELDS	10/22/2013	0.500	0	0	0	2	-	0	2

Search Summary Report

**TARGET SITE: 88 GROVE STREET
MERIDEN, CT 06451**

Category	Database	Update	Radius	Site	1/8	1/4	1/2	> 1/2	ZIP	TOTALS
US Brownfields	US BROWNFIELDS	03/20/2014	0.500	0	1	4	7	-	1	13
Other Haz Sites	US CDL	12/04/2013	TP	0	-	-	-	-	0	0
Local Land Records	CT PROPERTY	02/11/2014	0.250	0	1	2	-	-	0	3
Spills	HMIRS	12/31/2013	TP	0	-	-	-	-	0	0
	SPILLS	01/28/2014	TP	0	-	-	-	-	0	0
	SPILLS 90	10/15/2012	TP	0	-	-	-	-	0	0
Other	RCRA NonGen / NLR	03/11/2014	TP	0	-	-	-	-	0	0
	TRIS	12/31/2011	TP	0	-	-	-	-	0	0
	TSCA	12/31/2006	TP	0	-	-	-	-	0	0
	FTTS	04/09/2009	TP	0	-	-	-	-	0	0
	SSTS	12/31/2009	TP	0	-	-	-	-	0	0
	ICIS	07/20/2011	TP	0	-	-	-	-	0	0
	PADS	06/01/2013	TP	0	-	-	-	-	0	0
	MLTS	07/22/2013	TP	0	-	-	-	-	0	0
	RADINFO	01/09/2014	TP	0	-	-	-	-	0	0
	FINDS	11/18/2013	TP	0	-	-	-	-	0	0
	RAATS	04/17/1995	TP	0	-	-	-	-	0	0
	LWDS	07/17/2009	0.250	0	0	0	-	-	0	0
	MANIFEST	07/30/2013	0.250	0	3	22	-	-	7	32
	INDIAN RESERV	12/31/2005	1.000	0	0	0	0	0	0	0
	CPCS	01/30/2014	0.250	0	1	4	-	-	4	9
	PRP	04/15/2013	TP	0	-	-	-	-	0	0
US AIRS	10/23/2013	TP	0	-	-	-	-	0	0	
	- Totals --			0	9	48	32	17	23	129

Site Information Report

Request Date: APRIL 10, 2014
Request Name: SHELBY MILLER

Search Type: COORD
Job Number: 81649.14

Target Site: 88 GROVE STREET
 MERIDEN, CT 06451

Site Location

	<u>Degrees (Decimal)</u>	<u>Degrees (Min/Sec)</u>	<u>UTMs</u>
Longitude:	72.804800	72.8048000 - 72° 48' 17.28"	Easting: 683117.1
Latitude:	41.539300	41.5393000 - 41° 32' 21.48"	Northing: 4600741.5
Elevation:	182 ft. above sea level		Zone: Zone 18

Demographics

Sites: 106	Non-Geocoded: 23	Population: N/A		
RADON				
Federal EPA Radon Zone for NEW HAVEN County: 1				
Note: Zone 1 indoor average level > 4 pCi/L. : Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L. : Zone 3 indoor average level < 2 pCi/L.				

Federal Area Radon Information for NEW HAVEN COUNTY, CT				
Number of sites tested: 1286				
<u>Area</u>	<u>Average Activity</u>	<u>% <4 pCi/L</u>	<u>% 4-20 pCi/L</u>	<u>% >20 pCi/L</u>
Living Area	1.070 pCi/L	89%	10%	1%
Basement	1.900 pCi/L	78%	20%	2%

Federal Area Radon Information for NEW HAVEN COUNTY, CT				
Number of sites tested: 158				
<u>Area</u>	<u>Average Activity</u>	<u>% <4 pCi/L</u>	<u>% 4-20 pCi/L</u>	<u>% >20 pCi/L</u>
Living Area - 1st Floor	2.083 pCi/L	83%	17%	0%
Living Area - 2nd Floor	1.200 pCi/L	100%	0%	0%
Basement	2.470 pCi/L	84%	16%	0%

Site Information Report

RADON

State Database: CT Radon

Radon Test Results

City	# Sites	< 4 Pci/L	4 < 10 Pci/L	10 < 20 Pci/L	20 < 50 Pci/L	50 < 100 Pci/L	> 100 Pci/L
Wallingford	100	90 (90)	10 (10)	0 (0)	0 (0)	0 (0)	0 (0)
Waterbury	20	19 (95)	1 (5)	0 (0)	0 (0)	0 (0)	0 (0)
West Haven	14	14 (93.3)	1 (6.7)	0 (0)	0 (0)	0 (0)	0 (0)
Wolcott	7	3 (42.9)	4 (57.1)	0 (0)	0 (0)	0 (0)	0 (0)
Woodbridge	126	79 (62.7)	32 (25.4)	9 (7.1)	4 (3.2)	1 (.8)	0 (0)
Yalesville	3	3 (100)	0 (0)	0 (0)	0 (0)	0 (0)	0 (0)
Ansonia	110	62 (56.4)	29 (26.4)	8 (7.3)	10 (1)	1 (9)	0 (0)
Beacon Falls	4	3 (75)	1 (25)	0 (0)	0 (0)	0 (0)	0 (0)
Bethany	3	2 (66.7)	1 (33.3)	0 (0)	0 (0)	0 (0)	0 (0)
Branford	196	126 (64.3)	40 (20.4)	13 (6.6)	14 (7.1)	13 (1.5)	0 (0)
Cheshire	16	10 (62.5)	4 (25)	2 (12.5)	0 (0)	0 (0)	0 (0)
Derby	11	4 (36.4)	6 (54.6)	1 (9)	0 (0)	0 (0)	0 (0)
East Haven	27	22 (81.5)	4 (14.8)	1 (3.7)	0 (0)	0 (0)	0 (0)
Guilford	138	95 (68.8)	22 (15.9)	13 (9.4)	7 (5.1)	0 (0)	1 (.7)
Hamden	39	29 (74.4)	10 (25.6)	0 (0)	0 (0)	0 (0)	0 (0)
Madison	133	84 (63.2)	32 (24)	9 (6.8)	6 (4.5)	2 (1.5)	0 (0)
Meriden	97	76 (78.4)	19 (19.6)	1 (1)	0 (0)	0 (0)	1 (1)
Middlebury	5	5 (100)	0 (0)	0 (0)	0 (0)	0 (0)	0 (0)
Milford	20	15 (.75)	4 (20)	1 (5)	0 (0)	0 (0)	0 (0)
Naugatuck	9	8 (88.9)	1 (11.1)	0 (0)	0 (0)	0 (0)	0 (0)
New Haven	21	16 (76.2)	5 (23.8)	0 (0)	0 (0)	0 (0)	0 (0)
North Branford	13	11 (84.6)	2 (15.4)	0 (0)	0 (0)	0 (0)	0 (0)
North Haven	5	3 (0)	2 (0)	0 (0)	0 (0)	0 (0)	0 (0)
Northford	7	5 (71.4)	0 (0)	1 (14.2)	0 (0)	0 (0)	1 (14.2)
Orange	16	14 (87.5)	2 (12.5)	0 (0)	0 (0)	0 (0)	0 (0)
Oxford	3	2 (0)	1 (0)	0 (0)	0 (0)	0 (0)	0 (0)
Prospect	3	3 (100)	0 (0)	0 (0)	0 (0)	0 (0)	0 (0)
Seymour	9	5 (55.6)	3 (33.3)	1 (11.1)	0 (0)	0 (0)	0 (0)
Southbury	21	10 (47.6)	8 (38.1)	3 (14.3)	0 (0)	0 (0)	0 (0)

Target Site Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
--------	------------------------	-----------	---------	----------	----------	----------

No sites found for target address

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129 GEOCODED: 106 NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
1	MANIFEST	CT DEP EMERG RESP PER CGS 22A-	80 GROVE ST MERIDEN, CT	0.01 SSW	- 7	1
2	UST --80-7153 --Permanently Closed	SAINT MARY SCHOOL	97 GROVE ST MERIDEN, CT 06451	0.01 NNE	+ 5	3
A3	MANIFEST	MERIDEN CITY OF HOUSING AUTHOR	22 CHURCH ST MERIDEN, CT 06451	0.10 East	- 22	4
4	UST --80-7058 --Permanently Closed	SENIOR CITIZEN CENTER	22 W MAIN ST MERIDEN, CT 06451	0.11 SE	- 20	6
B5	CPCS	COLONIAL CUSTOM CLEANERS	9 BUTLER ST MERIDEN, CT	0.12 SSW	- 29	7
B5	CT PROPERTY	COLONIAL CUSTOM CLEANERS	9 BUTLER ST MERIDEN, CT	0.12 SSW	- 29	8
B5	SDADB --937 --944	COLONIAL CUSTOM CLEANERS	9 BUTLER ST MERIDEN, CT	0.12 SSW	- 29	11
B6	MANIFEST	COLONIAL CUSTOMS CLEANERS	9 BUTLER ST MERIDEN, CT 06450	0.12 SSW	- 29	15
A7	US BROWNFIELDS	33 COLONY STREET	15-31 CHURCH ST MERIDEN, CT 06451	0.12 ESE	- 23	17
C8	UST --80-4008 --Currently In Use	JEFFERSON FEDERAL SAVINGS	1 W MAIN ST MERIDEN, CT 06451	0.13 SE	- 26	20
C9	CPCS --LUST Completed (DEP's significant hazard definition)	CT. NATIONAL BANK	1 WEST MAIN ST. MERIDEN, CT 06450	0.13 SE	- 26	21
C9	LUST --Lust Completed --28433	CT. NATIONAL BANK	1 WEST MAIN ST. MERIDEN, CT 06450	0.13 SE	- 26	22
10	UST --80-10560 --Permanently Closed	MERIDEN REDEVELOPMENT	13 S COLONY ST MERIDEN, CT 06450	0.15 SE	- 29	26

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
11	MANIFEST	MERIDEN WALLINGFORD CHRYSALIS	3-5 WASHINGTON PLACE MERIDEN, CT	0.15 NE	- 2	27
D12	CT PROPERTY	SNET	25 BUTLER STREET MERIDEN, CT	0.15 SSW	- 34	29
D12	SDADB --4464	SNET	25 BUTLER STREET MERIDEN, CT	0.15 SSW	- 34	32
D13	MANIFEST	SOUTHERN NEW ENGLAND TELEPHONE	27 BUTLER STREET MERIDEN, CT 06450	0.15 SSW	- 35	34
D14	UST --80-3637 --Permanently Closed --Currently In Use	MERIDEN CO #7801	27 BUTLER ST MERIDEN, CT 06451	0.15 SSW	- 35	35
D15	MANIFEST	SOUTHERN NEW ENGLAND TELE	27 BUTLER ST MERIDEN, CT 06450	0.15 SSW	- 35	39
D15	LUST --Investigation --49338	SOUTHERN NEW ENGLAND TELE	27 BUTLER ST MERIDEN, CT 06450	0.15 SSW	- 35	41
16	UST --80-3883 --Permanently Closed --Currently In Use	HARBOR TOWERS LIM.PART.	60 HANOVER ST MERIDEN, CT 06451	0.16 South	- 44	45
17	MANIFEST	MEDCO	79 HANOVER ST PO BOX 637 MERIDEN, CT 06450	0.17 South	- 43	48
18	MANIFEST	FIRST CONGRETATIONAL CHURCH	62 COLONY ST MERIDEN, CT 06451	0.17 East	- 30	50
E19	CPCS --Cleanup Initiated	HENNY PENNY (FORMERLY VINNIE'S	2 MAIN STREET MERIDEN, CT 06450	0.18 ESE	- 42	52
E19	SDADB --1555	HENNY PENNY (FORMERLY VINNIE'S	2 MAIN STREET MERIDEN, CT 06450	0.18 ESE	- 42	53
E20	CT PROPERTY	HENNY PENNY (FORMERLY VINNIE'S	2 MAIN STREET MERIDEN, CT 06450	0.18 ESE	- 42	56
E20	LUST --Cleanup Initiated --31697	HENNY PENNY (FORMERLY VINNIE'S	2 MAIN STREET MERIDEN, CT 06450	0.18 ESE	- 42	59

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
F21	MANIFEST	R F S CABLEWAVE SYSTEMS DIV	1 STATE ST MERIDEN, CT 06450	0.18 SE	- 34	63
F22	MANIFEST	RADIO FREQUENCY SYSTEMS	1 STATE ST MERIDEN, CT 06450	0.18 SE	- 34	87
F23	MANIFEST	RFS CABLE WAVE SYSTEMS	1 STATE ST MERIDEN, CT 06450	0.18 SE	- 34	106
24	US BROWNFIELDS	MERIDEN AMTRAK STATION	60 STATE STREET MERIDEN, CT 06450	0.18 ESE	- 45	109
E25	MANIFEST	AMES REALTY	14 WEST MAIN ST MERIDEN, CT	0.19 ESE	- 42	112
G26	UST --80-7050 --Permanently Closed	MOTOR VEHICLE DEPT. (BUTLER ST	47 BUTLER ST MERIDEN, CT 06451	0.20 SSW	- 39	114
F27	US BROWNFIELDS	FORMER CHURCH AND MORSE	33 SOUTH COLONY ST MERIDEN, CT 06450	0.20 SE	- 30	115
E28	CPCS --Investigation	MERIDEN SENIOR CENTER	22 WEST MAIN ST. MERIDEN, CT 06450	0.20 ESE	- 41	120
E29	LUST --Investigation --28428	MERIDEN SENIOR CENTER	22 WEST MAIN ST. MERIDEN, CT 06450	0.20 ESE	- 41	121
F30	MANIFEST	TUNXIS OHRS	35 NORTH COLONY ST MERIDEN, CT 06450	0.20 SE	- 30	125
31	MANIFEST	US POSTAL SERVICE	87 COLONY ST MERIDEN, CT 06750	0.20 ENE	- 30	127
H32	US BROWNFIELDS	51-53 SOUTH COLONY ST	51-53 SOUTH COLONY ST MERIDEN, CT 06450	0.21 SE	- 31	130
G33	UST --80-3879 --Permanently Closed --Currently In Use	HANOVER TOWERS REALTY	76 BUTLER ST MERIDEN, CT 06451	0.21 SSW	- 41	135
G34	CPCS --LUST Completed (DEP's significant hazard definition)	HANOVER TOWERS	76 BUTLER STREET MERIDEN, CT 06450	0.21 SSW	- 41	138
G34	LUST --Lust Completed --28629	HANOVER TOWERS	76 BUTLER STREET MERIDEN, CT 06450	0.21 SSW	- 41	139

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
35	MANIFEST	MERIDEN CITY OF MERIDEN HUB TH	77 STATE ST MERIDEN, CT 06450	0.21 East	- 45	143
G36	US BROWNFIELDS	FACTORY H - 104 BUTLER STREET	104 BUTLER STREET MERIDEN, CT 06451	0.22 SSW	- 41	146
G37	VCP	INTERNATIONAL SILVER COMPANY,	104 BUTLER STREET MERIDEN, CT	0.22 SSW	- 41	163
H38	MANIFEST	RECORD JOURNAL PUBLISHING	11 CROWN ST MERIDEN, CT 06450	0.23 SE	- 23	166
H39	MANIFEST	MERIDEN RECORDO	11 CROWN ST MERIDEN, CT 06450	0.23 SE	- 23	168
H40	SDADB --877	THE MERIDEN RECORD CO.	11 CROWN STREET MERIDEN, CT	0.23 SE	- 23	174
I41	MANIFEST	MERIDEN POLICE DEPT	50 WEST MAIN ST MERIDEN, CT 06450	0.23 ESE	- 34	176
I42	MANIFEST	MERIDEN POLICE DEPT	50 WEST MAIN ST MERIDEN, CT 06450	0.23 ESE	- 34	178
I43	MANIFEST	CT STATE OF JD	54 WEST MAIN ST MERIDEN, CT 06450	0.24 ESE	- 32	180
J44	MANIFEST	FIRESTONE STORE 7056	72 COOK AVE MERIDEN, CT 06450	0.24 SW	- 33	182
J45	MANIFEST	FIRESTONE STORE 7056	72 COOK AVE MERIDEN, CT 06450	0.24 SW	- 33	183
J46	MANIFEST	FIRESTONE 00582	72 COOK AVE MERIDEN, CT 06451	0.24 SW	- 33	189
J47	UST --80-3656 --Permanently Closed	FIRESTONE STORE #7056	72 COOK AVE MERIDEN, CT 06451	0.24 SW	- 33	196
J48	MANIFEST	FIRESTONE INC	72 COOK AVE MERIDEN, CT 06450	0.24 SW	- 33	197
I49	MANIFEST	MERIDEN CITY OF PURCHASING	60 E MAIN ST MERIDEN, CT 06450	0.24 ESE	- 27	199
J50	LUST --Cleanup Initiated --59707	XTRA MART	80 COOK AVE MERIDEN, CT 06450	0.25 SW	- 39	201
51	LUST --Lust Completed --36274	UNKNOWN	LEWIS & SPRINGDALE AVES. MERIDEN, CT 06450	0.26 NW	- 38	205

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
52	LUST --Lust Completed --34263	SALVATION ARMY	23 ST.CASIMER ST SALVATIO MERIDEN, CT 06450	0.28 SE	- 18	209
K53	LUST --Lust Completed --36428 --37069	G.T TIRES	155 COLONY STREET MERIDEN, CT 06450	0.31 NE	- 31	213
K54	CORRACTS	QUINLAN RUSSELL (J. B. COGGINS	5 CROSS ST MERIDEN, CT	0.32 NE	- 32	220
K54	CERC-NFRAP --CTD000842906	QUINLAN RUSSELL (J. B. COGGINS	5 CROSS ST MERIDEN, CT	0.32 NE	- 32	221
K54	RCRA-TSDF --CTD000842906	QUINLAN RUSSELL (J. B. COGGINS	5 CROSS ST MERIDEN, CT	0.32 NE	- 32	222
K55	SDADB --228	J. B. COGGINS CO.	5 CROSS STREET MERIDEN, CT 06450	0.32 NE	- 32	232
K55	SHWS	J. B. COGGINS CO.	5 CROSS STREET MERIDEN, CT 06450	0.32 NE	- 32	234
L56	VCP	RADIOLOGY ASSOC, INC.	116 COOK AVENUE MERIDEN, CT	0.32 SSW	- 47	235
L57	US BROWNFIELDS	FORMER MERIDEN MEDICAL CENTER	116 COOK AVENUE MERIDEN, CT	0.32 SSW	- 47	238
58	LUST --Lust Completed --30179	OFFICE COMPLEX	95 EAST MAIN ST. MERIDEN, CT 06450	0.32 ESE	- 13	241
59	LUST --Lust Completed --32640	JOE GIANNETTI	71 PRATT ST MERIDEN, CT 06450	0.34 East	- 51	245
60	US BROWNFIELDS	MILLS MEMORIAL HOUSING COMPLEX	161 STATE STREET MERIDEN, CT 06450	0.37 ENE	- 40	249
61	LUST --Lust Completed --48734	H.C.S. ENTERPRISES, LLC	293 WEST MAIN STREET MERIDEN, CT	0.41 West	- 38	252

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
62	SDADB --1344	INSILCO FACTORY	COOPER STREET AND CHERRY MERIDEN, CT	0.42 South	- 41	256
M63	US BROWNFIELDS	FACTORY H - 77 COOPER STREET	77 COOPER STREET MERIDEN, CT 06451	0.43 SSW	- 37	259
M64	CERCLIS --CTN000105724	FACTORY H	77 COOPER STREET MERIDEN, CT 06451	0.43 SSW	- 37	279
M65	BROWNFIELDS	FORMER FACTORY H-INTERNATIONAL	77 COOPER STREET MERIDEN, CT 06451	0.43 SSW	- 37	284
M65	VCP	FORMER FACTORY H-INTERNATIONAL	77 COOPER STREET MERIDEN, CT 06451	0.43 SSW	- 37	285
M66	US BROWNFIELDS	85 COOPER STREET	85 COOPER STREET MERIDEN, CT	0.43 SSW	- 35	288
67	US BROWNFIELDS	144 PRATT STREET	144 PRATT STREET MERIDEN, CT 06450	0.44 East	- 46	291
68	BROWNFIELDS	GENERAL HOSPITAL	1 KING PL MERIDEN, CT	0.44 SSW	- 27	294
69	LUST --Investigation --59108	GR CUMMINGS CO.	198 - 210 STATE STREET MERIDEN, CT	0.45 ENE	- 37	295
70	US BROWNFIELDS	CEDAR PARK	62 CEDAR STREET MERIDEN, CT 06450	0.46 ENE	- 57	299
N71	LUST --Cleanup Initiated --28437	GETTY STATION	213 COLONY RD. MERIDEN, CT 06450	0.46 South	- 20	304
N72	SDADB --4457	GETTY PETROLEUM	213 COLONY STREET MERIDEN, CT 06450	0.46 South	- 20	308
73	SDADB --4461	PERSONAL EXPRESSIONS	35 MERIDIAN STREET MERIDEN, CT	0.48 SSW	- 29	310
74	SDADB --762	RAGEDINO	4-10 AMES AVENUE MERIDEN, CT	0.48 NW	- 50	312

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
75	US BROWNFIELDS	62 TWISS STREET	62 TWISS STREET MERIDEN, CT 06450	0.49 ESE	- 25	314
076	LUST --Cleanup Initiated --59109	MERIDEN SUNOCO	357 WEST MAIN STREET - 36 MERIDEN, CT	0.50 West	- 49	317
077	SDADB --4446	AMERICAN OIL CHANGE CORP.	321-327 WEST MAIN STREET MERIDEN, CT	0.50 West	- 49	321
78	SDADB --4458	GUEST COMPANY INC.	49 ELM STREET MERIDEN, CT	0.55 SE	+ 97	323
79	SDADB --4467	ZIMMERMAN, JOSEPH M.D.	319 HANOVER STREET MERIDEN, CT	0.56 SW	- 8	325
P80	SDADB --4453	DAVELLA MOTORS, INC.	41 CAPITOL AVENUE MERIDEN, CT	0.60 WNW	- 49	327
81	CORRACTS	MILLER CO THE	99 CENTER ST MERIDEN, CT 06450	0.61 East	- 24	329
P82	SDADB --1947	MAGNAKLEEN	54 CAPITOL AVENUE MERIDEN, CT	0.61 WNW	- 55	331
83	SDADB --2996	KINGS CLEANERS & LAUNDRY CENTE	326 CENTER STREET MERIDEN, CT	0.62 ENE	- 32	333
84	SDADB --4465	SPENCER'S GARAGE	274 COOK AVENUE MERIDEN, CT	0.64 SSW	- 59	335
85	SDADB --1639	UNION MFG CO	290 PRATT ST MERIDEN, CT	0.68 East	- 36	337
86	SDADB --4451	CITY OF MERIDEN	41 HIGH STREET MERIDEN, CT	0.68 SE	+ 96	339
87	SDADB --753	SILVER CITY GLASS	122 CHARLES STREET MERIDEN, CT	0.80 SE	+ 93	341

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
88	SDADB --2991	DUFFY PROPERTY	382 COOK AVENUE MERIDEN, CT	0.83 SSW	- 19	343
89	SDADB --4448	AS YOU LIKE IT CLEANERS	367 E MAIN ST MERIDEN, CT 06450	0.84 ESE	+ 96	345
90	SDADB --875	THE EUREKA PRESS INC.	264 BROAD STREET MERIDEN, CT	0.86 SSE	+ 121	347
91	SDADB --3169	VALERIO ALBARELLO, INC.	41-45 PARKER AVENUE MERIDEN, CT 06450	0.89 SE	+ 102	349
92	SDADB --876	MERIDEN-STINEHOUR, INC.	47 BILLARD STREET MERIDEN, CT	0.90 NNE	- 12	351
93	SDADB --740	MERIDEN FOUNDRY DUMP SITE	COE AVENUE AND HANOVER RO MERIDEN, CT	0.96 SW	- 52	353
94	SDADB --1017	MRM INDUSTRIES, INC.	508 NORTH COLONY STREET MERIDEN, CT 06450	0.97 NE	- 14	355

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
	UST --80-7206 --Permanently Closed --Currently In Use	MERIDEN MAINT. GARAGE (BLDG 81	ROUTE 15 W. C. PARKWAY MERIDEN, CT	NON GC	N/A	N/A
	MANIFEST	CT STATE OF DOT	RTE 15 OVER I 91 MERIDEN, CT 06450	NON GC	N/A	N/A
	MANIFEST	STATE OF CT DOT	RTE 15 MERIDEN, CT 06450	NON GC	N/A	N/A
	SDADB --763	DUMP #9	ROUTE 66 MERIDEN, CT	NON GC	N/A	N/A
	MANIFEST	KERI CORP	RTE 91 NORTHBOUND MERIDEN, CT	NON GC	N/A	N/A
	CPCS --LUST Completed (DEP's significant hazard definition)	EYELET SPECIALTIES	NORTH BROWN ST. MERIDEN, CT 06450	NON GC	N/A	N/A
	LUST --Lust Completed --29533	EYELET SPECIALTIES	NORTH BROWN ST. MERIDEN, CT 06450	NON GC	N/A	N/A
	MANIFEST	TARGET	3474 CHAMBERLAIN HWY MERIDEN, CT 06451	NON GC	N/A	N/A
	MANIFEST	CITGO PETROLEUM	CHAMBERLAIN HWY MERIDEN, CT 06451	NON GC	N/A	N/A
	CPCS --Cleanup Initiated	CABIN RESTAURANT / ANTHONY PAG	COLONY STREET, BROOKS STR MERIDEN, CT 06450	NON GC	N/A	N/A
	LUST --Cleanup Initiated --31542	CABIN RESTAURANT / ANTHONY PAG	COLONY STREET, BROOKS STR MERIDEN, CT 06450	NON GC	N/A	N/A
	SDADB --765	DUMP #11	NORTH COLONY STREET MERIDEN, CT	NON GC	N/A	N/A
	SDADB --734	HANOVER POND	HANOVER POND MERIDEN, CT	NON GC	N/A	N/A

Sites Summary Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

TOTAL: 129

GEOCODED: 106

NON GEOCODED: 23

Map ID	DB Type --ID/Status	Site Name	Address	Dist/Dir	ElevDiff	Page No.
	SDADB --755	DUMP #1	HANOVER STREET MERIDEN, CT	NON GC	N/A	N/A
	CPCS --Pending	INTERSECTION OF W. MAIN & CENT	INTERSECTION OF W. MAIN & MERIDEN, CT 06450	NON GC	N/A	N/A
	LUST --Pending --45333	INTERSECTION OF W. MAIN & CENT	INTERSECTION OF W. MAIN & MERIDEN, CT 06450	NON GC	N/A	N/A
	SDADB --761	DUMP #7	LEWIS AVENUE MERIDEN, CT	NON GC	N/A	N/A
	SDADB --2399	AMOCO	EAST MAIN STREET MERIDEN, CT	NON GC	N/A	N/A
	MANIFEST	STOP & SHOP SUPERMARKET CO	E MAIN ST MERIDEN, CT 06450	NON GC	N/A	N/A
	SDADB --756	DUMP #2	WEST SIDE HANOVER POND MERIDEN, CT	NON GC	N/A	N/A
	US BROWNFIELDS	MERIDEN HUB	1-77 STATE STREET 30 EAST MERIDEN, CT 06450	NON GC	N/A	N/A
	MANIFEST	MERIDEN MANUFACTURING	230 STATE STREET EXTENTIO MERIDEN, CT 06450	NON GC	N/A	N/A
	CPCS --LUST Completed (DEP's significant hazard definition)	CITY OF MERIDEN, WILMA PIETRA	THOMAS EDISON MIDDLE SCHO MERIDEN, CT 06450	NON GC	N/A	N/A

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109747857 **DIST/DIR:** 0.012 SSW **ELEVATION:** 175 **MAP ID:** 1

NAME: CT DEP EMERG RESP PER CGS 22A-451 **Rev:** 07/30/2013
ADDRESS: 80 GROVE ST
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTF0910450
Year: 2000
Waste Occurrence: 1
UNNA: 1263
Hazard Class: 3
US Dot Description: paint related material, paint
No of Containers: 008
Container Type: DM
Quantity: 560
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0910450
Year: 2000
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 2000
Manifest ID: CTF0910450
TSDf EPA ID: CTD021816889
TSDf Name: UNITED OIL RECOVERY DBA ADV LIQ REC
TSDf Address: 136 GRACEY AVE
TSDf City,St,Zip: MERIDEN, CT 06451
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 08/10/2000
Transporter EPA ID: CTD021816889
Transporter Name: UNITED OIL RECOVERY DBA ADV LIQ REC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109747857 **DIST/DIR:** 0.012 SSW **ELEVATION:** 175 **MAP ID:** 1

NAME: CT DEP EMERG RESP PER CGS 22A-451 **Rev:** 07/30/2013
ADDRESS: 80 GROVE ST
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000019853
Generator Phone: Not reported
Generator Mailing Addr: 80 GROVE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: Not reported
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 08/10/2000
Date Received: 08/10/2000
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002029634 **DIST/DIR:** 0.015 NNE **ELEVATION:** 187 **MAP ID:** 2

NAME: SAINT MARY SCHOOL
ADDRESS: 97 GROVE ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-7153
ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:
Facility Id: 80-7153
Latitude: 41.539620
Longitude: -72.804370
Owner: SAINT MARY SCHOOL
Owner Address: 97 GROVE ST
Owner Address 2: Not reported
Owner City,St,Zip: MERIDEN, CT 064513114

Tank ID: 7153-1
Compartment ID: 7153-1
Compartment Num: 1
Alt. Tank ID: S1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 3000
Substance: Gasoline
Date Installed: 01/01/1950
Date Last Used: 01/01/1989
Closure Status: Tank was Removed From Ground
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109752957 **DIST/DIR:** 0.098 East **ELEVATION:** 160 **MAP ID:** A3

NAME: MERIDEN CITY OF HOUSING AUTHORITY **Rev:** 07/30/2013
ADDRESS: 22 CHURCH ST
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTF0986565
Year: 2002
Waste Occurrence: 1
UNNA: 1992
Hazard Class: 3
US Dot Description: flammable liquid toxic nos
No of Containers: 002
Container Type: DM
Quantity: 100
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0986565
Year: 2002
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 2002
Manifest ID: CTF0986565
TSDf EPA ID: OHD066060609
TSDf Name: CHEMTRON CORP
TSDf Address: 35850 SCHNEIDER CT
TSDf City,St,Zip: AVON, OH 44011
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 10/03/2002
Transporter EPA ID: CTD983896341
Transporter Name: WASTE MGT N E ENV TRANSPORT INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: 10/16/2002
Trans 2 EPA ID: NJD054126164
Trans 2 Name: FREEHOLD CARTAGE INC

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109752957 **DIST/DIR:** 0.098 East **ELEVATION:** 160 **MAP ID:** A3

NAME: MERIDEN CITY OF HOUSING AUTHORITY **Rev:** 07/30/2013
ADDRESS: 22 CHURCH ST
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000026826
Generator Phone: Not reported
Generator Mailing Addr: 22 CHURCH ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06451
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 10/03/2002
Date Received: 10/30/2002
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002175258 **DIST/DIR:** 0.106 SE **ELEVATION:** 162 **MAP ID:** 4

NAME: SENIOR CITIZEN CENTER
ADDRESS: 22 W MAIN ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-7058
ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:
Facility Id: 80-7058
Latitude: Not reported
Longitude: Not reported
Owner: CITY OF MERIDEN
Owner Address: 142 E MAIN ST
Owner Address 2: Not reported
Owner City,St,Zip: MERIDEN, CT 064505605

Tank ID: 7058-1
Compartment ID: 7058-1
Compartment Num: 1
Alt. Tank ID: A1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 2000
Substance: Gasoline
Date Installed: 01/01/1950
Date Last Used: 10/01/1996
Closure Status: Tank Filled with Inert Material
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CPCS

EDR ID: 1000842782 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B5

NAME: COLONIAL CUSTOM CLEANERS **Rev:** 01/30/2014

ADDRESS: 9 BUTLER ST
MERIDEN, CT
NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

CPCS:

Site Type: Projects

Lust Status: Not reported

PTP Form: III

Program: Property Transfer Program

Comments: Projects

Site Type Definition: Property Transfer Form III

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CT PROPERTY

EDR ID: 1000842782 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B5

NAME: COLONIAL CUSTOM CLEANERS **Rev:** 02/11/2014
ADDRESS: 9 BUTLER ST
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

CT Property:

Seller Name: Helen Rosen rep. of estat
Buyer Name: City of Meriden
Certifying Party: Not reported
Certifying Attention Person: Not reported
Title Of Certifying Person: Not reported
Certifying Person Address: Not reported
Certifying Person City,St,Zip: Not reported
Property Transfer Forms: Form III (DEP-PERD-PTP-203) when a discharge, spillage, uncontrolled loss, seepage or filtration of hazardous waste has occurred at the parcel that has not been fully remediated or the environmental conditions at the parcel are unknown. The person signing the Form III certification agrees to investigate and remediate the site in accordance with the remediation standards. The statute does not require completion of remediation before the parcel is transferred. Any person submitting a Form III shall simultaneously submit a completed Environmental Condition Assessment Form (ECAFA)(DEP-PERD-PTP-200).
Date Recieved: 01/11/1994
Ackn Date: Not reported
Determination Date: Not reported
LEP Verified/DEP Approval Date: Not reported
Rem Id: 2076
Remediation Location Id: 228
Date Entered: Not reported
Program: Property Transfer Program
GAO Site: False
Staff Full Name: Mary Jane Dapkus
Super/Date: Not reported
Stage Of Project: SITE MONITORING
RP Level Of Activity: LOW
RP Needed Level Of Activity: LOW
Staff Level Of Activity: LOW
Staff Needed Level Of Activity: LOW
Public Intrest: LOW
PRP Cooperation: MEDIUM
Enforcement Status: NONE TAKEN
Level Of Complexity: LOW
Complex Eng Or Sci: False
Complex Due To Public Involvement: False
Politically Complex: False
Complex Enforcement: False
Coordination With Other Bureaus: False
EPA Involvement: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CT PROPERTY

EDR ID: 1000842782 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B5

NAME: COLONIAL CUSTOM CLEANERS **Rev:** 02/11/2014
ADDRESS: 9 BUTLER ST
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Prefrence: PASS ON
Readiness For Transfer: READY TO TRANSFER NOW
Project Transfer Time: Not reported
Transfer Comments: Not reported
Staff As Of July 2000: Hamel Maurice
Initial Staff: MRH
Type Of Transfer: Not reported
Salutation: Not reported
Relationship To Transfer: Not reported
Audit Date: Not reported
Verif Type: Not reported
Audit Outcome: Not reported
GW: GB
Basin: Not reported
1st Payment: 6000
Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
RTN: Not reported
Revised: Not reported
ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported
Report Overdue: Not reported
Ext Aprvl Sched: Not reported
License #: Not reported
Project Phase: Not reported
PT Comments: Not reported
EPA Id Number: Not reported
GW Class: Not reported
SW Class: Not reported
AO/C0: Not reported
Water Lead(Y Or N): Not reported
Priority: Not reported
Project Status(A, I Or D): Not reported
Last Updated: Not reported
SR Comments: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CT PROPERTY

EDR ID: 1000842782 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B5

NAME: COLONIAL CUSTOM CLEANERS **Rev:** 02/11/2014
ADDRESS: 9 BUTLER ST
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Priority Or Work-Load: Not reported
Status: Not reported
Notes: Not reported
Special Project Name: Not reported
Special Project Comments: Not reported
DOT Project: Not reported
Pt Counter: Not reported
Project Complete: False
Project Inactive: False
Int Deposit #: Not reported
Deposit #: Not reported
Spill Case #: Not reported
Diversion Id: Not reported
Public Notice: Not reported
RAP Received: Not reported
RAP Approved: Not reported
Compliance Category: Not reported
Delete Record: False
ECAF Reviewed By: Not reported
Not Locatable: False
Primary Address: True
AKA Site Name: False
Primary Site Name: True
AKA Site Address: False
Lead: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: 1000842782 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B5

NAME: COLONIAL CUSTOM CLEANERS **Rev:** 04/23/2010
ADDRESS: 9 BUTLER ST ID/Status: 937
MERIDEN, CT ID/Status: 944
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 937
Rem Master ID: 986
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: OIL, PCE
Disposal: SPILL/DUMP, TO GROUND
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 886
Source of referral: SUPERFUND
Date Received: 7/1/1990
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Referral Id: 3593
Source of referral: RCRA
Date Received: 8/31/1990
Staff Assigned: BOTTI, T.

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: 1000842782 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B5

NAME: COLONIAL CUSTOM CLEANERS

Rev: 04/23/2010

ADDRESS: 9 BUTLER ST
MERIDEN, CT
NEW HAVEN

ID/Status: 937
ID/Status: 944

SOURCE: CT Department of Energy & Environmental Protection

Remediation Program: D&A
Date dt_assigned: 8/31/1990
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: 322
PTP Id: 942
Remediation Program: III
Remediation Program Entered: Not reported
Staff Assigned: HAMEL, M.
Remediation Program: PTP
Date dt_assign: Not reported
Project Phase: A
Order issued: False
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: False
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: 1000842782 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B5

NAME: COLONIAL CUSTOM CLEANERS **Rev:** 04/23/2010
ADDRESS: 9 BUTLER ST ID/Status: 937
MERIDEN, CT ID/Status: 944
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Facility ID: 944
Rem Master ID: 993
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: PCE
Disposal: SPILL/DUMP, TO GROUND
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: True
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: Not reported
Source of referral: Not reported
Date Received: Not reported
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported
Staff Assigned: Not reported
Remediation Program: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: 1000842782 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B5

NAME: COLONIAL CUSTOM CLEANERS **Rev:** 04/23/2010
ADDRESS: 9 BUTLER ST ID/Status: 937
MERIDEN, CT ID/Status: 944
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109740179 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B6

NAME: COLONIAL CUSTOMS CLEANERS **Rev:** 07/30/2013
ADDRESS: 9 BUTLER ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTC0300976
Year: 1990
Waste Occurrence: 1
UNNA: 1897
Hazard Class: ORM-A
US Dot Description: WASTE PERCHLOROETHYLENE
No of Containers: 005
Container Type: DM
Quantity: 300
Weight/Volume: P
Additional Description: Y
Handling Code: S01
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTC0300976
Year: 1990
Waste Occurrence: 1
EPA Waste Code: F002
Recycled Waste?: True
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1990
Manifest ID: CTC0300976
TSDf EPA ID: CTD980667927
TSDf Name: SAFETY KLEEN CORP 2-112-01
TSDf Address: 11 TIPPING DR LOT #4
TSDf City,St,Zip: BRANFORD, CT 06405
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 05/14/1990
Transporter EPA ID: ILD051060408
Transporter Name: SAFETY-KLEEN CORP (TRANSPORTER ONLY)
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109740179 **DIST/DIR:** 0.116 SSW **ELEVATION:** 153 **MAP ID:** B6

NAME: COLONIAL CUSTOMS CLEANERS **Rev:** 07/30/2013
ADDRESS: 9 BUTLER ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000011045
Generator Phone: 2032379068
Generator Mailing Addr: 9 BUTLER ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 05/14/1990
Date Received: 05/14/1990
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970103 **DIST/DIR:** 0.117 ESE **ELEVATION:** 159 **MAP ID:** A7

NAME: 33 COLONY STREET **Rev:** 03/20/2014
ADDRESS: 15-31 CHURCH ST
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of
Grant type: Assessment
Property name: 33 COLONY STREET
Property #: Not reported
Parcel size: .13
Property Description: Formerly commercial retail and office space owned by David Legere.
Currently a vacant lot owned by the City of Meriden.
Latitude: 41.538978
Longitude: -72.801761
HCM label: Address Matching-House Number
Map scale: Not reported
Point of reference: Center of a Facility or Station
Datum: North American Datum of 1983
ACRES property ID: 147302
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 900
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Unknown
Video available: Not reported
Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970103 **DIST/DIR:** 0.117 ESE **ELEVATION:** 159 **MAP ID:** A7

NAME: 33 COLONY STREET **Rev:** 03/20/2014
ADDRESS: 15-31 CHURCH ST
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: .13
Past use industrial acreage: Not reported
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970103 **DIST/DIR:** 0.117 ESE **ELEVATION:** 159 **MAP ID:** A7

NAME: 33 COLONY STREET

Rev: 03/20/2014

ADDRESS: 15-31 CHURCH ST
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002027965 **DIST/DIR:** 0.131 SE **ELEVATION:** 156 **MAP ID:** C8

NAME: JEFFERSON FEDERAL SAVINGS
ADDRESS: 1 W MAIN ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-4008
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

UST:
Facility Id: 80-4008
Latitude: 41.538330
Longitude: -72.803360
Owner: CARABETTA MANAGEMENT COMPANY
Owner Address: 200 PRATT ST
Owner Address 2: Not reported
Owner City,St,Zip: MERIDEN, CT 064504220

Tank ID: 4008-1
Compartment ID: 4008-1
Compartment Num: 1
Alt. Tank ID: A1
Tank Status: Currently In Use
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 10000
Substance: Heating Oil
Date Installed: 05/01/1974
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Not reported
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CPCS

EDR ID: S105456150 **DIST/DIR:** 0.131 SE **ELEVATION:** 156 **MAP ID:** C9

NAME: CT. NATIONAL BANK
ADDRESS: 1 WEST MAIN ST.
MERIDEN, CT 06450

Rev: 01/30/2014
ID/Status: LUST Completed (DEP's significant hazard def

SOURCE: CT Department of Energy & Environmental Protection

CPCS:
Site Type: LUST
Lust Status: LUST Completed (DEP's significant hazard definition)
PTP Form: Not reported
Program: Not reported
Comments: Not reported
Site Type Definition: Leaking Underground Storage Tanks Completed

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S105456150 **DIST/DIR:** 0.131 SE **ELEVATION:** 156 **MAP ID:** C9

NAME: CT. NATIONAL BANK **Rev:** 02/11/2014
ADDRESS: 1 WEST MAIN ST.
MERIDEN, CT 06450 ID/Status: Lust Completed
ID/Status: 28433

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 407
UST Facility Id: 4008
LUST Case Id: 28433
Lust Status: Lust Completed
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 01/31/1990
Entry Date: Not reported
Site Case Id: Not reported
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: 848
LUST Owner Id: Not reported
UST Event Id: 406
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S105456150 **DIST/DIR:** 0.131 SE **ELEVATION:** 156 **MAP ID:** C9

NAME: CT. NATIONAL BANK
ADDRESS: 1 WEST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 28433

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 31
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S105456150 **DIST/DIR:** 0.131 SE **ELEVATION:** 156 **MAP ID:** C9

NAME: CT. NATIONAL BANK
ADDRESS: 1 WEST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 28433

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlaid: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S105456150 **DIST/DIR:** 0.131 SE **ELEVATION:** 156 **MAP ID:** C9

NAME: CT. NATIONAL BANK
ADDRESS: 1 WEST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 28433

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Not reported
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U004008740 **DIST/DIR:** 0.148 SE **ELEVATION:** 153 **MAP ID:** 10

NAME: MERIDEN REDEVELOPMENT
ADDRESS: 13 S COLONY ST
MERIDEN, CT 06450

Rev: 03/03/2014
ID/Status: 80-10560
ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:
Facility Id: 80-10560
Latitude: Not reported
Longitude: Not reported
Owner: MERIDEN REDEVELOPMENT
Owner Address: 290 PRATT ST
Owner Address 2: Not reported
Owner City,St,Zip: MERIDEN, CT 064508600

Tank ID: 10560-1
Compartment ID: 10560-1
Compartment Num: 1
Alt. Tank ID: A1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 2000
Substance: Gasoline
Date Installed: 01/01/1950
Date Last Used: 07/01/1991
Closure Status: Tank was Removed From Ground
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109742956 **DIST/DIR:** 0.150 NE **ELEVATION:** 180 **MAP ID:** 11

NAME: MERIDEN WALLINGFORD CHRYSALIS INC **Rev:** 07/30/2013
ADDRESS: 3-5 WASHINGTON PLACE
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTC0276591
Year: 1992
Waste Occurrence: 1
UNNA: 9189
Hazard Class: ORM-E
US Dot Description: HAZARDOUS WASTE SOLID NOS, LEAD
No of Containers: 001
Container Type: CM
Quantity: 8000
Weight/Volume: P
Additional Description: Y
Handling Code: D81
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTC0276591
Year: 1992
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1992
Manifest ID: CTC0276591
TSDf EPA ID: OHD045243706
TSDf Name: ENVIROSAFE SERVICES OF OHIO INC
TSDf Address: 876 OTTER CREEK RD
TSDf City,St,Zip: OREGON, OH 43616
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 09/04/1992
Transporter EPA ID: MAD080030356
Transporter Name: JEFFERY CHEMICAL COMPANY INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: 09/09/1992
Trans 2 EPA ID: OHD009865825
Trans 2 Name: DART TRUCKING CO. A/K/A DART AMERICA TRANSPORTERS

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109742956 **DIST/DIR:** 0.150 NE **ELEVATION:** 180 **MAP ID:** 11

NAME: MERIDEN WALLINGFORD CHRYSALIS INC **Rev:** 07/30/2013
ADDRESS: 3-5 WASHINGTON PLACE
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000013898
Generator Phone: 2032373713
Generator Mailing Addr: 3-5 WASHINGTON PLACE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: Not reported
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: Yes
Date Shipped: 09/04/1992
Date Received: 09/09/1992
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CT PROPERTY

EDR ID: S103541249 **DIST/DIR:** 0.150 SSW **ELEVATION:** 148 **MAP ID:** D12

NAME: SNET **Rev:** 02/11/2014

ADDRESS: 25 BUTLER STREET
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

CT Property:

Seller Name: SNET
Buyer Name: SBC Communications Inc.
Certifying Party: SNET/Donald Shassian
Certifying Attention Person: Not reported
Title Of Certifying Person: Not reported
Certifying Person Address: Not reported
Certifying Person City,St,Zip: Not reported
Property Transfer Forms: Form I (DEP-PERD-PTP-201) when no release of hazardous waste has occurred at the parcel being transferred.
Date Recieved: 11/04/1998
Ackn Date: 06/18/1999
Determination Date: Not reported
LEP Verified/DEP Approval Date: Not reported
Rem Id: 4066
Remediation Location Id: 3490
Date Entered: Not reported
Program: Property Transfer Program
GAO Site: False
Staff Full Name: Not reported
Super/Date: Not reported
Stage Of Project: Not reported
RP Level Of Activity: Not reported
RP Needed Level Of Activity: Not reported
Staff Level Of Activity: Not reported
Staff Needed Level Of Activity: Not reported
Public Intrest: Not reported
PRP Cooperation: Not reported
Enforcement Status: Not reported
Level Of Complexity: Not reported
Complex Eng Or Sci: False
Complex Due To Public Involvement: False
Politically Complex: False
Complex Enforcement: False
Coordination With Other Bureaus: False
EPA Involvement: False
Staff Prefrence: Not reported
Readiness For Transfer: Not reported
Project Transfer Time: Not reported
Transfer Comments: Not reported
Staff As Of July 2000: Not reported
Initial Staff: Not reported
Type Of Transfer: Not reported
Salutation: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CT PROPERTY

EDR ID: S103541249 **DIST/DIR:** 0.150 SSW **ELEVATION:** 148 **MAP ID:** D12

NAME: SNET **Rev:** 02/11/2014

ADDRESS: 25 BUTLER STREET
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Relationship To Transfer: transferor
Audit Date: Not reported
Verif Type: Not reported
Audit Outcome: Not reported
GW: Not reported
Basin: Not reported
1st Payment: 200
Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
RTN: Not reported
Revised: Not reported
ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported
Report Overdue: Not reported
Ext Aprvl Sched: Not reported
License #: Not reported
Project Phase: Not reported
PT Comments: Not reported
EPA Id Number: Not reported
GW Class: Not reported
SW Class: Not reported
AO/C0: Not reported
Water Lead(Y Or N): Not reported
Priority: Not reported
Project Status(A, I Or D): Not reported
Last Updated: Not reported
SR Comments: Not reported
Priority Or Work-Load: Not reported
Status: Not reported
Notes: Not reported
Special Project Name: Not reported
Special Project Comments: Not reported
DOT Project: Not reported
Pt Counter: Not reported
Project Complete: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CT PROPERTY

EDR ID: S103541249 **DIST/DIR:** 0.150 SSW **ELEVATION:** 148 **MAP ID:** D12

NAME: SNET **Rev:** 02/11/2014

ADDRESS: 25 BUTLER STREET
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Project Inactive: False
Int Deposit #: Not reported
Deposit #: Not reported
Spill Case #: Not reported
Diversion Id: Not reported
Public Notice: Not reported
RAP Received: Not reported
RAP Approved: Not reported
Compliance Category: Not reported
Delete Record: False
ECAF Reviewed By: Not reported
Not Locatable: False
Primary Address: True
AKA Site Name: False
Primary Site Name: True
AKA Site Address: False
Lead: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S103541249 **DIST/DIR:** 0.150 SSW **ELEVATION:** 148 **MAP ID:** D12

NAME: SNET **Rev:** 04/23/2010
ADDRESS: 25 BUTLER STREET **ID/Status:** 4464
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4464
Rem Master ID: 4546
PTP Id: 3001
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4623
Source of referral: PTP
Date Received: 11/4/1998
Staff Assigned: Not reported
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 11/4/1998
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S103541249 **DIST/DIR:** 0.150 SSW **ELEVATION:** 148 **MAP ID:** D12

NAME: SNET **Rev:** 04/23/2010
ADDRESS: 25 BUTLER STREET **ID/Status:** 4464
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000407836 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D13

NAME: SOUTHERN NEW ENGLAND TELEPHONE CO **Rev:** 12/31/2013
ADDRESS: 27 BUTLER STREET
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

NY MANIFEST:

EPA ID: CTD980514905
Country: USA
Mailing Name: SNET CO
Mailing Contact: MATTHEW JASLORKOWSKI
Mailing Address: 36 S FAIRVIEW AVE 4TH FL
Mailing Address 2: Not reported
Mailing City: PARK RIDGE
Mailing State: IL
Mailing Zip: 60068
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 847-384-5995

Document ID: NYG3070125
Manifest Status: Not reported
Trans1 State ID: CTD983896341
Trans2 State ID: Not reported
Generator Ship Date: 08/08/2001
Trans1 Recv Date: 08/08/2001
Trans2 Recv Date: Not reported
TSD Site Recv Date: 08/20/2001
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: CTD980514905
Trans1 EPA ID: NYD049836679
Trans2 EPA ID: Not reported
TSD ID: J40175CT
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00300
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 01.55
Year: 2001

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002173432 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D14

NAME: MERIDEN CO #7801
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-3637
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-3637
Latitude: Not reported
Longitude: Not reported
Owner: AT&T CORP.
Owner Address: 308 S AKARD ST
Owner Address 2: Not reported
Owner City,St,Zip: DALLAS, TX 752025315

Tank ID: 3637-1
Compartment ID: 3637-1
Compartment Num: 1
Alt. Tank ID: A1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 10000
Substance: Heating Oil
Date Installed: 06/01/1962
Date Last Used: 05/01/1988
Closure Status: Tank was Removed From Ground
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Tank ID: 3637-2
Compartment ID: 3637-2
Compartment Num: 1
Alt. Tank ID: A1R1
Tank Status: Currently In Use
Tank Material: Fiberglass Reinforced Plastic
Secondary Material: Not reported
Capacity: 10000
Substance: Heating Oil
Date Installed: 05/01/1998
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Containment Sumps @ Tanks,Double-Walled
Spill Installed: Spill Bucket
Overfill Installed: Audible Alarm

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002173432 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D14

NAME: MERIDEN CO #7801
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-3637
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 3637-3
Compartment ID: 3637-3
Compartment Num: 1
Alt. Tank ID: B2
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 10000
Substance: Gasoline
Date Installed: 06/01/1962
Date Last Used: 05/01/1988
Closure Status: Tank was Removed From Ground
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Tank ID: 3637-4
Compartment ID: 3637-4
Compartment Num: 1
Alt. Tank ID: B2R1
Tank Status: Permanently Closed
Tank Material: Fiberglass Reinforced Plastic
Secondary Material: Not reported
Capacity: 10000
Substance: Diesel
Date Installed: 06/01/1988
Date Last Used: 08/01/2009
Closure Status: Tank was Removed From Ground
Pipe Material: Other (Specify)
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Tank ID: 3637-5
Compartment ID: 3637-5
Compartment Num: 1
Alt. Tank ID: C3
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 1500
Substance: Gasoline

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002173432 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D14

NAME: MERIDEN CO #7801
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-3637
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Date Installed: 06/01/1962
Date Last Used: 05/01/1988
Closure Status: Tank was Removed From Ground
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Tank ID: 3637-6
Compartment ID: 3637-6
Compartment Num: 1
Alt. Tank ID: D4
Tank Status: Currently In Use
Tank Material: Coated & Cathodically Protected Steel (sti-P3)
Secondary Material: Double-Walled
Capacity: 5000
Substance: Diesel
Date Installed: 10/01/1996
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Containment Sumps @ Tanks,Double-Walled
Spill Installed: Spill Bucket
Overfill Installed: Audible Alarm

Tank ID: 3637-7
Compartment ID: 3637-7
Compartment Num: 1
Alt. Tank ID: E5
Tank Status: Currently In Use
Tank Material: Coated & Cathodically Protected Steel (sti-P3)
Secondary Material: Double-Walled
Capacity: 5000
Substance: Diesel
Date Installed: 10/01/1996
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Containment Sumps @ Tanks,Double-Walled
Spill Installed: Spill Bucket
Overfill Installed: Audible Alarm

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002173432 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D14

NAME: MERIDEN CO #7801
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-3637
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 3637-8
Compartment ID: 3637-8
Compartment Num: 1
Alt. Tank ID: F6
Tank Status: Currently In Use
Tank Material: Coated & Cathodically Protected Steel (sti-P3)
Secondary Material: Double-Walled
Capacity: 5000
Substance: Diesel
Date Installed: 10/01/1996
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Containment Sumps @ Tanks, Double-Walled
Spill Installed: Spill Bucket
Overfill Installed: Audible Alarm

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109729745 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D15

NAME: SOUTHERN NEW ENGLAND TELE **Rev:** 07/30/2013
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: NYG3070125
Year: 2001
Waste Occurrence: 1
UNNA: 3077
Hazard Class: 9
US Dot Description: ENVIRONMENTALLY HAZ. SUBSTANCES,SOLID
No of Containers: 001
Container Type: DM
Quantity: 300
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: NYG3070125
Year: 2001
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 2001
Manifest ID: NYG3070125
TSDf EPA ID: NYD049836679
TSDf Name: C W M CHEMICAL SERVICES LLC
TSDf Address: 1550 BALMER RD
TSDf City,St,Zip: MODEL CITY, NY 14107
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 08/08/2001
Transporter EPA ID: CTD983896341
Transporter Name: WASTE MGT NEW ENGLAND ENV TRANSP INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109729745 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D15

NAME: SOUTHERN NEW ENGLAND TELE **Rev:** 07/30/2013
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980514905
Generator Phone: 2037712673
Generator Mailing Addr: 27 BUTLER ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Yes
Date Shipped: 08/08/2001
Date Received: 08/20/2001
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109729745 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D15

NAME: SOUTHERN NEW ENGLAND TELE
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Investigation
ID/Status: 49338

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 0
UST Facility Id: 3637
LUST Case Id: 49338
Lust Status: Investigation
Processing Status: Not reported
EPA Reportable: True
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 08/16/2007
Entry Date: 12/08/2008
Site Case Id: 200705259
UST Site Id: 0
Cost Recovery Spill Case #: 0
Old SITS Number: 0
Case Log Id: 0
Monthly Report Id: 0
UST Owner Id: 8261
LUST Owner Id: DJF
UST Event Id: 0
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109729745 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D15

NAME: SOUTHERN NEW ENGLAND TELE
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Investigation
ID/Status: 49338

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: AT&T Corp.
Resp Party Address: 308 South Akard Street
Resp Party City,St,Zip: Dallas, TX 752025315
Resp Party Town Number: Not reported
Resp Party Phone: 2144641477
Resp Party Fax: 2144641424
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 22
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109729745 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D15

NAME: SOUTHERN NEW ENGLAND TELE
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Investigation
ID/Status: 49338

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlaid: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109729745 **DIST/DIR:** 0.154 SSW **ELEVATION:** 147 **MAP ID:** D15

NAME: SOUTHERN NEW ENGLAND TELE
ADDRESS: 27 BUTLER ST
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Investigation
ID/Status: 49338

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: 0
Lph Wells: 0
User Stamp: allison forrest/ForrestA
Date Stamp: 09/06/2013
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Spills Files, UST Enforcement Files, and Remediation FilesOpen LUST cases:2007-05259
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002173565 **DIST/DIR:** 0.158 South **ELEVATION:** 138 **MAP ID:** 16

NAME: HARBOR TOWERS LIM.PART.

Rev: 03/03/2014

ADDRESS: 60 HANOVER ST
MERIDEN, CT 06451

ID/Status: 80-3883
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-3883
Latitude: Not reported
Longitude: Not reported
Owner: CARABETTA MANAGEMENT COMPANY
Owner Address: 200 PRATT ST
Owner Address 2: Not reported
Owner City,St,Zip: MERIDEN, CT 064504220

Tank ID: 3883-1
Compartment ID: 3883-1
Compartment Num: 1
Alt. Tank ID: A1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 15000
Substance: Heating Oil
Date Installed: 05/01/1983
Date Last Used: 08/01/1997
Closure Status: Tank was Removed From Ground
Pipe Material: Not reported
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Tank ID: 3883-2
Compartment ID: 3883-2
Compartment Num: 1
Alt. Tank ID: A2
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 10000
Substance: Diesel
Date Installed: 12/01/1983
Date Last Used: 08/01/1997
Closure Status: Tank was Removed From Ground
Pipe Material: Not reported
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002173565 **DIST/DIR:** 0.158 South **ELEVATION:** 138 **MAP ID:** 16

NAME: HARBOR TOWERS LIM.PART.

Rev: 03/03/2014

ADDRESS: 60 HANOVER ST
MERIDEN, CT 06451

ID/Status: 80-3883
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 3883-3
Compartment ID: 3883-3
Compartment Num: 1
Alt. Tank ID: B1
Tank Status: Permanently Closed
Tank Material: Not reported
Secondary Material: Not reported
Capacity: 1000
Substance: Diesel
Date Installed: Not reported
Date Last Used: 08/01/1997
Closure Status: Tank was Removed From Ground
Pipe Material: Other (Specify)
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Tank ID: 3883-4
Compartment ID: 3883-4
Compartment Num: 1
Alt. Tank ID: A1R1
Tank Status: Currently In Use
Tank Material: Composite - Steel with Fiberglass (ACT 100)
Secondary Material: Double-Walled
Capacity: 20000
Substance: Heating Oil
Date Installed: 08/01/1997
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Not reported
Spill Installed: Spill Bucket
Overfill Installed: Audible Alarm

Tank ID: 3883-5
Compartment ID: 3883-5
Compartment Num: 1
Alt. Tank ID: B1R1
Tank Status: Currently In Use
Tank Material: Composite - Steel with Fiberglass (ACT 100)
Secondary Material: Double-Walled
Capacity: 1000
Substance: Diesel

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002173565 **DIST/DIR:** 0.158 South **ELEVATION:** 138 **MAP ID:** 16

NAME: HARBOR TOWERS LIM.PART.

Rev: 03/03/2014

ADDRESS: 60 HANOVER ST
MERIDEN, CT 06451

ID/Status: 80-3883
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Date Installed: 08/01/1997
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Not reported
Spill Installed: Spill Bucket
Overfill Installed: Audible Alarm

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109720806 **DIST/DIR:** 0.166 South **ELEVATION:** 139 **MAP ID:** 17

NAME: MEDCO **Rev:** 07/30/2013

ADDRESS: 79 HANOVER ST PO BOX 637
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: CTB0084227
Year: 1987
Waste Occurrence: 1
UNNA: 1203
Hazard Class: FLAMMABLE
US Dot Description: WASTE GASOLINE, FLAMMABLE LIQUID
No of Containers: 001
Container Type: TT
Quantity: 500
Weight/Volume: G
Additional Description: Y
Handling Code: T01
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTB0084227
Year: 1987
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:

Year: 1987
Manifest ID: CTB0084227
TSDf EPA ID: CTD089631956
TSDf Name: EAST COAST ENVIRONMENTAL SERVICE CORP
TSDf Address: 454 QUINNIPIAC AVE
TSDf City,St,Zip: NEW HAVEN, CT 06513
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 06/11/1987
Transporter EPA ID: CTD089631956
Transporter Name: EAST COAST ENVIRONMENTAL SERVICE CORP
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109720806 **DIST/DIR:** 0.166 South **ELEVATION:** 139 **MAP ID:** 17

NAME: MEDCO **Rev:** 07/30/2013

ADDRESS: 79 HANOVER ST PO BOX 637
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CT\$000020470
Generator Phone: 2032375573
Generator Mailing Addr: 79 HANOVER ST PO BOX 637
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 06/11/1987
Date Received: 06/11/1987
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109750964 **DIST/DIR:** 0.172 East **ELEVATION:** 152 **MAP ID:** 18

NAME: FIRST CONGREGATIONAL CHURCH **Rev:** 07/30/2013
ADDRESS: 62 COLONY ST
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTF0920995
Year: 2000
Waste Occurrence: 1
UNNA: 3077
Hazard Class: 9
US Dot Description: ENVIRONMENTALLY HAZ. SUBSTANCES,SOLID
No of Containers: 004
Container Type: DM
Quantity: 1200
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0920995
Year: 2000
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 2000
Manifest ID: CTF0920995
TSDf EPA ID: RID040098352
TSDf Name: NORTHLAND ENVIRONMENTAL (STABLEX)
TSDf Address: 252 - 275 ALLENS AVE
TSDf City,St,Zip: PROVIDENCE, RI 02905
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 07/13/2000
Transporter EPA ID: CTR000003939
Transporter Name: ENVIRONMENTAL MAINT SVCS
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109750964 **DIST/DIR:** 0.172 East **ELEVATION:** 152 **MAP ID:** 18

NAME: FIRST CONGREGATIONAL CHURCH **Rev:** 07/30/2013
ADDRESS: 62 COLONY ST
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000023507
Generator Phone: Not reported
Generator Mailing Addr: 62 COLONY ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06451
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 07/13/2000
Date Received: 07/13/2000
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CPCS

EDR ID: S104254263 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E19

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO)
ADDRESS: 2 MAIN STREET
MERIDEN, CT 06450

Rev: 01/30/2014
ID/Status: Cleanup Initiated

SOURCE: CT Department of Energy & Environmental Protection

CPCS:

Site Type: LUST

Lust Status: Cleanup Initiated

PTP Form: Not reported

Program: Not reported

Comments: According To The Ust Notification Form 2x3k, 2x4k, 1x2k Gasoline, 1x1k

Hf And 1x500 Gal. Wo Tank Were Removed From The Subject Facility In

April Of 1989.American Realty Purchased The Property From Vinnie

Bariaro On 4/13/89.One Piece Of Correspondenc

Site Type Definition: Leaking Underground Storage Tanks Rem. Started

Site Type: Projects

Lust Status: Not reported

PTP Form: III

Program: Property Transfer Program

Comments: Projects

Site Type Definition: Property Transfer Form III

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254263 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E19

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO) **Rev:** 04/23/2010
ADDRESS: 2 MAIN STREET **ID/Status:** 1555
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 1555
Rem Master ID: 1566
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: GB/GA
Surface Water Quality Classification: C/B
Waste Type: CHLR VOC, HYDRO/OIL
Disposal: UST
Sample Data Available: False
Updated By: POST, M.
Update Program: CORE
Updated: 8/16/1994
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 1435
Source of referral: PTP
Date Received: 10/6/1993
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 10/6/1993
Outcome: PTP
Referral Id: 3691
Source of referral: REMEDIAL
Date Received: 8/18/1994
Staff Assigned: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254263 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E19

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO) **Rev:** 04/23/2010
ADDRESS: 2 MAIN STREET **ID/Status:** 1555
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Remediation Program: PWP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: 326
PTP Id: 962
Remediation Program: III
Remediation Program Entered: Not reported
Staff Assigned: WILCOX, J.
Remediation Program: PTP
Date dt_assign: Not reported
Project Phase: A
Order issued: False
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: False
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254263 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E19

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO)

Rev: 04/23/2010

ADDRESS: 2 MAIN STREET
MERIDEN, CT 06450

ID/Status: 1555

SOURCE: CT Department of Energy & Environmental Protection

SDADB:

Waste Id: 5

Waste Type: CHLR VOC

Description: Chlorinated Volatile Organic Compounds

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CT PROPERTY

EDR ID: S104100300 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E20

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO) **Rev:** 02/11/2014
ADDRESS: 2 MAIN STREET
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT Property:

Seller Name: Vincent C. Barillaro

Buyer Name: Jane W. Freeman trustee

Certifying Party: Not reported

Certifying Attention Person: Not reported

Title Of Certifying Person: Not reported

Certifying Person Address: Not reported

Certifying Person City,St,Zip: Not reported

Property Transfer Forms: Form III (DEP-PERD-PTP-203) when a discharge, spillage, uncontrolled loss, seepage or filtration of hazardous waste has occurred at the parcel that has not been fully remediated or the environmental conditions at the parcel are unknown. The person signing the Form III certification agrees to investigate and remediate the site in accordance with the remediation standards. The statute does not require completion of remediation before the parcel is transferred. Any person submitting a Form III shall simultaneously submit a completed Environmental Condition Assessment Form (ECAAF)(DEP-PERD-PTP-200).

Date Recieved: 04/21/1989

Ackn Date: 05/22/1989

Determination Date: Not reported

LEP Verified/DEP Approval Date: Not reported

Rem Id: 2096

Remediation Location Id: 1324

Date Entered: Not reported

Program: Property Transfer Program

GAO Site: False

Staff Full Name: Claire Foster

Super/Date: Not reported

Stage Of Project: INVESTIGATION

RP Level Of Activity: LOW

RP Needed Level Of Activity: MEDIUM

Staff Level Of Activity: LOW

Staff Needed Level Of Activity: LOW

Public Intrest: LOW

PRP Cooperation: LOW

Enforcement Status: NONE TAKEN

Level Of Complexity: LOW

Complex Eng Or Sci: False

Complex Due To Public Involvement: False

Politically Complex: False

Complex Enforcement: False

Coordination With Other Bureaus: False

EPA Involvement: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CT PROPERTY

EDR ID: S104100300 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E20

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO) **Rev:** 02/11/2014
ADDRESS: 2 MAIN STREET
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Staff Prefrence: PASS ON
Readiness For Transfer: READY TO TRANSFER NOW
Project Transfer Time: Not reported
Transfer Comments: Not reported
Staff As Of July 2000: Wilcox Jeff
Initial Staff: JBW
Type Of Transfer: Not reported
Salutation: Not reported
Relationship To Transfer: Not reported
Audit Date: Not reported
Verif Type: Not reported
Audit Outcome: Not reported
GW: GB/GA
Basin: Not reported
1st Payment: 900
Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
RTN: Not reported
Revised: Not reported
ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported
Report Overdue: Not reported
Ext Aprvl Sched: Not reported
License #: Not reported
Project Phase: Not reported
PT Comments: ref-WCU memo 7/17/89
EPA Id Number: Not reported
GW Class: Not reported
SW Class: Not reported
AO/C0: Not reported
Water Lead(Y Or N): Not reported
Priority: Not reported
Project Status(A, I Or D): Not reported
Last Updated: Not reported
SR Comments: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CT PROPERTY

EDR ID: S104100300 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E20

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO) **Rev:** 02/11/2014
ADDRESS: 2 MAIN STREET
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Priority Or Work-Load: Not reported
Status: Not reported
Notes: Not reported
Special Project Name: Not reported
Special Project Comments: Not reported
DOT Project: Not reported
Pt Counter: Not reported
Project Complete: False
Project Inactive: False
Int Deposit #: Not reported
Deposit #: Not reported
Spill Case #: Not reported
Diversion Id: Not reported
Public Notice: Not reported
RAP Received: Not reported
RAP Approved: Not reported
Compliance Category: Not reported
Delete Record: False
ECAF Reviewed By: Not reported
Not Locatable: False
Primary Address: True
AKA Site Name: False
Primary Site Name: True
AKA Site Address: False
Lead: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104100300 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E20

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO)
ADDRESS: 2 MAIN STREET
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Cleanup Initiated
ID/Status: 31697

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 3671
UST Facility Id: 3311
LUST Case Id: 31697
Lust Status: Cleanup Initiated
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 04/13/1989
Entry Date: Not reported
Site Case Id: Not reported
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: 231
LUST Owner Id: Not reported
UST Event Id: 3746
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104100300 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E20

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO)
ADDRESS: 2 MAIN STREET
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Cleanup Initiated
ID/Status: 31697

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: DOUGHENDEL@HENDELSINC.COM
Resp Party Name: American Realty
Resp Party Address: 35 Great Neck Road
Resp Party City,St,Zip: Waterford, CT 063853337
Resp Party Town Number: 152
Resp Party Phone: 8604435337
Resp Party Fax: Not reported
Resp Party Name 2: Doug Hendel
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: Not reported
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GA (maybe impaired)

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104100300 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E20

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO)
ADDRESS: 2 MAIN STREET
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Cleanup Initiated
ID/Status: 31697

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104100300 **DIST/DIR:** 0.178 ESE **ELEVATION:** 140 **MAP ID:** E20

NAME: HENNY PENNY (FORMERLY VINNIE'S AUTO)
ADDRESS: 2 MAIN STREET
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Cleanup Initiated
ID/Status: 31697

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: allison forrest/ForrestA
Date Stamp: 09/06/2013
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Not reported
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: MAM163584
Year: 2002
Waste Occurrence: 1
UNNA: 3077
Hazard Class: 9
US Dot Description: ENVIRONMENTALLY HAZ. SUBSTANCES,SOLID
No of Containers: 001
Container Type: DM
Quantity: 600
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: MAM163584
Year: 2002
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 2002
Manifest ID: MAM163584
TSDf EPA ID: MAD047075734
TSDf Name: JONES ENVIRONMENTAL SVS NE INC
TSDf Address: 263 HOWARD ST
TSDf City,St,Zip: LOWELL, MA 01851
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 12/18/2002
Transporter EPA ID: MAR000008425
Transporter Name: NORTH COUNTRY ENVIRONMENTAL SVS INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2036303311
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 12/18/2002
Date Received: 12/18/2002
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: MAM145245
Year: 2001
Waste Occurrence: 1
UNNA: 3082
Hazard Class: 9
US Dot Description: env. Hazardous substance liquid nos
No of Containers: 003
Container Type: DM
Quantity: 165
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: MAM145245
Year: 2001
Waste Occurrence: 2
UNNA: 3077
Hazard Class: 9
US Dot Description: ENVIRONMENTALLY HAZ. SUBSTANCES,SOLID
No of Containers: 001
Container Type: CF

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Quantity: 10
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: MAM145245
Year: 2001
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: MAM145245
Year: 2001
Waste Occurrence: 2
EPA Waste Code: D009
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 2001
Manifest ID: MAM145245
TSDf EPA ID: MAD047075734
TSDf Name: JONES ENV SERVICES NE INC
TSDf Address: 263 HOWARD ST
TSDf City,St,Zip: LOWELL, MA 01851
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 02/28/2001
Transporter EPA ID: MAD985294693
Transporter Name: OIL RECOVERY CORP
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013

ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2036303311
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 02/28/2001
Date Received: 04/10/2001
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: MAM286647
Year: 2000
Waste Occurrence: 1
UNNA: 3077
Hazard Class: 9
US Dot Description: ENVIRONMENTALLY HAZ. SUBSTANCES,SOLID
No of Containers: 001
Container Type: DM
Quantity: 55
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: MAM286647
Year: 2000
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Year: 2000
Manifest ID: MAM286647
TSDf EPA ID: MAD000604447
TSDf Name: LAIDLAW ENVIRONMENTAL SERVICES (NORTHEAST INC)
TSDf Address: 300 CANAL ST
TSDf City,St,Zip: LAWRENCE, MA 01845
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 04/11/2000
Transporter EPA ID: SCR000074591
Transporter Name: SAFETY-KLEEN TG INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2036303311
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Yes
Date Shipped: 04/11/2000
Date Received: 04/11/2000
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: NYB4006413
Year: 1993
Waste Occurrence: 1
UNNA: 1993
Hazard Class: FLAMMABLE
US Dot Description: WASTE FLAMMABLE LIQUID
No of Containers: 001

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Container Type: DM
Quantity: 350
Weight/Volume: P
Additional Description: Y
Handling Code: B
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYB4006413
Year: 1993
Waste Occurrence: 2
UNNA: 1325
Hazard Class: FLAMMABLE
US Dot Description: WASTE FLAMMABLE LIQUID
No of Containers: 001
Container Type: DM
Quantity: 15
Weight/Volume: P
Additional Description: Y
Handling Code: B
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYB4006413
Year: 1993
Waste Occurrence: 3
UNNA: 2672
Hazard Class: CORROSIVE
US Dot Description: WASTE AMMONIA SOLUTION
No of Containers: 002
Container Type: DM
Quantity: 120
Weight/Volume: P
Additional Description: Y
Handling Code: T
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: NYB4006413
Year: 1993
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYB4006413
Year: 1993
Waste Occurrence: 2
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYB4006413
Year: 1993
Waste Occurrence: 3
EPA Waste Code: D002
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1993
Manifest ID: NYB4006413
TSDf EPA ID: NYD049178296
TSDf Name: RADIAC RESEARCH CORP
TSDf Address: 261 KENT AVE
TSDf City,St,Zip: BROOKLYN, NY 11211
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 04/07/1993
Transporter EPA ID: NYD049178296
Transporter Name: RADIAC RESEARCH CORP
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 04/07/1993
Date Received: 04/08/1993
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: CTF0127200
Year: 1992
Waste Occurrence: 1
UNNA: 9193
Hazard Class: OXIDI/CORR
US Dot Description: WASTE LIQUID NOS, HYDROFLUORIC ACID
No of Containers: 001
Container Type: DM
Quantity: 550
Weight/Volume: P
Additional Description: Y
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0127200
Year: 1992
Waste Occurrence: 1
EPA Waste Code: D002
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1992
Manifest ID: CTF0127200
TSDf EPA ID: GAD000222083
TSDf Name: ENSCO ENVIROMENTAL SERVICE
TSDf Address: 1015 SOUTH HARRIS ST

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

TSDf City,St,Zip: DALTON, GA 30720
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 11/04/1992
Transporter EPA ID: NYD980769947
Transporter Name: HAZMAT TRUCKING
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 11/04/1992
Date Received: 11/09/1992
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: CTF0055872
Year: 1991
Waste Occurrence: 1
UNNA: 2831
Hazard Class: ORM-A
US Dot Description: WASTE, 1,1,1, TRICHLOROETHANE
No of Containers: 001
Container Type: DM
Quantity: 55
Weight/Volume: G
Additional Description: Not reported
Handling Code: T63

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0055872
Year: 1991
Waste Occurrence: 1
EPA Waste Code: F001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1991
Manifest ID: CTF0055872
TSDf EPA ID: MAD019371079
TSDf Name: GENERAL CHEMICAL CORP
TSDf Address: 133 LELAND ST
TSDf City,St,Zip: FRAMINGHAM, MA 01701
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 11/11/1991
Transporter EPA ID: CTD055310759
Transporter Name: HUBBARD HALL INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: 11/13/1991
Trans 2 EPA ID: MAD019371079
Trans 2 Name: GENERAL CHEMICAL CORPORATION,
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 11/11/1991
Date Received: 11/21/1991

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: NYA7736832
Year: 1990
Waste Occurrence: 1
UNNA: 9193
Hazard Class: OXID-CORRO
US Dot Description: WASTE OXID CORRO LIQ NOS NITRIC ACID
No of Containers: 001
Container Type: DM
Quantity: 328
Weight/Volume: P
Additional Description: Y
Handling Code: T
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYA7736832
Year: 1990
Waste Occurrence: 2
UNNA: 1325
Hazard Class: FLAMMABLE
US Dot Description: WASTE SOLID NOS FLUX/METHANOL
No of Containers: 001
Container Type: DM
Quantity: 10
Weight/Volume: P
Additional Description: Y
Handling Code: B
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYA7736832
Year: 1990
Waste Occurrence: 3
UNNA: 2672
Hazard Class: CORROSIVE
US Dot Description: WASTE AMMO HYDROX MAT'L
No of Containers: 002
Container Type: DM

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Quantity: 116
Weight/Volume: P
Additional Description: N
Handling Code: T
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYA7736832
Year: 1990
Waste Occurrence: 4
UNNA: 1759
Hazard Class: CORROSIVE
US Dot Description: WASTE SOLID MAT'L NOS BULK SODA ASH
No of Containers: 001
Container Type: DM
Quantity: 89
Weight/Volume: P
Additional Description: Y
Handling Code: T
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: NYA7736832
Year: 1990
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYA7736832
Year: 1990
Waste Occurrence: 2
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYA7736832
Year: 1990
Waste Occurrence: 3
EPA Waste Code: D002
Recycled Waste?: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYA7736832
Year: 1990
Waste Occurrence: 4
EPA Waste Code: D002
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1990
Manifest ID: NYA7736832
TSDf EPA ID: NYD049178296
TSDf Name: RADIAC RESEARCH CORP
TSDf Address: 261 KENT AVE
TSDf City,St,Zip: BROOKLYN, NY 11211
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 04/09/1990
Transporter EPA ID: NYD049178296
Transporter Name: RADIAC RESEARCH CORP
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 04/09/1990
Date Received: 04/09/1990
Last modified date: 04/27/2004

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Last modified by: IG
Comments: Not reported

Waste:
Manifest No: NYB2180988
Year: 1989
Waste Occurrence: 1
UNNA: 1230
Hazard Class: FLAMMABLE
US Dot Description: WASTE METHYL ALCOHOL
No of Containers: 001
Container Type: DM
Quantity: 250
Weight/Volume: P
Additional Description: Y
Handling Code: B
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYB2180988
Year: 1989
Waste Occurrence: 2
UNNA: 9193
Hazard Class: OXIDIZER
US Dot Description: WASTE OXIDIZER CORROSIVE LIQUID,
No of Containers: 001
Container Type: DM
Quantity: 340
Weight/Volume: P
Additional Description: Y
Handling Code: T
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYB2180988
Year: 1989
Waste Occurrence: 3
UNNA: 1325
Hazard Class: FLAMMABLE
US Dot Description: WASTE FLAMMABLE SOLID, NOS
No of Containers: 001
Container Type: DM
Quantity: 50

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Weight/Volume: P
Additional Description: Y
Handling Code: B
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYB2180988
Year: 1989
Waste Occurrence: 4
UNNA: 2672
Hazard Class: CORROSIVE
US Dot Description: WASTE AMMONIUM HYDROXIDE
No of Containers: 002
Container Type: DM
Quantity: 120
Weight/Volume: P
Additional Description: Y
Handling Code: T
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: NYB2180988
Year: 1989
Waste Occurrence: 1
EPA Waste Code: F003
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYB2180988
Year: 1989
Waste Occurrence: 2
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Manifest No: NYB2180988
Year: 1989
Waste Occurrence: 3
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

DEO Who Last Modified Record: IG

Manifest No: NYB2180988
Year: 1989
Waste Occurrence: 4
EPA Waste Code: D002
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1989
Manifest ID: NYB2180988
TSDf EPA ID: NYD049178296
TSDf Name: RADIAC RESEARCH CORP
TSDf Address: 261 KENT AVE
TSDf City,St,Zip: BROOKLYN, NY 11211
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 11/30/1989
Transporter EPA ID: NYD049178296
Transporter Name: RADIAC RESEARCH CORPORATION
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 11/30/1989
Date Received: 11/30/1989
Last modified date: 04/27/2004
Last modified by: IG

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Comments: Not reported

Waste:

Manifest No: CTC0148477
Year: 1988
Waste Occurrence: 1
UNNA: 2831
Hazard Class: ORM-A
US Dot Description: WASTE, 1,1,1, TRICHLOROETHANE
No of Containers: 001
Container Type: DM
Quantity: 566
Weight/Volume: P
Additional Description: Y
Handling Code: T63
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTC0148477
Year: 1988
Waste Occurrence: 1
EPA Waste Code: F001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:

Year: 1988
Manifest ID: CTC0148477
TSDf EPA ID: MAD019371079
TSDf Name: GENERAL CHEMICAL CORP
TSDf Address: 133 LELAND ST
TSDf City,St,Zip: FRAMINGHAM, MA 01701
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 11/07/1988
Transporter EPA ID: CTD055310759
Transporter Name: HUBBARD HALL INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: 11/09/1988

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 EPA ID: MAD019371079
Trans 2 Name: GENERAL CHEMICAL CORPORATION,
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: No
Discrepancies: No
Date Shipped: 11/07/1988
Date Received: 11/14/1988
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: CTB0072904
Year: 1987
Waste Occurrence: 1
UNNA: 2831
Hazard Class: ORM-A
US Dot Description: WASTE, 1,1,1, TRICHLOROETHANE
No of Containers: 001
Container Type: DM
Quantity: 355
Weight/Volume: P
Additional Description: Y
Handling Code: T63
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTB0072904
Year: 1987
Waste Occurrence: 1
EPA Waste Code: F001
Recycled Waste?: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:

Year: 1987
Manifest ID: CTB0072904
TSDf EPA ID: MAD019371079
TSDf Name: GENERAL CHEMICAL CORP
TSDf Address: 133 LELAND ST
TSDf City,St,Zip: FRAMINGHAM, MA 01701
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 04/07/1987
Transporter EPA ID: CTD055310759
Transporter Name: HUBBARD HALL INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: 04/08/1987
Trans 2 EPA ID: MAD019371079
Trans 2 Name: GENERAL CHEMICAL CORPORATION,
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: No
Discrepancies: No
Date Shipped: 04/07/1987
Date Received: 04/09/1987
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:

Manifest No: CTB0009263
Year: 1986
Waste Occurrence: 1

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

UNNA: 2831
Hazard Class: ORM-A
US Dot Description: WASTE, 1,1,1, TRICHLOROETHANE
No of Containers: 001
Container Type: DM
Quantity: 304
Weight/Volume: P
Additional Description: Y
Handling Code: T63
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTB0009263
Year: 1986
Waste Occurrence: 1
EPA Waste Code: F001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1986
Manifest ID: CTB0009263
TSDf EPA ID: MAD019371079
TSDf Name: GENERAL CHEMICAL CORP
TSDf Address: 133 LELAND ST
TSDf City,St,Zip: FRAMINGHAM, MA 01701
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 09/22/1986
Transporter EPA ID: CTD055310759
Transporter Name: HUBBARD HALL CHEMICAL CO
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: 09/24/1986
Trans 2 EPA ID: CTD019371079
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: No
Discrepancies: No
Date Shipped: 09/22/1986
Date Received: 09/25/1986
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: MAB037919
Year: 1985
Waste Occurrence: 1
UNNA: 2831
Hazard Class: ORM-A
US Dot Description: WASTE 111 TRICHLOROETHANE
No of Containers: 001
Container Type: DM
Quantity: 76
Weight/Volume: P
Additional Description: Y
Handling Code: S01
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: MAB037919
Year: 1985
Waste Occurrence: 1
EPA Waste Code: F001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1985
Manifest ID: MAB037919
TSDf EPA ID: MAD019371079

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

TSDf Name: GENERAL CHEMICAL CORPORATION
TSDf Address: 133 LELAND STREET
TSDf City,St,Zip: FRAMINGHAM, MA 01701
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 02/04/1985
Transporter EPA ID: CTD055310759
Transporter Name: HUBBARD HALL, INC.
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: 02/06/1985
Trans 2 EPA ID: MAD019371079
Trans 2 Name: GENERAL CHEMICAL CORPORATION,
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: No
Discrepancies: No
Date Shipped: 02/04/1985
Date Received: 02/12/1985
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: NYA104531-4
Year: 1984
Waste Occurrence: 1
UNNA: 2831
Hazard Class: ORM-A
US Dot Description: WASTE TRICHLOROETHANE
No of Containers: 001
Container Type: DM
Quantity: 40
Weight/Volume: P

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Additional Description: Y
Handling Code: L
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: NYA104531-4
Year: 1984
Waste Occurrence: 1
EPA Waste Code: F001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1984
Manifest ID: NYA104531-4
TSDf EPA ID: NYD049178296
TSDf Name: RADIAC RESEARCH CORP
TSDf Address: 261 KENT AVE
TSDf City,St,Zip: BROOKLYN, NY 11211
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 09/21/1984
Transporter EPA ID: NYD049178296
Transporter Name: RADIAC RESEARCH CORP
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD980909295
Generator Phone: 2032382351
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109730046 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F21

NAME: R F S CABLEWAVE SYSTEMS DIV **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Date Shipped: 09/21/1984
Date Received: 09/21/1984
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

NY MANIFEST:

EPA ID: CTD980909295
Country: USA
Mailing Name: CANBERRA INDUSTRIES INC
Mailing Contact: DAVID R GELPKE
Mailing Address: ONE STATE STREET
Mailing Address 2: Not reported
Mailing City: MERIDEN
Mailing State: CT
Mailing Zip: 06450
Mailing Zip4: Not reported
Mailing Country: USA
Mailing Phone: 203-238-2351

Document ID: NYA3089261
Manifest Status: Completed copy
Trans1 State ID: NJXJ-71JG
Trans2 State ID: Not reported
Generator Ship Date: 860509
Trans1 Recv Date: 860509
Trans2 Recv Date: Not reported
TSD Site Recv Date: 860509
Part A Recv Date: 860515
Part B Recv Date: 860520
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDF ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00204
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00510
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Quantity: 00320
Units: P - Pounds
Number of Containers: 008
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00514
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 86

Document ID: NYA7707312
Manifest Status: Completed copy
Trans1 State ID: 000000000
Trans2 State ID: 000000000
Generator Ship Date: 890817
Trans1 Recv Date: 890817
Trans2 Recv Date: Not reported
TSD Site Recv Date: 890817
Part A Recv Date: 890822
Part B Recv Date: 890830
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00403
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00532
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 89

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Document ID: NYB2182014
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: LC5437NY
Trans2 State ID: Not reported
Generator Ship Date: 900208
Trans1 Recv Date: 900208
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900208
Part A Recv Date: 900223
Part B Recv Date: 900312
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDf ID: NYD049178296
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00682
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00240
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 90

Document ID: NYB4007358
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: PD8070
Trans2 State ID: Not reported
Generator Ship Date: 920722
Trans1 Recv Date: 920722
Trans2 Recv Date: Not reported
TSD Site Recv Date: 920723
Part A Recv Date: Not reported
Part B Recv Date: 920828
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDf ID: NYD049178296

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00600
Units: P - Pounds
Number of Containers: 003
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00400
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00030
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00150
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 92

Document ID: NYB2180988
Manifest Status: Completed copy
Trans1 State ID: LC5437NY
Trans2 State ID: Not reported
Generator Ship Date: 891130
Trans1 Recv Date: 891130
Trans2 Recv Date: Not reported
TSD Site Recv Date: 891130
Part A Recv Date: 891211
Part B Recv Date: 891222
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDF ID: NYD049178296

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Waste Code: F003 - UNKNOWN
Quantity: 00250
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00340
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00050
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00120
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 01061
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 89

Document ID: NYA7650567
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: PC4339NY
Trans2 State ID: Not reported
Generator Ship Date: 900606
Trans1 Recv Date: 900606
Trans2 Recv Date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

TSD Site Recv Date: 900606
Part A Recv Date: 900720
Part B Recv Date: 900727
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00210
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00354
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00056
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00306
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00208
Units: P - Pounds
Number of Containers: 001
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: D008 - LEAD 5.0 MG/L TCLP
Quantity: 00260
Units: P - Pounds

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYA2140605
Manifest Status: Completed copy
Trans1 State ID: NY89851-G
Trans2 State ID: Not reported
Generator Ship Date: 850314
Trans1 Recv Date: 850314
Trans2 Recv Date: Not reported
TSD Site Recv Date: 850314
Part A Recv Date: 850318
Part B Recv Date: 850319
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDF ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00325
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00086
Units: P - Pounds
Number of Containers: 003
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00040
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00055
Units: P - Pounds

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Number of Containers: 002
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 85

Document ID: NYA7736832
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: IC9834NY
Trans2 State ID: Not reported
Generator Ship Date: 900409
Trans1 Recv Date: 900409
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900409
Part A Recv Date: 900507
Part B Recv Date: 900530
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDf ID: NYD049178296
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00328
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00010
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00116
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00089
Units: P - Pounds

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00246
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 90

Document ID: NYB2191581
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: PC4340NY
Trans2 State ID: Not reported
Generator Ship Date: 900907
Trans1 Recv Date: 900907
Trans2 Recv Date: Not reported
TSD Site Recv Date: 900907
Part A Recv Date: 900917
Part B Recv Date: 901010
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDf ID: NYD049178296
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00300
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00015
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00057
Units: P - Pounds

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00010
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 90

Document ID: NYB4006413
Manifest Status: Completed copy
Trans1 State ID: PD8070NY
Trans2 State ID: Not reported
Generator Ship Date: 930407
Trans1 Recv Date: 930407
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930408
Part A Recv Date: 930420
Part B Recv Date: 930423
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00350
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00015
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00120
Units: P - Pounds

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 93

Document ID: NYB4366233
Manifest Status: Completed copy
Trans1 State ID: Not reported
Trans2 State ID: Not reported
Generator Ship Date: 930527
Trans1 Recv Date: 930527
Trans2 Recv Date: Not reported
TSD Site Recv Date: 930527
Part A Recv Date: 930615
Part B Recv Date: 930611
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDF ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00400
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00400
Units: P - Pounds
Number of Containers: 004
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 93

Document ID: NYA3089272
Manifest Status: Completed copy
Trans1 State ID: 817666VNY
Trans2 State ID: Not reported
Generator Ship Date: 861212
Trans1 Recv Date: 861212
Trans2 Recv Date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

TSD Site Recv Date: 861212
Part A Recv Date: 861218
Part B Recv Date: 861226
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDF ID: NYD049178296
Waste Code: D001 - NON-LISTED IGNITABLE WASTES
Quantity: 00200
Units: P - Pounds
Number of Containers: 005
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00289
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00378
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00040
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 86

Document ID: NYA2140578
Manifest Status: Completed after the designated time period for a TSDF to get a copy to the DEC
Trans1 State ID: NY89851GC
Trans2 State ID: Not reported
Generator Ship Date: 841219
Trans1 Recv Date: 841219
Trans2 Recv Date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

TSD Site Recv Date: 841219
Part A Recv Date: 841227
Part B Recv Date: 850102
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: D002 - NON-LISTED CORROSIVE WASTES
Quantity: 00056
Units: P - Pounds
Number of Containers: 002
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 84

Document ID: NYA6368049
Manifest Status: Completed copy
Trans1 State ID: NJXJ-70JG
Trans2 State ID: Not reported
Generator Ship Date: 870415
Trans1 Recv Date: 870415
Trans2 Recv Date: Not reported
TSD Site Recv Date: 870415
Part A Recv Date: 870421
Part B Recv Date: 870423
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00210
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00575
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Waste Code: Not reported
Quantity: 00405
Units: P - Pounds
Number of Containers: 008
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00417
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 87

Document ID: NYB2182023
Manifest Status: Completed after the designated time period for a TSDf to get a copy to the DEC
Trans1 State ID: PA4340NY
Trans2 State ID: Not reported
Generator Ship Date: 901213
Trans1 Recv Date: 901213
Trans2 Recv Date: Not reported
TSD Site Recv Date: 901215
Part A Recv Date: 910114
Part B Recv Date: 910109
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSDf ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00214
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00369
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Waste Code: Not reported
Quantity: 00057
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 90

Document ID: NYA2140614
Manifest Status: Completed copy
Trans1 State ID: NJXXN-63B
Trans2 State ID: Not reported
Generator Ship Date: 850514
Trans1 Recv Date: 850514
Trans2 Recv Date: Not reported
TSD Site Recv Date: 850514
Part A Recv Date: 850523
Part B Recv Date: 850528
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00013
Units: P - Pounds
Number of Containers: 001
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00159
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00829
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Waste Code: Not reported
Quantity: 00028
Units: P - Pounds
Number of Containers: 001
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Year: 85

Document ID: NYA6368076
Manifest Status: Completed copy
Trans1 State ID: NJXJ-71JG
Trans2 State ID: Not reported
Generator Ship Date: 871112
Trans1 Recv Date: 871112
Trans2 Recv Date: Not reported
TSD Site Recv Date: 871112
Part A Recv Date: 871123
Part B Recv Date: 871123
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00231
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00680
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00300
Units: P - Pounds
Number of Containers: 006
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Waste Code: Not reported
Quantity: 00961
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 87

Document ID: NYA5768811
Manifest Status: Completed copy
Trans1 State ID: XJ70J6NJ
Trans2 State ID: Not reported
Generator Ship Date: 880526
Trans1 Recv Date: 880526
Trans2 Recv Date: Not reported
TSD Site Recv Date: 880526
Part A Recv Date: 880603
Part B Recv Date: 880606
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00400
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 00965
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: Not reported
Quantity: 02160
Units: P - Pounds
Number of Containers: 014
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: NY Department of Environmental Conservation

Year: 88

Document ID: NYA1045314
Manifest Status: Completed copy
Trans1 State ID: NYXXX-57G
Trans2 State ID: Not reported
Generator Ship Date: 840921
Trans1 Recv Date: 840921
Trans2 Recv Date: Not reported
TSD Site Recv Date: 840921
Part A Recv Date: 841002
Part B Recv Date: 841002
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: F001 - UNKNOWN
Quantity: 00040
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 100
Year: 84

Document ID: NYA1045323
Manifest Status: Completed copy
Trans1 State ID: NJXXX-57G
Trans2 State ID: Not reported
Generator Ship Date: 840921
Trans1 Recv Date: 840921
Trans2 Recv Date: Not reported
TSD Site Recv Date: 840921
Part A Recv Date: 841002
Part B Recv Date: 841002
Generator EPA ID: CTD980909295
Trans1 EPA ID: NYD049178296
Trans2 EPA ID: Not reported
TSD ID: NYD049178296
Waste Code: F003 - UNKNOWN
Quantity: 00248
Units: P - Pounds
Number of Containers: 001

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000162963 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F22

NAME: RADIO FREQUENCY SYSTEMS **Rev:** 12/31/2013

ADDRESS: 1 STATE ST
MERIDEN, CT 06450
NEW HAVEN

SOURCE: NY Department of Environmental Conservation

Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 100
Year: 84

[Click this hyperlink](#) while viewing on your computer to access
15 additional NY_MANIFEST: record(s) in the EDR Site Report.

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109748770 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F23

NAME: RFS CABLE WAVE SYSTEMS **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: MAK814883
Year: 1999
Waste Occurrence: 1
UNNA: 3082
Hazard Class: 9
US Dot Description: env. Hazardous substance liquid nos
No of Containers: 001
Container Type: DM
Quantity: 222
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: MAK814883
Year: 1999
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1999
Manifest ID: MAK814883
TSDf EPA ID: MAD000604447
TSDf Name: LAIDLAW ENV SVS (NORTHEAST)
TSDf Address: 300 CANAL ST
TSDf City,St,Zip: LAWRENCE, MA 01845
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 01/18/1999
Transporter EPA ID: SCD987574647
Transporter Name: LAIDLAW ENVIRONMENTAL SERVICES
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109748770 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F23

NAME: RFS CABLE WAVE SYSTEMS **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000021095
Generator Phone: Not reported
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Yes
Date Shipped: 01/18/1999
Date Received: 01/19/1999
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: MAK494355
Year: 1998
Waste Occurrence: 1
UNNA: 3082
Hazard Class: 9
US Dot Description: env. Hazardous substance liquid nos
No of Containers: 001
Container Type: DM
Quantity: 477
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: MAK494355
Year: 1998
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109748770 **DIST/DIR:** 0.184 SE **ELEVATION:** 148 **MAP ID:** F23

NAME: RFS CABLE WAVE SYSTEMS **Rev:** 07/30/2013
ADDRESS: 1 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Detail:

Year: 1998
Manifest ID: MAK494355
TSDf EPA ID: MAD000604447
TSDf Name: LAIDLAW ENVIRO SVS (NORTHEAST INC)
TSDf Address: 300 CANAL ST
TSDf City,St,Zip: LAWRENCE, MA 01845
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 07/01/1998
Transporter EPA ID: SCD987574647
Transporter Name: LAIDLAW ENVIRONMENTAL SERVICES
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000021095
Generator Phone: Not reported
Generator Mailing Addr: 1 STATE ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 07/01/1998
Date Received: 07/01/1998
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970101 **DIST/DIR:** 0.185 ESE **ELEVATION:** 137 **MAP ID:** 24

NAME: MERIDEN AMTRAK STATION **Rev:** 03/20/2014
ADDRESS: 60 STATE STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of
Grant type: Assessment
Property name: MERIDEN AMTRAK STATION
Property #: Not reported
Parcel size: .34
Property Description: The site existed as part of the Meriden Britannia Company/International Silver Company (manufacturers of silverware) from the 1800s until the 1950s. The City of Meriden purchased the site from Joseph and Gloria Stone in 1971 as part of the Central Area Urban Renewal. Since 1970s the site has been used as a passenger train station.
Latitude: 41.5392036
Longitude: -72.8007687
HCM label: Address Matching-House Number
Map scale: Not reported
Point of reference: Entrance Point of a Facility or Station
Datum: North American Datum of 1983
ACRES property ID: 146181
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 1800
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Unknown
Video available: Not reported
Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970101 **DIST/DIR:** 0.185 ESE **ELEVATION:** 137 **MAP ID:** 24

NAME: MERIDEN AMTRAK STATION **Rev:** 03/20/2014
ADDRESS: 60 STATE STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970101 **DIST/DIR:** 0.185 ESE **ELEVATION:** 137 **MAP ID:** 24

NAME: MERIDEN AMTRAK STATION **Rev:** 03/20/2014
ADDRESS: 60 STATE STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Past use commercial acreage: Not reported
Past use industrial acreage: .34
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109734622 **DIST/DIR:** 0.191 ESE **ELEVATION:** 140 **MAP ID:** E25

NAME: AMES REALTY **Rev:** 07/30/2013
ADDRESS: 14 WEST MAIN ST
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTA0069369
Year: 1985
Waste Occurrence: 1
UNNA: 9189
Hazard Class: ORM-E
US Dot Description: HAZARDOUS WASTE LIQUID NOS
No of Containers: 002
Container Type: DM
Quantity: 100
Weight/Volume: G
Additional Description: Y
Handling Code: S02
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTA0069369
Year: 1985
Waste Occurrence: 1
EPA Waste Code: D007
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1985
Manifest ID: CTA0069369
TSDf EPA ID: CTD072138969
TSDf Name: ENVIRONMENTAL WASTE RESOURCES INC
TSDf Address: 130 FREIGHT ST
TSDf City,St,Zip: WATERBURY, CT 06702
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 07/19/1985
Transporter EPA ID: CTD072138969
Transporter Name: ENVIRONMENTAL WASTE RESOURCES, INC.
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109734622 **DIST/DIR:** 0.191 ESE **ELEVATION:** 140 **MAP ID:** E25

NAME: AMES REALTY **Rev:** 07/30/2013
ADDRESS: 14 WEST MAIN ST
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000001504
Generator Phone: 2032352595
Generator Mailing Addr: 14 WEST MAIN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: Not reported
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 07/19/1985
Date Received: 07/19/1985
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U004009595 **DIST/DIR:** 0.199 SSW **ELEVATION:** 143 **MAP ID:** G26

NAME: MOTOR VEHICLE DEPT. (BUTLER ST. FIRE)

Rev: 03/03/2014

ADDRESS: 47 BUTLER ST
MERIDEN, CT 06451

ID/Status: 80-7050
ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-7050
Latitude: Not reported
Longitude: Not reported
Owner: CITY OF MERIDEN
Owner Address: 142 E MAIN ST
Owner Address 2: Not reported
Owner City,St,Zip: MERIDEN, CT 064505605

Tank ID: 7050-1
Compartment ID: 7050-1
Compartment Num: 1
Alt. Tank ID: A1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 1000
Substance: Gasoline
Date Installed: 12/01/1953
Date Last Used: 11/01/1991
Closure Status: Tank was Removed From Ground
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456733 **DIST/DIR:** 0.202 SE **ELEVATION:** 152 **MAP ID:** F27

NAME: FORMER CHURCH AND MORSE **Rev:** 03/20/2014
ADDRESS: 33 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FORMER CHURCH AND MORSE
Property #: Not reported
Parcel size: .48
Property Description: The site was utilized for industrial/commercial purposes from the late 1800 until the late 2000s, primarily occupied by Church and Morse, a former retail hardware store
Latitude: Not reported
Longitude: Not reported
HCM label: Not reported
Map scale: Not reported
Point of reference: Not reported
Datum: North American Datum of 1983
ACRES property ID: 156321
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 1150
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 0
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden
Did owner change: Y
Cleanup required: Unknown
Video available: No
Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456733 **DIST/DIR:** 0.202 SE **ELEVATION:** 152 **MAP ID:** F27

NAME: FORMER CHURCH AND MORSE **Rev:** 03/20/2014
ADDRESS: 33 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: .48
Past use industrial acreage: Not reported
Future use greenspace acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456733 **DIST/DIR:** 0.202 SE **ELEVATION:** 152 **MAP ID:** F27

NAME: FORMER CHURCH AND MORSE **Rev:** 03/20/2014
ADDRESS: 33 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FORMER CHURCH AND MORSE
Property #: Not reported
Parcel size: .48

Property Description: The site was utilized for industrial/commercial purposes from the late 1800 until the late 2000s, primarily occupied by Church and Morse, a former retail hardware store

Latitude: Not reported
Longitude: Not reported
HCM label: Not reported
Map scale: Not reported
Point of reference: Not reported
Datum: North American Datum of 1983
ACRES property ID: 156321
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 2100
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden
Did owner change: Y
Cleanup required: Unknown
Video available: No
Photo available: Yes
Institutional controls required: U

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456733 **DIST/DIR:** 0.202 SE **ELEVATION:** 152 **MAP ID:** F27

NAME: FORMER CHURCH AND MORSE **Rev:** 03/20/2014
ADDRESS: 33 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456733 **DIST/DIR:** 0.202 SE **ELEVATION:** 152 **MAP ID:** F27

NAME: FORMER CHURCH AND MORSE

Rev: 03/20/2014

ADDRESS: 33 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Past use residential acreage: Not reported
Past use commercial acreage: .48
Past use industrial acreage: Not reported
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CPCS

EDR ID: S105456147 **DIST/DIR:** 0.202 ESE **ELEVATION:** 141 **MAP ID:** E28

NAME: MERIDEN SENIOR CENTER
ADDRESS: 22 WEST MAIN ST.
MERIDEN, CT 06450

Rev: 01/30/2014
ID/Status: Investigation

SOURCE: CT Department of Energy & Environmental Protection

CPCS:
Site Type: LUST
Lust Status: Investigation
PTP Form: Not reported
Program: Not reported
Comments: Not reported
Site Type Definition: Leaking Underground Storage Tanks Investigation

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S108789027 **DIST/DIR:** 0.202 ESE **ELEVATION:** 141 **MAP ID:** E29

NAME: MERIDEN SENIOR CENTER
ADDRESS: 22 WEST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Investigation
ID/Status: 28428

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 402
UST Facility Id: 7058
LUST Case Id: 28428
Lust Status: Investigation
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 01/13/1989
Entry Date: Not reported
Site Case Id: Not reported
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: 1130
LUST Owner Id: Not reported
UST Event Id: 401
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S108789027 **DIST/DIR:** 0.202 ESE **ELEVATION:** 141 **MAP ID:** E29

NAME: MERIDEN SENIOR CENTER
ADDRESS: 22 WEST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Investigation
ID/Status: 28428

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 14
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S108789027 **DIST/DIR:** 0.202 ESE **ELEVATION:** 141 **MAP ID:** E29

NAME: MERIDEN SENIOR CENTER
ADDRESS: 22 WEST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Investigation
ID/Status: 28428

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlaid: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S108789027 **DIST/DIR:** 0.202 ESE **ELEVATION:** 141 **MAP ID:** E29

NAME: MERIDEN SENIOR CENTER
ADDRESS: 22 WEST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Investigation
ID/Status: 28428

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Not reported
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109752120 **DIST/DIR:** 0.202 SE **ELEVATION:** 152 **MAP ID:** F30

NAME: TUNXIS OHRS **Rev:** 07/30/2013
ADDRESS: 35 NORTH COLONY ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTF1010983
Year: 2001
Waste Occurrence: 1
UNNA: 3082
Hazard Class: 9
US Dot Description: env. Hazardous substance liquid nos
No of Containers: 001
Container Type: TT
Quantity: 3025
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF1010983
Year: 2001
Waste Occurrence: 1
EPA Waste Code: F002
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 2001
Manifest ID: CTF1010983
TSDf EPA ID: CTD021816889
TSDf Name: UNITED OIL RECOVERY INC
TSDf Address: 136 GRACEY AVE
TSDf City,St,Zip: MERIDEN, CT 06450
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 06/25/2001
Transporter EPA ID: CTD021816889
Transporter Name: UNITED OIL RECOVERY INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109752120 **DIST/DIR:** 0.202 SE **ELEVATION:** 152 **MAP ID:** F30

NAME: TUNXIS OHRS **Rev:** 07/30/2013

ADDRESS: 35 NORTH COLONY ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000025823
Generator Phone: Not reported
Generator Mailing Addr: 35 NORTH COLONY ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 06/25/2001
Date Received: 06/25/2001
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109754293 **DIST/DIR:** 0.202 ENE **ELEVATION:** 152 **MAP ID:** 31

NAME: US POSTAL SERVICE **Rev:** 07/30/2013
ADDRESS: 87 COLONY ST
MERIDEN, CT 06750

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTF1177367
Year: 2005
Waste Occurrence: 1
UNNA: 1479
Hazard Class: 5.1
US Dot Description: OXIDIZING SOLID, N.O.S.
No of Containers: 1
Container Type: DF
Quantity: 10
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2006-02-02 00:00:00
DEO Who Last Modified Record: CYF

Manifest No: CTF1177367
Year: 2005
Waste Occurrence: 2
UNNA: 1950
Hazard Class: 2.1
US Dot Description: AEROSOLS, FLAMMABLE
No of Containers: 1
Container Type: DF
Quantity: 88
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2006-02-02 00:00:00
DEO Who Last Modified Record: CYF

Waste CD:
Manifest No: CTF1177367
Year: 2005
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2006-02-02 00:00:00
DEO Who Last Modified Record: CYF

Manifest No: CTF1177367
Year: 2005

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109754293 **DIST/DIR:** 0.202 ENE **ELEVATION:** 152 **MAP ID:** 31

NAME: US POSTAL SERVICE **Rev:** 07/30/2013
ADDRESS: 87 COLONY ST
MERIDEN, CT 06750

SOURCE: CT Department of Energy & Environmental Protection

Waste Occurrence: 2
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2006-02-02 00:00:00
DEO Who Last Modified Record: CYF

Manifest No: CTF1177367
Year: 2005
Waste Occurrence: 2
EPA Waste Code: F001
Recycled Waste?: False
Date Record Was Last Modified: 2006-02-02 00:00:00
DEO Who Last Modified Record: CYF

Detail:
Year: 2005
Manifest ID: CTF1177367
TSDf EPA ID: RID040098352
TSDf Name: NORTHLAND ENVIRONMENTAL INC.
TSDf Address: 275 ALLENS LANE
TSDf City,St,Zip: 275 ALLENS LANE, RI 02905
TSDf Country: USA
TSDf Telephone: 4017816340
Transport Date: 03/04/2005
Transporter EPA ID: CTR000003939
Transporter Name: ENVIRONMENTAL MAINTENANCE SERVICES, INC.
Transporter Country: USA
Transporter Phone: (203)758-5550
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000028600
Generator Phone: (203)235-5465
Generator Mailing Addr: 87 COLONY ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06750-
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109754293 **DIST/DIR:** 0.202 ENE **ELEVATION:** 152 **MAP ID:** 31

NAME: US POSTAL SERVICE **Rev:** 07/30/2013

ADDRESS: 87 COLONY ST
MERIDEN, CT 06750

SOURCE: CT Department of Energy & Environmental Protection

Date Shipped: 03/04/2005
Date Received: 03/08/2005
Last modified date: 02/02/2006
Last modified by: CYF
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456472 **DIST/DIR:** 0.209 SE **ELEVATION:** 151 **MAP ID:** H32

NAME: 51-53 SOUTH COLONY ST **Rev:** 03/20/2014
ADDRESS: 51-53 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of
Grant type: Assessment
Property name: 51-53 SOUTH COLONY ST
Property #: Not reported
Parcel size: .33
Property Description: The site was utilized for industrial/commercial purposes from the late 1800s until the 1990s. This included an electric generating facility, a welding company, and a furniture store. It was later used as a warehouse.
Latitude: 41.5364473
Longitude: -72.8027498
HCM label: Address Matching-House Number
Map scale: Not reported
Point of reference: Entrance Point of a Facility or Station
Datum: North American Datum of 1983
ACRES property ID: 156322
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 1150
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 0
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden
Did owner change: Y
Cleanup required: Unknown
Video available: No
Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456472 **DIST/DIR:** 0.209 SE **ELEVATION:** 151 **MAP ID:** H32

NAME: 51-53 SOUTH COLONY ST **Rev:** 03/20/2014
ADDRESS: 51-53 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: .33
Past use industrial acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456472 **DIST/DIR:** 0.209 SE **ELEVATION:** 151 **MAP ID:** H32

NAME: 51-53 SOUTH COLONY ST **Rev:** 03/20/2014
ADDRESS: 51-53 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Assessment
Property name: 51-53 SOUTH COLONY ST
Property #: Not reported
Parcel size: .33
Property Description: The site was utilized for industrial/commercial purposes from the late 1800s until the 1990s. This included an electric generating facility, a welding company, and a furniture store. It was later used as a warehouse.

Latitude: 41.5364473
Longitude: -72.8027498
HCM label: Address Matching-House Number
Map scale: Not reported
Point of reference: Entrance Point of a Facility or Station
Datum: North American Datum of 1983
ACRES property ID: 156322
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 2300
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden
Did owner change: Y
Cleanup required: Unknown
Video available: No

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456472 **DIST/DIR:** 0.209 SE **ELEVATION:** 151 **MAP ID:** H32

NAME: 51-53 SOUTH COLONY ST **Rev:** 03/20/2014
ADDRESS: 51-53 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016456472 **DIST/DIR:** 0.209 SE **ELEVATION:** 151 **MAP ID:** H32

NAME: 51-53 SOUTH COLONY ST

Rev: 03/20/2014

ADDRESS: 51-53 SOUTH COLONY ST
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: .33
Past use industrial acreage: Not reported
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002027907 **DIST/DIR:** 0.210 SSW **ELEVATION:** 141 **MAP ID:** G33

NAME: HANOVER TOWERS REALTY
ADDRESS: 76 BUTLER ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-3879
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

UST:
Facility Id: 80-3879
Latitude: Not reported
Longitude: Not reported
Owner: CARABETTA MANAGEMENT COMPANY
Owner Address: 200 PRATT ST
Owner Address 2: Not reported
Owner City,St,Zip: MERIDEN, CT 064504220

Tank ID: 3879-1
Compartment ID: 3879-1
Compartment Num: 1
Alt. Tank ID: A1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 20000
Substance: Heating Oil
Date Installed: 06/01/1980
Date Last Used: 08/01/1997
Closure Status: Tank was Removed From Ground
Pipe Material: Not reported
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Tank ID: 3879-2
Compartment ID: 3879-2
Compartment Num: 1
Alt. Tank ID: A2
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 20000
Substance: Heating Oil
Date Installed: 06/01/1980
Date Last Used: 08/01/1997
Closure Status: Tank was Removed From Ground
Pipe Material: Not reported
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002027907 **DIST/DIR:** 0.210 SSW **ELEVATION:** 141 **MAP ID:** G33

NAME: HANOVER TOWERS REALTY
ADDRESS: 76 BUTLER ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-3879
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Tank ID: 3879-3
Compartment ID: 3879-3
Compartment Num: 1
Alt. Tank ID: B1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 1000
Substance: Diesel
Date Installed: 01/01/1980
Date Last Used: 08/01/1997
Closure Status: Tank was Removed From Ground
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Tank ID: 3879-4
Compartment ID: 3879-4
Compartment Num: 1
Alt. Tank ID: A1R1
Tank Status: Currently In Use
Tank Material: Composite - Steel with Fiberglass (ACT 100)
Secondary Material: Double-Walled
Capacity: 20000
Substance: Heating Oil
Date Installed: 08/01/1997
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Not reported
Spill Installed: Spill Bucket
Overfill Installed: Audible Alarm

Tank ID: 3879-5
Compartment ID: 3879-5
Compartment Num: 1
Alt. Tank ID: B1R1
Tank Status: Currently In Use
Tank Material: Composite - Steel with Fiberglass (ACT 100)
Secondary Material: Double-Walled
Capacity: 1000
Substance: Diesel

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002027907 **DIST/DIR:** 0.210 SSW **ELEVATION:** 141 **MAP ID:** G33

NAME: HANOVER TOWERS REALTY
ADDRESS: 76 BUTLER ST
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-3879
ID/Status: Permanently Closed
ID/Status: Currently In Use

SOURCE: CT Department of Energy & Environmental Protection

Date Installed: 08/01/1997
Date Last Used: Not reported
Closure Status: Not reported
Pipe Material: Flexible Plastic
Pipe Mode Description: Not reported
Spill Installed: Spill Bucket
Overfill Installed: Audible Alarm

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CPCS

EDR ID: S103161449 **DIST/DIR:** 0.210 SSW **ELEVATION:** 141 **MAP ID:** G34

NAME: HANOVER TOWERS
ADDRESS: 76 BUTLER STREET
MERIDEN, CT 06450

Rev: 01/30/2014
ID/Status: LUST Completed (DEP's significant hazard def

SOURCE: CT Department of Energy & Environmental Protection

CPCS:
Site Type: LUST
Lust Status: LUST Completed (DEP's significant hazard definition)
PTP Form: Not reported
Program: Not reported
Comments: Not reported
Site Type Definition: Leaking Underground Storage Tanks Completed

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S103161449 **DIST/DIR:** 0.210 SSW **ELEVATION:** 141 **MAP ID:** G34

NAME: HANOVER TOWERS
ADDRESS: 76 BUTLER STREET
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 28629

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 3391
UST Facility Id: 3879
LUST Case Id: 28629
Lust Status: Lust Completed
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 08/08/1997
Entry Date: Not reported
Site Case Id: 9704369
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: 848
LUST Owner Id: Not reported
UST Event Id: 3437
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN, UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Stanley Dynia
Site Contact Address: GZA

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S103161449 **DIST/DIR:** 0.210 SSW **ELEVATION:** 141 **MAP ID:** G34

NAME: HANOVER TOWERS
ADDRESS: 76 BUTLER STREET
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 28629

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: ZipCode Unknown
Site Contact Phone: (860) 875-7655
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: True
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: True
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Carabetta Management Company
Resp Party Address: 200 Pratt Street
Resp Party City,St,Zip: Meriden, CT 064504220
Resp Party Town Number: 80
Resp Party Phone: 2032377400
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: 2032380454
Investigator Id: 35
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S103161449 **DIST/DIR:** 0.210 SSW **ELEVATION:** 141 **MAP ID:** G34

NAME: HANOVER TOWERS
ADDRESS: 76 BUTLER STREET
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 28629

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S103161449 **DIST/DIR:** 0.210 SSW **ELEVATION:** 141 **MAP ID:** G34

NAME: HANOVER TOWERS
ADDRESS: 76 BUTLER STREET
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 28629

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Allison Forrest/ForrestA
Date Stamp: 05/16/2012
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Harbor Brook is ~100 ft south-southeast of site.
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Spills Files and UST Enforcement Files
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109755137 **DIST/DIR:** 0.215 East **ELEVATION:** 137 **MAP ID:** 35

NAME: MERIDEN CITY OF MERIDEN HUB THE **Rev:** 07/30/2013
ADDRESS: 77 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: 000007733UIS
Year: 2007
Waste Occurrence: 1
UNNA: 1950
Hazard Class: 2.1
US Dot Description: AEROSOLS, FLAMMABLE
No of Containers: 001
Container Type: DF
Quantity: 50
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2008-06-09 00:00:00
DEO Who Last Modified Record: DMG

Manifest No: 000007733UIS
Year: 2007
Waste Occurrence: 2
UNNA: 1992
Hazard Class: 3
US Dot Description: FLAMMABLE LIQUIDS, TOXIC, N.O.S.
No of Containers: 1
Container Type: DM
Quantity: 150
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2008-06-09 00:00:00
DEO Who Last Modified Record: DMG

Manifest No: 000007733UIS
Year: 2007
Waste Occurrence: 3
UNNA: 1791
Hazard Class: 8
US Dot Description: HYPOCHLORITE SOLUTIONS
No of Containers: 001
Container Type: DF
Quantity: 20
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109755137 **DIST/DIR:** 0.215 East **ELEVATION:** 137 **MAP ID:** 35

NAME: MERIDEN CITY OF MERIDEN HUB THE **Rev:** 07/30/2013
ADDRESS: 77 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Date Record Was Last Modified: 2008-06-09 00:00:00
DEO Who Last Modified Record: DMG

Waste CD:
Manifest No: 000007733UIS
Year: 2007
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2008-06-09 00:00:00
DEO Who Last Modified Record: DMG

Manifest No: 000007733UIS
Year: 2007
Waste Occurrence: 2
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2008-06-09 00:00:00
DEO Who Last Modified Record: DMG

Manifest No: 000007733UIS
Year: 2007
Waste Occurrence: 3
EPA Waste Code: D002
Recycled Waste?: False
Date Record Was Last Modified: 2008-06-09 00:00:00
DEO Who Last Modified Record: DMG

Detail:
Year: 2007
Manifest ID: 000007733UIS
TSDf EPA ID: CTD002593887
TSDf Name: BRIDGEPORT UNITED RECYCLING
TSDf Address: 50 Cross St
TSDf City,St,Zip: BRIDGEPORT, CT 06610-
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 03/14/2007
Transporter EPA ID: CTD021816889
Transporter Name: UNITED OIL RECOVERY INC
Transporter Country: USA
Transporter Phone: (203)238-6745
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109755137 **DIST/DIR:** 0.215 East **ELEVATION:** 137 **MAP ID:** 35

NAME: MERIDEN CITY OF MERIDEN HUB THE **Rev:** 07/30/2013
ADDRESS: 77 STATE ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000029792
Generator Phone: (973)628-9500
Generator Mailing Addr: 142 E MAIN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06451-
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported
Date Shipped: 03/14/2007
Date Received: 03/15/2007
Last modified date: 06/09/2008
Last modified by: DMG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FACTORY H - 104 BUTLER STREET
Property #: Not reported
Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.

Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the property.

Latitude: 41.5365767
Longitude: -72.8060524
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73161
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 17325
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: Not reported
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Supplemental Assessment
Accomplishment count: 0
Cooperative agreement #: 97114801

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: Yes
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Y
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.75
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FACTORY H - 104 BUTLER STREET
Property #: Not reported
Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.

Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the property.

Latitude: 41.5365767
Longitude: -72.8060524
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73161
Start date: Not reported
Completed date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 52125
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: Not reported
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase II Environmental Assessment
Accomplishment count: 0
Cooperative agreement #: 97114801
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: Yes
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Y
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.75
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Cleanup
Property name: FACTORY H - 104 BUTLER STREET
Property #: Not reported
Parcel size: 3.75
Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.
Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site,

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the property.

Latitude: 41.5365767
Longitude: -72.8060524
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73161
Start date: 01-DEC-08
Completed date: Not reported
Acres cleaned up: .1
Cleanup funding: 10300
Cleanup funding source: US EPA - Brownfields Cleanup Cooperative Agreement
Assessment funding: Not reported
Assessment funding source: Not reported
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: Not reported
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Not reported
Accomplishment count: 0
Cooperative agreement #: 97182301
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: Yes
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Y
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.75
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FACTORY H - 104 BUTLER STREET
Property #: Not reported
Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.

Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the property.

Latitude: 41.5365767
Longitude: -72.8060524
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73161
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 21250
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Supplemental Assessment
Accomplishment count: 0
Cooperative agreement #: 97182101

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: Yes
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Y
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.75
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FACTORY H - 104 BUTLER STREET
Property #: Not reported
Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.

Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the property.

Latitude: 41.5365767
Longitude: -72.8060524
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73161
Start date: Not reported
Completed date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 2200
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97114801
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: Yes
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Y
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.75
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: R1 Brownfields TBA (previously Superfund TBA)
Grant type: TBA
Property name: FACTORY H - 104 BUTLER STREET
Property #: Not reported
Parcel size: 3.75
Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.
Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site,

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the property.

Latitude: 41.5365767
Longitude: -72.8060524
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73161
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 35000
Assessment funding source: US EPA - TBA Funding
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase II Environmental Assessment
Accomplishment count: 0
Cooperative agreement #: n/a
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: Yes
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Y
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.75
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Superfund Fed. landowner flag: N

Recipient name: R1 Brownfields TBA (previously Superfund TBA)

Grant type: TBA

Property name: FACTORY H - 104 BUTLER STREET

Property #: Not reported

Parcel size: 3.75

Property Description: 104 Butler Street is 3.75 acres and sits east of Harbor Brook.

Approximately half the site is located within the 100-year flood plain. The site is zoned for manufacturing use. The site contains a 7,200 sq ft former power plant and associated heat conveyance piping. In 1884, Parker Bros. Machine Shops and Gun Factory facility were in operation. Industrial operations included gun manufacturing, specifically consisting of a foundry and machining activities. In 1939 the International Silver Co. was in operation at the site, involved in silverware manufacturing. Processes included casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently occupied by heat conveyance piping and the former power plant building. The remainder of the site is vacant cleared space. The City of Meriden recently acquired the property.

Latitude: 41.5365767

Longitude: -72.8060524

HCM label: Unknown

Map scale: Not reported

Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73161

Start date: Not reported

Completed date: Not reported

Acres cleaned up: Not reported

Cleanup funding: Not reported

Cleanup funding source: Not reported

Assessment funding: 5000

Assessment funding source: US EPA - TBA Funding

Redevelopment funding: Not reported

Redev. funding source: Not reported

Redev. funding entity name: Not reported

Redevelopment start date: Not reported

Assessment funding entity: EPA

Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 0

Cooperative agreement #: n/a

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET **Rev:** 03/20/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: Yes
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Y
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1011997022 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G36

NAME: FACTORY H - 104 BUTLER STREET
ADDRESS: 104 BUTLER STREET
MERIDEN, CT 06451

Rev: 03/20/2014

SOURCE: US Environmental Protection Agency

Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.75
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

VCP

EDR ID: S111382847 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G37

NAME: INTERNATIONAL SILVER COMPANY, FACTORY H **Rev:** 02/11/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

VCP:

Transferor (seller): n/a
Transfee (buyer): n/a
Certifying Party: City of Meriden
Certifying Party Attn: Lawrence J. Kendzior
Certifying Party Title: City Manager
Certifying Party Address: 142 East Main Street
Certifying Party City,St,Zip: Meriden, CT 06450
Voluntary Remediation Site: Yes
Date Received: 10/27/2011
Acknowledge Date: 12/20/2011
Determination Date: 12/20/2011
LEP Verified/DEP: Not reported
Rem Id: 10705
Remediation Location Id: 8778
Date Entered: 11/02/2011
Program: Vol_Rem_X
GAO Site: False
Staff Full Name: Jing Chen
Super/Date: 12/21/2011
Stage Of Project: Not reported
RP Level Of Activity: Not reported
RP Needed Level Of Activity: Not reported
Staff Level Of Activity: Not reported
Staff Needed Level Of Activity: Not reported
Public Intrest: Not reported
PRP Cooperation: Not reported
Enforcement Status: Not reported
Level Of Complexity: Not reported
Complex Eng Or Sci: False
Complex Due To Public Involvement: False
Politically Complex: False
Complex Enforcement: False
Coordination With Other Bureaus: False
EPA Involvement: False
Staff Prefrence: Not reported
Readiness For Transfer: Not reported
Project Transfer Time: Not reported
Transfer Comments: Not reported
Staff As Of July 2000: Not reported
Initial Staff: Not reported
Type Of Transfer: Not reported
Salutation: Mr. Kendzior
Relationship To Transfer: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

VCP

EDR ID: S111382847 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G37

NAME: INTERNATIONAL SILVER COMPANY, FACTORY H **Rev:** 02/11/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Audit Date: Not reported
Verif Type: Not reported
Audit Outcome: Not reported
GW: GB
Basin: Not reported
1st Payment: 0
Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
Rtn: Not reported
Revised: Not reported
ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported
Report Overdue: Not reported
Ext Aprvl Sched: Not reported
License #: Not reported
Project Phase: Not reported
PT Comments: one of parcels for the site, include REM10704
EPA Id Number: Not reported
GW Class: Not reported
SW Class: Not reported
AO/C0: Not reported
Water Lead(Y Or N): Not reported
Priority: Not reported
Project Status(A, I Or D): Not reported
Last Updated: Not reported
SR Comments: Not reported
Priority Or Work-Load: Not reported
Status: Not reported
Notes: Not reported
Special Project Name: Not reported
Special Project Comments: Not reported
DOT Project: Not reported
Pt Counter: 0
Project Complete: False
Project Inactive: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

VCP

EDR ID: S111382847 **DIST/DIR:** 0.221 SSW **ELEVATION:** 141 **MAP ID:** G37

NAME: INTERNATIONAL SILVER COMPANY, FACTORY H **Rev:** 02/11/2014
ADDRESS: 104 BUTLER STREET
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Intl Deposit #: Not reported
Deposit #: Not reported
Spill Case #: Not reported
Diversion Id: 0
Public Notice: Not reported
Rap Received: Not reported
Rap Approved: Not reported
Compliance Category: Not reported
Delete Record: False
ECAAF Reviewed By: Jing Chen
Notlocatable: False
Primaryaddress: False
Aka_sitename: False
Primarysitename: False
Aka_siteaddress: False
Lead: LEP

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109723225 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H38

NAME: RECORD JOURNAL PUBLISHING **Rev:** 07/30/2013
ADDRESS: 11 CROWN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: NJA3026188
Year: 1999
Waste Occurrence: 1
UNNA: 1993
Hazard Class: 3
US Dot Description: RQ WASTE FLAMMABLE LIQUIDS, N.O.S.
No of Containers: 002
Container Type: DM
Quantity: 1072
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:

Manifest No: NJA3026188
Year: 1999
Waste Occurrence: 1
EPA Waste Code: F003
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Detail:

Year: 1999
Manifest ID: NJA3026188
TSDf EPA ID: NJD002182897
TSDf Name: SAFETY-KLEEN SYSTEMS INC
TSDf Address: 1200 SYLVAN ST
TSDf City,St,Zip: LINDEN, NJ 07036
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 03/04/1999
Transporter EPA ID: ILD984908202
Transporter Name: SAFETY-KLEEN SYSTEMS INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: 03/09/1999
Trans 2 EPA ID: SCD987574647
Trans 2 Name: SAFETY-KLEEN (TG), INC.

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109723225 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H38

NAME: RECORD JOURNAL PUBLISHING **Rev:** 07/30/2013
ADDRESS: 11 CROWN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD001146422
Generator Phone: 2032351661
Generator Mailing Addr: 11 CROWN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported
Date Shipped: 03/04/1999
Date Received: 03/17/1999
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109723223 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H39

NAME: MERIDEN RECORDO **Rev:** 07/30/2013
ADDRESS: 11 CROWN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: CTF0672818
Year: 1997
Waste Occurrence: 1
UNNA: 1993
Hazard Class: 3
US Dot Description: RQ WASTE FLAMMABLE LIQUIDS, N.O.S.
No of Containers: 002
Container Type: DM
Quantity: 1068
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:

Manifest No: CTF0672818
Year: 1997
Waste Occurrence: 1
EPA Waste Code: F003
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Detail:

Year: 1997
Manifest ID: CTF0672818
TSDf EPA ID: CTD980667927
TSDf Name: SAFETY-KLEEN CORP
TSDf Address: 11 TIPPING DR
TSDf City,St,Zip: BRANFORD, CT 06405
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 10/21/1997
Transporter EPA ID: ILD984908202
Transporter Name: SAFETY-KLEEN CORP
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109723223 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H39

NAME: MERIDEN RECORDO **Rev:** 07/30/2013
ADDRESS: 11 CROWN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD001146422
Generator Phone: 2032351661
Generator Mailing Addr: 11 CROWN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported
Date Shipped: 10/21/1997
Date Received: 10/21/1997
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: CTC0177761
Year: 1992
Waste Occurrence: 1
UNNA: 1210
Hazard Class: COMBUSTIBL
US Dot Description: WASTE INK
No of Containers: 002
Container Type: DM
Quantity: 110
Weight/Volume: G
Additional Description: Y
Handling Code: S01
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTC0177761
Year: 1992
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109723223 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H39

NAME: MERIDEN RECORDO **Rev:** 07/30/2013
ADDRESS: 11 CROWN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Detail:

Year: 1992
Manifest ID: CTC0177761
TSDf EPA ID: OHD980681571
TSDf Name: NORTHEAST CHEMICAL
TSDf Address: 3301 MONROE AVE
TSDf City,St,Zip: CLEVELAND, OH 44113
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 04/16/1992
Transporter EPA ID: OHD987027604
Transporter Name: NORTH EAST RECYCLING TRANS
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: OHD987027604
Trans 2 Name: NORTH EAST RECYCLING TRANS
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD001146422
Generator Phone: 2032351661
Generator Mailing Addr: 11 CROWN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 04/16/1992
Date Received: 04/21/1992
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:

Manifest No: CTA0054085
Year: 1986
Waste Occurrence: 1
UNNA: 2867
Hazard Class: COMBUSTIBL
US Dot Description: WASTE INK, LIQUID, COMBUSTIBLE

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109723223 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H39

NAME: MERIDEN RECORDO **Rev:** 07/30/2013
ADDRESS: 11 CROWN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: 005
Container Type: DR
Quantity: 275
Weight/Volume: G
Additional Description: Not reported
Handling Code: T04
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTA0054085
Year: 1986
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1986
Manifest ID: CTA0054085
TSDf EPA ID: CTD009717604
TSDf Name: SOLVENTS RECOVERY SERVICE OF NEW ENGLAND INC
TSDf Address: LAZY LANE
TSDf City,St,Zip: SOUTHLINGTON, CT 06489
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 04/09/1986
Transporter EPA ID: CTD009717604
Transporter Name: SOLVENTS RECOVERY SERVICE OF NEW ENGLAND INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD001146422
Generator Phone: 2032351661
Generator Mailing Addr: 11 CROWN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109723223 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H39

NAME: MERIDEN RECORDO **Rev:** 07/30/2013
ADDRESS: 11 CROWN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 04/09/1986
Date Received: 04/09/1986
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: CTA0054083
Year: 1985
Waste Occurrence: 1
UNNA: 2867
Hazard Class: COMBUSTIB
US Dot Description: WASTE INK COMBUSTIBLE LIQUID
No of Containers: 020
Container Type: DM
Quantity: 1000
Weight/Volume: G
Additional Description: N
Handling Code: T04
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTA0054083
Year: 1985
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1985
Manifest ID: CTA0054083
TSDf EPA ID: CTD009717604
TSDf Name: SOLVENTS RECOVERY SERVICE OF NEW ENGLAND INC
TSDf Address: LAZY LANE
TSDf City,St,Zip: SOUTHLINGTON, CT 06489

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109723223 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H39

NAME: MERIDEN RECORDO **Rev:** 07/30/2013

ADDRESS: 11 CROWN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

TSDF Country: USA
TSDF Telephone: Not reported
Transport Date: 04/15/1985
Transporter EPA ID: CTD009717604
Transporter Name: SOLVENTS RECOVERY SERVICE OF NEW ENGLAND, INC.,
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD001146422
Generator Phone: 2032351661
Generator Mailing Addr: 11 CROWN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 03/26/1985
Date Received: 04/15/1985
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254260 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H40

NAME: THE MERIDEN RECORD CO. **Rev:** 04/23/2010
ADDRESS: 11 CROWN STREET **ID/Status:** 877
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:
Facility ID: 877
Rem Master ID: 1295
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: CHEMICAL LIQUID, SLUDGES
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 829
Source of referral: ISWS
Date Received: 5/18/1990
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254260 **DIST/DIR:** 0.226 SE **ELEVATION:** 159 **MAP ID:** H40

NAME: THE MERIDEN RECORD CO.

Rev: 04/23/2010

ADDRESS: 11 CROWN STREET
MERIDEN, CT
NEW HAVEN

ID/Status: 877

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109750540 **DIST/DIR:** 0.234 ESE **ELEVATION:** 148 **MAP ID:** I41

NAME: MERIDEN POLICE DEPT **Rev:** 07/30/2013
ADDRESS: 50 WEST MAIN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTF0878298
Year: 1999
Waste Occurrence: 1
UNNA: 1993
Hazard Class: 3
US Dot Description: FLAMMABLE LIQUID N.O.S.
No of Containers: 001
Container Type: TT
Quantity: 475
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0878298
Year: 1999
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1999
Manifest ID: CTF0878298
TSDf EPA ID: CTD021816889
TSDf Name: UNITED OIL RECOVERY DBA ADV LIQ REC
TSDf Address: 136 GRACEY AVE
TSDf City,St,Zip: MERIDEN, CT 06451
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 10/04/1999
Transporter EPA ID: CTD021816889
Transporter Name: UNITED OIL RECOVERY INC/UIS DBA ADVANCED LIQ REC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109750540 **DIST/DIR:** 0.234 ESE **ELEVATION:** 148 **MAP ID:** I41

NAME: MERIDEN POLICE DEPT **Rev:** 07/30/2013
ADDRESS: 50 WEST MAIN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000023017
Generator Phone: 2032381911
Generator Mailing Addr: 50 WEST MAIN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 10/04/1999
Date Received: 10/04/1999
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109749008 **DIST/DIR:** 0.234 ESE **ELEVATION:** 148 **MAP ID:** 142

NAME: MERIDEN POLICE DEPT **Rev:** 07/30/2013
ADDRESS: 50 WEST MAIN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: PAE9447410
Year: 1998
Waste Occurrence: 1
UNNA: 3077
Hazard Class: 9
US Dot Description: ENVIRONMENTALLY HAZ. SUBSTANCES,SOLID
No of Containers: 016
Container Type: CF
Quantity: 200
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Manifest No: PAE9447410
Year: 1998
Waste Occurrence: 2
UNNA: 3077
Hazard Class: 9
US Dot Description: ENVIRONMENTALLY HAZ. SUBSTANCES,SOLID
No of Containers: 007
Container Type: DF
Quantity: 1500
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: PAE9447410
Year: 1998
Waste Occurrence: 1
EPA Waste Code: D009
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Manifest No: PAE9447410
Year: 1998

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109749008 **DIST/DIR:** 0.234 ESE **ELEVATION:** 148 **MAP ID:** 142

NAME: MERIDEN POLICE DEPT **Rev:** 07/30/2013
ADDRESS: 50 WEST MAIN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Waste Occurrence: 2
EPA Waste Code: D009
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Detail:

Year: 1998
Manifest ID: PAE9447410
TSDf EPA ID: PAD987367216
TSDf Name: ADVANCED ENVIRON RECYCLING CORP
TSDf Address: 2591 MITCHELL AVE
TSDf City,St,Zip: ALLENTOWN, PA 18103
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 06/02/1998
Transporter EPA ID: PAD014146179
Transporter Name: ELDREDGE INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000021344
Generator Phone: Not reported
Generator Mailing Addr: 50 WEST MAIN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 05/29/1998
Date Received: 06/05/1998
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109744608 **DIST/DIR:** 0.238 ESE **ELEVATION:** 150 **MAP ID:** 143

NAME: CT STATE OF JD **Rev:** 07/30/2013
ADDRESS: 54 WEST MAIN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTF0272482
Year: 1993
Waste Occurrence: 1
UNNA: 3077
Hazard Class: 9
US Dot Description: HAZARDOUS WASTE SOLID
No of Containers: 003
Container Type: CF
Quantity: 798
Weight/Volume: P
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0272482
Year: 1993
Waste Occurrence: 1
EPA Waste Code: D009
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1993
Manifest ID: CTF0272482
TSDf EPA ID: CTD089631956
TSDf Name: EAST COAST ENVIRONMENTAL SERV CORP
TSDf Address: 454 QUINNIPIAC AVE
TSDf City,St,Zip: NEW HAVEN, CT 06513
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 12/06/1993
Transporter EPA ID: CTD089631956
Transporter Name: EAST COAST ENVIRONMENTAL SERVICE CORP
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109744608 **DIST/DIR:** 0.238 ESE **ELEVATION:** 150 **MAP ID:** I43

NAME: CT STATE OF JD **Rev:** 07/30/2013
ADDRESS: 54 WEST MAIN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000016093
Generator Phone: 2032386130
Generator Mailing Addr: 54 WEST MAIN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 12/06/1993
Date Received: 12/06/1993
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: 1000495317 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J44

NAME: FIRESTONE STORE 7056 **Rev:** 12/31/2012
ADDRESS: 72 COOK AVE
MERIDEN, CT 06450
NEW HAVEN
SOURCE: RI Department of Environmental Management

RI MANIFEST:
GEN Cert Date: 12/12/2007
Transporter Receipt Date: 12/12/2007
Number Of Containers: 1
Container Type: DM
Waste Code1: CR02
Waste Code2: R003
Waste Code3: Not reported
Comment: Not reported
Fee Exempt Code: Not reported
TSDf Name: United Oil Recovery Inc
TSDf ID: RID084802842
TSDf Date: 12/17/2007
Transporter 2 Name: Not reported
Transporter 2 ID: Not reported
Manifest Docket Number: 000065678UIS
Waste Description: PETROLEUM DISTILLATES NOS
Quantity: 15
WT/Vol Units: G
Item Number: a
Transporter Name: SAFETY-KLEEN SYSTEMS INC
Transporter EPA ID: TXR000050930
GEN Cert Date: 12/12/2007
Transporter Recpt Date: 12/12/2007
Transporter 2 Recpt Date: Not reported
TSDf Recpt Date: 12/17/2007
EPA ID: CTD983894809
Transporter 2 ID: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733686 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J45

NAME: FIRESTONE STORE 7056 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: CTF0755874
Year: 1999
Waste Occurrence: 1
UNNA: 1268
Hazard Class: 3
US Dot Description: petroleum distillates nos
No of Containers: 001
Container Type: DM
Quantity: 13
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0755874
Year: 1999
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: True
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1999
Manifest ID: CTF0755874
TSDf EPA ID: CTD021816889
TSDf Name: UNITED OIL RECOVERY DBA ADV LIQ REC
TSDf Address: 136 GRACEY AVE
TSDf City,St,Zip: MERIDEN, CT 06451
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 02/06/1999
Transporter EPA ID: CTD021816889
Transporter Name: UNITED OIL RECOVERY INC/UIS DBA ADVANCED LIQ REC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733686 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J45

NAME: FIRESTONE STORE 7056 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 02/06/1999
Date Received: 02/08/1999
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: CTF0696535
Year: 1998
Waste Occurrence: 1
UNNA: 1268
Hazard Class: 3
US Dot Description: petroleum distillates nos
No of Containers: 001
Container Type: DM
Quantity: 8
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0696535
Year: 1998
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: True
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733686 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J45

NAME: FIRESTONE STORE 7056 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Detail:

Year: 1998
Manifest ID: CTF0696535
TSDf EPA ID: CTD021816889
TSDf Name: UNITED OIL RECOVERY DBA ADV LIQ REC
TSDf Address: 136 GRACEY AVE
TSDf City,St,Zip: MERIDEN, CT 06451
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 05/16/1998
Transporter EPA ID: CTD021816889
Transporter Name: UNITED OIL RECOVERY DBA ADVANCED LIQ REC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: No
Date Shipped: 05/16/1998
Date Received: 05/21/1998
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Waste:

Manifest No: CTF0676134
Year: 1997
Waste Occurrence: 1
UNNA: 1268
Hazard Class: 3
US Dot Description: petroleum distillates nos

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733686 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J45

NAME: FIRESTONE STORE 7056 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: 001
Container Type: DM
Quantity: 8
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0676134
Year: 1997
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1997
Manifest ID: CTF0676134
TSDf EPA ID: CTD021816889
TSDf Name: UNITED OIL RECOVERY DBA ADV LIQ REC
TSDf Address: 136 GRACEY AVE
TSDf City,St,Zip: MERIDEN, CT 06451
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 09/11/1997
Transporter EPA ID: CTD021816889
Transporter Name: UNITED OIL RECOVERY DBA ADV LIQ REC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733686 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J45

NAME: FIRESTONE STORE 7056 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported
Date Shipped: 09/11/1997
Date Received: 09/12/1997
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Waste:
Manifest No: CTF0385368
Year: 1996
Waste Occurrence: 1
UNNA: 1268
Hazard Class: 3
US Dot Description: petroleum distillates nos
No of Containers: 001
Container Type: DM
Quantity: 14
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0385368
Year: 1996
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-26 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1996
Manifest ID: CTF0385368
TSDf EPA ID: CTD021816889
TSDf Name: UNITED OIL RECOVERY DBA ADV LIQ REC
TSDf Address: 136 GRACEY AVE
TSDf City,St,Zip: MERIDEN, CT 06451

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733686 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J45

NAME: FIRESTONE STORE 7056 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 10/10/1996
Transporter EPA ID: CTD021816889
Transporter Name: UNITED OIL RECOVERY INC DBA ADV LIQ REC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported
Date Shipped: 10/10/1996
Date Received: 10/10/1996
Last modified date: 04/26/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733685 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J46

NAME: FIRESTONE 00582 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: 003843441fle
Year: 2010
Waste Occurrence: 1
UNNA: 3082
Hazard Class: 9
US Dot Description: HAZARDOUS WASTE, LIQUID, N.O.S.
No of Containers: 001
Container Type: DF
Quantity: 5
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2011-01-11 00:00:00
DEO Who Last Modified Record: DPW

Manifest No: 003843441fle
Year: 2010
Waste Occurrence: 2
UNNA: 0000
Hazard Class: 0
US Dot Description: USED CLEANING COMPOUNDS, N.O.I.B.N.
No of Containers: 001
Container Type: DM
Quantity: 15
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2011-01-11 00:00:00
DEO Who Last Modified Record: DPW

Waste CD:

Manifest No: 003843441fle
Year: 2010
Waste Occurrence: 1
EPA Waste Code: D039
Recycled Waste?: False
Date Record Was Last Modified: 2011-01-11 00:00:00
DEO Who Last Modified Record: DPW

Manifest No: 003843441fle
Year: 2010

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733685 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J46

NAME: FIRESTONE 00582 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Waste Occurrence: 2
EPA Waste Code: D039
Recycled Waste?: False
Date Record Was Last Modified: 2011-01-11 00:00:00
DEO Who Last Modified Record: DPW

Detail:
Year: 2010
Manifest ID: 003843441fle
TSDf EPA ID: RID084802842
TSDf Name: SAFETY-KLEEN SYSTEMS, INC.
TSDf Address: 167 MILL STREET
TSDf City,St,Zip: CRANSTON, RI 02905
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 10/26/2010
Transporter EPA ID: TXR000050930
Transporter Name: SAFETY-KLEEN SYSTEMS, INC.
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06451
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported
Date Shipped: 10/26/2010
Date Received: 10/29/2010
Last modified date: 01/11/2011
Last modified by: DPW
Comments: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733685 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J46

NAME: FIRESTONE 00582 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Waste:

Manifest No: 001269589SKS
Year: 2008
Waste Occurrence: 1
UNNA: 1993
Hazard Class: 3
US Dot Description: WASTE COMBUSTIBLE LIQUID, N.O.S.
No of Containers: 001
Container Type: DM
Quantity: 15
Weight/Volume: G
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: 2008-08-27 00:00:00
DEO Who Last Modified Record: DPW

Waste CD:

Manifest No: 001269589SKS
Year: 2008
Waste Occurrence: 1
EPA Waste Code: D039
Recycled Waste?: False
Date Record Was Last Modified: 2008-08-27 00:00:00
DEO Who Last Modified Record: DPW

Detail:

Year: 2008
Manifest ID: 001269589SKS
TSDf EPA ID: RID084802842
TSDf Name: SAFETY-KLEEN SYSTEMS, INC.
TSDf Address: 167 MILL STREET
TSDf City,St,Zip: CRANSTON, RI 02905
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 06/23/2008
Transporter EPA ID: TXR000050930
Transporter Name: SAFETY-KLEEN SYSTEMS, INC
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733685 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J46

NAME: FIRESTONE 00582 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06451
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported
Date Shipped: 06/23/2008
Date Received: 06/30/2008
Last modified date: 09/10/2009
Last modified by: CYF
Comments: Not reported

Waste:
Manifest No: CTF0147839
Year: 1993
Waste Occurrence: 1
UNNA: 1993
Hazard Class: COMBUSTIBL
US Dot Description: WASTE COMBUSTIBLE LIQUID
No of Containers: 001
Container Type: DM
Quantity: 8
Weight/Volume: G
Additional Description: Y
Handling Code: S02
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0147839
Year: 1993
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: True
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733685 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J46

NAME: FIRESTONE 00582 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Detail:

Year: 1993
Manifest ID: CTF0147839
TSDf EPA ID: CTD980667927
TSDf Name: SAFETY KLEEN CORP 2 112 01
TSDf Address: 11 TIPPING DR LOT #4
TSDf City,St,Zip: BRANFORD, CT 06405
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 01/26/1993
Transporter EPA ID: ILD051060408
Transporter Name: SAFETY KLEEN CORP
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 01/26/1993
Date Received: 01/26/1993
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Waste:

Manifest No: CTF0140490
Year: 1992
Waste Occurrence: 1
UNNA: 1993
Hazard Class: COMBUSTIBL
US Dot Description: WASTE COMBUSTIBLE LIQUID

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733685 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J46

NAME: FIRESTONE 00582 **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

No of Containers: 001
Container Type: DM
Quantity: 45
Weight/Volume: P
Additional Description: Y
Handling Code: S02
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: CTF0140490
Year: 1992
Waste Occurrence: 1
EPA Waste Code: D001
Recycled Waste?: True
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1992
Manifest ID: CTF0140490
TSDf EPA ID: CTD980667927
TSDf Name: SAFETY KLEEN CORP 2-112-01
TSDf Address: 11 TIPPING DR LOT #4
TSDf City,St,Zip: BRANFORD, CT 06405
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 12/30/1992
Transporter EPA ID: ILD051060408
Transporter Name: SAFETY-KLEEN CORP
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported
Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTD983894809
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109733685 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J46

NAME: FIRESTONE 00582 **Rev:** 07/30/2013

ADDRESS: 72 COOK AVE
MERIDEN, CT 06451

SOURCE: CT Department of Energy & Environmental Protection

Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 12/30/1992
Date Received: 12/30/1992
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

UST

EDR ID: U002027765 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J47

NAME: FIRESTONE STORE #7056
ADDRESS: 72 COOK AVE
MERIDEN, CT 06451

Rev: 03/03/2014
ID/Status: 80-3656
ID/Status: Permanently Closed

SOURCE: CT Department of Energy & Environmental Protection

UST:

Facility Id: 80-3656
Latitude: Not reported
Longitude: Not reported
Owner: MODERN HOME CONSTRUCTION
Owner Address: 6 SO. GROVE ST.
Owner Address 2: Not reported
Owner City,St,Zip: Meriden, CT

Tank ID: 3656-1
Compartment ID: 3656-1
Compartment Num: 1
Alt. Tank ID: A1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 2000
Substance: Heating Oil
Date Installed: 01/01/1972
Date Last Used: 09/01/1988
Closure Status: Tank was Removed From Ground
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Tank ID: 3656-2
Compartment ID: 3656-2
Compartment Num: 1
Alt. Tank ID: B1
Tank Status: Permanently Closed
Tank Material: Asphalt Coated or Bare Steel
Secondary Material: Not reported
Capacity: 500
Substance: Used Oil
Date Installed: 01/01/1972
Date Last Used: 09/01/1988
Closure Status: Tank was Removed From Ground
Pipe Material: Bare or Galvanized Steel
Pipe Mode Description: Not reported
Spill Installed: Not reported
Overfill Installed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S104100279 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J48

NAME: FIRESTONE INC **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:
Manifest No: MAF240538
Year: 1991
Waste Occurrence: 1
UNNA: 9189
Hazard Class: ORM-E
US Dot Description: HAZARDOUS WASTE LIQUID, NOS
No of Containers: 001
Container Type: TT
Quantity: 60
Weight/Volume: G
Additional Description: Y
Handling Code: T01
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Waste CD:
Manifest No: MAF240538
Year: 1991
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2004-04-27 00:00:00
DEO Who Last Modified Record: IG

Detail:
Year: 1991
Manifest ID: MAF240538
TSDf EPA ID: CTD072138969
TSDf Name: ENVIRONMENTAL WASTE RESOURCES INC
TSDf Address: 130 FREIGHT ST
TSDf City,St,Zip: WATERBURY, CT 06702
TSDf Country: USA
TSDf Telephone: Not reported
Transport Date: 10/23/1991
Transporter EPA ID: ILD051060408
Transporter Name: SAFETY-KLEEN CORP (TRANSPORTER ONLY)
Transporter Country: USA
Transporter Phone: Not reported
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S104100279 **DIST/DIR:** 0.241 SW **ELEVATION:** 149 **MAP ID:** J48

NAME: FIRESTONE INC **Rev:** 07/30/2013
ADDRESS: 72 COOK AVE
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: CTP000012677
Generator Phone: 2032357921
Generator Mailing Addr: 72 COOK AVE
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Yes
Discrepancies: No
Date Shipped: 10/23/1991
Date Received: 10/28/1991
Last modified date: 04/27/2004
Last modified by: IG
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109795148 **DIST/DIR:** 0.244 ESE **ELEVATION:** 155 **MAP ID:** 149

NAME: MERIDEN CITY OF PURCHASING **Rev:** 07/30/2013
ADDRESS: 60 E MAIN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

CT MANIFEST:

Waste:

Manifest No: Not reported
Year: Not reported
Waste Occurrence: Not reported
UNNA: Not reported
Hazard Class: Not reported
US Dot Description: Not reported
No of Containers: Not reported
Container Type: Not reported
Quantity: Not reported
Weight/Volume: Not reported
Additional Description: Not reported
Handling Code: Not reported
Date Record Was Last Modified: Not reported
DEO Who Last Modified Record: Not reported

Waste CD:

Manifest No: ctf1089760
Year: 2003
Waste Occurrence: 1
EPA Waste Code: D008
Recycled Waste?: False
Date Record Was Last Modified: 2005-01-19 00:00:00
DEO Who Last Modified Record: JEB

Detail:

Year: 2003
Manifest ID: ctf1089760
TSDf EPA ID: CTD021816889
TSDf Name: UNITED OIL RECOVERY INC
TSDf Address: 14 WEST MAIN ST
TSDf City,St,Zip: MERIDEN, CT 06451
TSDf Country: USA
TSDf Telephone: (203)238-6745
Transport Date: 11/17/2003
Transporter EPA ID: CTD021816889
Transporter Name: UNITED OIL RECOVERY INC
Transporter Country: USA
Transporter Phone: (203)238-6745
Trans 2 Date: Not reported
Trans 2 EPA ID: Not reported
Trans 2 Name: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

MANIFEST

EDR ID: S109795148 **DIST/DIR:** 0.244 ESE **ELEVATION:** 155 **MAP ID:** 149

NAME: MERIDEN CITY OF PURCHASING **Rev:** 07/30/2013
ADDRESS: 60 E MAIN ST
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Trans 2 Address: Not reported
Trans 2 City,St,Zip: CT
Trans 2 Country: USA
Trans 2 Phone: Not reported
EPA ID: ctp000027602
Generator Phone: Not reported
Generator Mailing Addr: 60 E MAIN ST
Generator Mailing Town: MERIDEN
Generator Mailing State: CT
Generator Mailing Zip: 06450
Generator Mailing Country: USA
Special Handling: Not reported
Discrepancies: Not reported
Date Shipped: 11/17/2003
Date Received: 11/17/2003
Last modified date: 01/19/2005
Last modified by: JEB
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109735597 **DIST/DIR:** 0.252 SW **ELEVATION:** 143 **MAP ID:** J50

NAME: XTRA MART
ADDRESS: 80 COOK AVE
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Cleanup Initiated
ID/Status: 59707

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 0
UST Facility Id: 7103
LUST Case Id: 59707
Lust Status: Cleanup Initiated
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 08/24/1998
Entry Date: 01/10/2011
Site Case Id: 0
UST Site Id: 939
Cost Recovery Spill Case #: 0
Old SITS Number: 0
Case Log Id: 0
Monthly Report Id: 0
UST Owner Id: 8285
LUST Owner Id: Not reported
UST Event Id: 0
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109735597 **DIST/DIR:** 0.252 SW **ELEVATION:** 143 **MAP ID:** J50

NAME: XTRA MART
ADDRESS: 80 COOK AVE
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Cleanup Initiated
ID/Status: 59707

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 0
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109735597 **DIST/DIR:** 0.252 SW **ELEVATION:** 143 **MAP ID:** J50

NAME: XTRA MART
ADDRESS: 80 COOK AVE
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Cleanup Initiated
ID/Status: 59707

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109735597 **DIST/DIR:** 0.252 SW **ELEVATION:** 143 **MAP ID:** J50

NAME: XTRA MART
ADDRESS: 80 COOK AVE
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Cleanup Initiated
ID/Status: 59707

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: 0
Lph Wells: 0
User Stamp: allison forrest/ForrestA
Date Stamp: 06/20/2013
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: UST Enforcement Files and Cleanup Fund Files
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104238138 **DIST/DIR:** 0.258 NW **ELEVATION:** 144 **MAP ID:** 51

NAME: UNKNOWN **Rev:** 02/11/2014
ADDRESS: LEWIS & SPRINGDALE AVES.
MERIDEN, CT 06450 ID/Status: Lust Completed
ID/Status: 36274

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 8223
UST Facility Id: Not reported
LUST Case Id: 36274
Lust Status: Lust Completed
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 05/27/1999
Entry Date: Not reported
Site Case Id: 9903404
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: Not reported
LUST Owner Id: Not reported
UST Event Id: 8404
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104238138 **DIST/DIR:** 0.258 NW **ELEVATION:** 144 **MAP ID:** 51

NAME: UNKNOWN

Rev: 02/11/2014

ADDRESS: LEWIS & SPRINGDALE AVES.
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 36274

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: True
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: True
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 35
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104238138 **DIST/DIR:** 0.258 NW **ELEVATION:** 144 **MAP ID:** 51

NAME: UNKNOWN **Rev:** 02/11/2014
ADDRESS: LEWIS & SPRINGDALE AVES.
MERIDEN, CT 06450 ID/Status: Lust Completed
ID/Status: 36274

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104238138 **DIST/DIR:** 0.258 NW **ELEVATION:** 144 **MAP ID:** 51

NAME: UNKNOWN

Rev: 02/11/2014

ADDRESS: LEWIS & SPRINGDALE AVES.
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 36274

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: unknown size, Heating Oil, PRIVATE, SAND BY DPW
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104238990 **DIST/DIR:** 0.278 SE **ELEVATION:** 164 **MAP ID:** 52

NAME: SALVATION ARMY **Rev:** 02/11/2014
ADDRESS: 23 ST.CASIMER ST SALVATION ARMY ID/Status: Lust Completed
MERIDEN, CT 06450 ID/Status: 34263

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 6138
UST Facility Id: Not reported
LUST Case Id: 34263
Lust Status: Lust Completed
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 06/24/1998
Entry Date: Not reported
Site Case Id: 9804022
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: Not reported
LUST Owner Id: Not reported
UST Event Id: 6253
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104238990 **DIST/DIR:** 0.278 SE **ELEVATION:** 164 **MAP ID:** 52

NAME: SALVATION ARMY

Rev: 02/11/2014

ADDRESS: 23 ST.CASIMER ST SALVATION ARMY
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 34263

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: True
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: True
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: True
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 35
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104238990 **DIST/DIR:** 0.278 SE **ELEVATION:** 164 **MAP ID:** 52

NAME: SALVATION ARMY **Rev:** 02/11/2014
ADDRESS: 23 ST.CASIMER ST SALVATION ARMY ID/Status: Lust Completed
MERIDEN, CT 06450 ID/Status: 34263

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlaid: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104238990 **DIST/DIR:** 0.278 SE **ELEVATION:** 164 **MAP ID:** 52

NAME: SALVATION ARMY

Rev: 02/11/2014

ADDRESS: 23 ST.CASIMER ST SALVATION ARMY
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 34263

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: #2 FUEL OIL, , TANK AND SOIL REMOVAL
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109750251 **DIST/DIR:** 0.309 NE **ELEVATION:** 151 **MAP ID:** K53

NAME: G.T TIRES **Rev:** 02/11/2014
ADDRESS: 155 COLONY STREET ID/Status: Lust Completed
MERIDEN, CT 06450 ID/Status: 36428
ID/Status: 37069

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 8402
UST Facility Id: 11996
LUST Case Id: 36428
Lust Status: Lust Completed
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: True
Other Release: Waste Oil
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 06/23/1999
Entry Date: Not reported
Site Case Id: 9904074
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: 8531
LUST Owner Id: Not reported
UST Event Id: 8583
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109750251 **DIST/DIR:** 0.309 NE **ELEVATION:** 151 **MAP ID:** K53

NAME: G.T TIRES **Rev:** 02/11/2014
ADDRESS: 155 COLONY STREET ID/Status: Lust Completed
MERIDEN, CT 06450 ID/Status: 36428
ID/Status: 37069

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: True
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 35
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109750251 **DIST/DIR:** 0.309 NE **ELEVATION:** 151 **MAP ID:** K53

NAME: G.T TIRES

Rev: 02/11/2014

ADDRESS: 155 COLONY STREET
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 36428
ID/Status: 37069

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109750251 **DIST/DIR:** 0.309 NE **ELEVATION:** 151 **MAP ID:** K53

NAME: G.T TIRES **Rev:** 02/11/2014
ADDRESS: 155 COLONY STREET ID/Status: Lust Completed
MERIDEN, CT 06450 ID/Status: 36428
ID/Status: 37069

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: 5000, Used Oil, COMMERCIAL, REMOVAL OF A 5,000-GALLON L.U.S.T / FIRE
MARSHAL REQUESTING RESPONSE / TANK FORMERLY GASOLINE - CONVERTED TO
WASTE OIL / WATER LINE RUPTURED DURING EXCAVATION
Work Performed: Not reported

LUST Id: 9043
UST Facility Id: 11996
LUST Case Id: 37069
Lust Status: Lust Completed
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: True
Diesel: False
Gasoline: True
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 10/04/1999
Entry Date: Not reported
Site Case Id: 9906728
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: 8531

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109750251 **DIST/DIR:** 0.309 NE **ELEVATION:** 151 **MAP ID:** K53

NAME: G.T TIRES **Rev:** 02/11/2014
ADDRESS: 155 COLONY STREET ID/Status: Lust Completed
MERIDEN, CT 06450 ID/Status: 36428
ID/Status: 37069

SOURCE: CT Department of Energy & Environmental Protection

LUST Owner Id: Not reported
UST Event Id: 9224
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported
Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: OCSR
Offsite Source: False
Date Referred: 1999-09-30 00:00:00
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: True
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109750251 **DIST/DIR:** 0.309 NE **ELEVATION:** 151 **MAP ID:** K53

NAME: G.T TIRES

Rev: 02/11/2014

ADDRESS: 155 COLONY STREET
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 36428
ID/Status: 37069

SOURCE: CT Department of Energy & Environmental Protection

Resp Party Phone: Not reported
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 35
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: Not reported
Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109750251 **DIST/DIR:** 0.309 NE **ELEVATION:** 151 **MAP ID:** K53

NAME: G.T TIRES **Rev:** 02/11/2014
ADDRESS: 155 COLONY STREET ID/Status: Lust Completed
MERIDEN, CT 06450 ID/Status: 36428
ID/Status: 37069

SOURCE: CT Department of Energy & Environmental Protection

NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False
Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: release type:petroleumrelease substance:gasolinemedium: Ground
surfaceDiscovery of both GW and soil contamination during on site
work.
Running Comments: unknown size, GASOLINE, COMMERCIAL, DISCOVERY OF BOTH GROUNDWATER AND
SOIL CONTAMINATION DURING ON SITE WORK
Work Performed: soil removedpumped outcontained removed tank contracted.

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CORRACTS

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS) **Rev:** 03/11/2014
ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN
SOURCE: US EPA

CORRACTS:

EPA ID: CTD000842906
EPA Region: 01
Area Name: ENTIRE FACILITY
Actual Date: 19930910
Action: CA075ME - CA Prioritization, Facility or area was assigned a medium
corrective action priority
NAICS Code(s): Not reported
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CTD000842906
EPA Region: 01
Area Name: ENTIRE FACILITY
Actual Date: 19930827
Action: CA050RF - RFA Completed, Assessment was an RFA
NAICS Code(s): Not reported
Original schedule date: Not reported
Schedule end date: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CERC-NFRAP

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 10/25/2013

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US EPA

CERC-NFRAP:

Site ID: 0101887

Federal Facility: Not a Federal Facility

NPL Status: Not on the NPL

Non NPL Status: Deferred to RCRA

CERCLIS-NFRAP Site Contact Details:

Contact Sequence ID: 13326718.00000

Person ID: 13004278.00000

CERCLIS-NFRAP Site Alias Name(s):

Alias Name: COGGINS, J.C.

Alias Address: Not reported
NEW HAVEN, CT

Alias Name: COGGINS, J.C.

Alias Address: 5 CROSS STREET
MERIDEN, CT 06450

Program Priority:

Description: Environmental Justice Indicator

CERCLIS-NFRAP Assessment History:

Action: DISCOVERY

Date Started: / /

Date Completed: 01/17/90

Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT

Date Started: / /

Date Completed: 06/21/90

Priority Level: Deferred to RCRA (Subtitle C)

Action: ARCHIVE SITE

Date Started: / /

Date Completed: 01/25/96

Priority Level: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

RCRA-TSDF:

Date form received by agency: 02/24/1981

Facility name: QUINLAN RUSSELL

Facility address: 5 CROSS ST
MERIDEN, CT 06450

EPA ID: CTD000842906

Mailing address: COLONY ST
MERIDEN, CT 06450

Contact: STUART GRANDY

Contact address: PO BOX 943
MERIDEN, CT 06450

Contact country: US

Contact telephone: (203) 235-7927

Contact email: Not reported

EPA Region: 01

Land type: Private

Classification: TSDF

Description: Handler is engaged in the treatment, storage or disposal of hazardous waste

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: J B COGGINS MANUFACTURING COMPANY

Owner/operator address: PO BOX 943
OPERCITY, CT 99999

Owner/operator country: Not reported

Owner/operator telephone: (203) 235-7927

Legal status: Private

Owner/Operator Type: Operator

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Owner/operator name: RUSSELL QUINLAN

Owner/operator address: PO BOX 943
MERIDEN, CT 06450

Owner/operator country: Not reported

Owner/operator telephone: (203) 235-7927

Legal status: Private

Owner/Operator Type: Owner

Owner/Op start date: Not reported

Owner/Op end date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: Yes
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 08/18/1980
Facility name: QUINLAN RUSSELL
Classification: Not a generator, verified

Hazardous Waste Summary:

Waste code: F006
Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Waste code: F006
Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Waste code: F007
Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

Waste code: F008

Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM
ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Waste code: F009

Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING
OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Corrective Action Summary:

Event date: 08/27/1993

Event: RFA Completed, Assessment was an RFA.

Event date: 09/10/1993

Event: CA Prioritization, Facility or area was assigned a medium corrective
action priority.

Facility Has Received Notices of Violations:

Regulation violated: SR - 22a-449(c)-105(h)

Area of violation: TSD - General

Date violation determined: 01/24/2005

Date achieved compliance: Not reported

Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

Enforcement action date: 01/27/2005

Enf. disposition status: Not reported

Enf. disp. status date: Not reported

Enforcement lead agency: State

Proposed penalty amount: Not reported

Final penalty amount: Not reported

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: TSD - General

Date violation determined: 11/20/1990

Date achieved compliance: 03/30/1994

Violation lead agency: State

Enforcement action: Not reported

Enforcement action date: Not reported

Enf. disposition status: Not reported

Enf. disp. status date: Not reported

Enforcement lead agency: Not reported

Proposed penalty amount: Not reported

Final penalty amount: Not reported

Paid penalty amount: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

Regulation violated: Not reported
Area of violation: TSD - General
Date violation determined: 12/02/1986
Date achieved compliance: 03/30/1994
Violation lead agency: State

Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Ground-Water Monitoring
Date violation determined: 11/05/1985
Date achieved compliance: 02/05/1986
Violation lead agency: State

Enforcement action: WRITTEN INFORMAL
Enforcement action date: 01/27/1986
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD - General
Date violation determined: 11/05/1985
Date achieved compliance: 03/30/1994
Violation lead agency: State

Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Formal Enforcement Agreement or Order
Date violation determined: 11/05/1985

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

Date achieved compliance: 03/30/1994

Violation lead agency: State

Enforcement action: Not reported

Enforcement action date: Not reported

Enf. disposition status: Not reported

Enf. disp. status date: Not reported

Enforcement lead agency: Not reported

Proposed penalty amount: Not reported

Final penalty amount: Not reported

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: TSD - General

Date violation determined: 07/11/1985

Date achieved compliance: 03/30/1994

Violation lead agency: State

Enforcement action: Not reported

Enforcement action date: Not reported

Enf. disposition status: Not reported

Enf. disp. status date: Not reported

Enforcement lead agency: Not reported

Proposed penalty amount: Not reported

Final penalty amount: Not reported

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: TSD IS-Ground-Water Monitoring

Date violation determined: 04/26/1985

Date achieved compliance: 03/30/1994

Violation lead agency: State

Enforcement action: Not reported

Enforcement action date: Not reported

Enf. disposition status: Not reported

Enf. disp. status date: Not reported

Enforcement lead agency: Not reported

Proposed penalty amount: Not reported

Final penalty amount: Not reported

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: TSD - General

Date violation determined: 11/19/1984

Date achieved compliance: 07/15/1987

Violation lead agency: State

Enforcement action: WRITTEN INFORMAL

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

Enforcement action date: 01/22/1985
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Ground-Water Monitoring
Date violation determined: 11/19/1984
Date achieved compliance: 02/05/1986
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 01/27/1986
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Ground-Water Monitoring
Date violation determined: 11/19/1984
Date achieved compliance: 03/30/1994
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD IS-Ground-Water Monitoring
Date violation determined: 07/13/1984
Date achieved compliance: 04/26/1985
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 07/23/1984
Enf. disposition status: Not reported
Enf. disp. status date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD - Financial Requirements
Date violation determined: 01/26/1984
Date achieved compliance: 03/30/1994
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD - General
Date violation determined: 01/26/1984
Date achieved compliance: 03/30/1994
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: TSD - Closure/Post-Closure
Date violation determined: 01/26/1984
Date achieved compliance: 03/30/1994
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 01/24/2005

Evaluation: NON-FINANCIAL RECORD REVIEW

Area of violation: TSD - General

Date achieved compliance: Not reported

Evaluation lead agency: State

Evaluation date: 02/17/1999

Evaluation: FOCUSED COMPLIANCE INSPECTION

Area of violation: Not reported

Date achieved compliance: Not reported

Evaluation lead agency: State

Evaluation date: 03/30/1994

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: Not reported

Date achieved compliance: Not reported

Evaluation lead agency: State

Evaluation date: 11/20/1990

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: TSD - General

Date achieved compliance: 03/30/1994

Evaluation lead agency: State

Evaluation date: 06/17/1988

Evaluation: NON-FINANCIAL RECORD REVIEW

Area of violation: Not reported

Date achieved compliance: Not reported

Evaluation lead agency: State

Evaluation date: 12/02/1986

Evaluation: COMPLIANCE SCHEDULE EVALUATION

Area of violation: Not reported

Date achieved compliance: Not reported

Evaluation lead agency: State

Evaluation date: 12/02/1986

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Area of violation: TSD - General

Date achieved compliance: 03/30/1994

Evaluation lead agency: State

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

Evaluation date: 11/05/1985
Evaluation: COMPLIANCE SCHEDULE EVALUATION
Area of violation: Formal Enforcement Agreement or Order
Date achieved compliance: 03/30/1994
Evaluation lead agency: State

Evaluation date: 11/05/1985
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Ground-Water Monitoring
Date achieved compliance: 02/05/1986
Evaluation lead agency: State

Evaluation date: 11/05/1985
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 03/30/1994
Evaluation lead agency: State

Evaluation date: 07/11/1985
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: TSD - General
Date achieved compliance: 03/30/1994
Evaluation lead agency: State

Evaluation date: 04/26/1985
Evaluation: GROUNDWATER MONITORING EVALUATION
Area of violation: TSD IS-Ground-Water Monitoring
Date achieved compliance: 03/30/1994
Evaluation lead agency: State

Evaluation date: 11/19/1984
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Ground-Water Monitoring
Date achieved compliance: 02/05/1986
Evaluation lead agency: State

Evaluation date: 11/19/1984
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 07/15/1987
Evaluation lead agency: State

Evaluation date: 11/19/1984
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD IS-Ground-Water Monitoring

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

RCRA-TSDF

EDR ID: 1000235508 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K54

NAME: QUINLAN RUSSELL (J. B. COGGINS)

Rev: 03/11/2014

ADDRESS: 5 CROSS ST
MERIDEN, CT
NEW HAVEN

ID/Status: CTD000842906

SOURCE: US Environmental Protection Agency

Date achieved compliance: 03/30/1994
Evaluation lead agency: State

Evaluation date: 07/13/1984
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: TSD IS-Ground-Water Monitoring
Date achieved compliance: 04/26/1985
Evaluation lead agency: State

Evaluation date: 01/26/1984
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - Closure/Post-Closure
Date achieved compliance: 03/30/1994
Evaluation lead agency: State

Evaluation date: 01/26/1984
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - Financial Requirements
Date achieved compliance: 03/30/1994
Evaluation lead agency: State

Evaluation date: 01/26/1984
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 03/30/1994
Evaluation lead agency: State

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254245 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K55

NAME: J. B. COGGINS CO. **Rev:** 04/23/2010
ADDRESS: 5 CROSS STREET **ID/Status:** 228
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 228
Rem Master ID: 328
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: 41.55
Longitude: -72.7917
Lat/Long Determined By: UNK
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: METALS, MOH SLUDGE
Disposal: LAGOON, IMPOUNDMENT
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: True
Site Archived from CERCLIS: False
Archive Date: Not reported
EPA's Removal at Site: False
Deferred to another EPA Program: True
EPA Env Priority Initiative Site: False
Federal Facility: False
Site on EPA's National Priority List: False
Part of an NPL site: False
RCRA Generator Status: GEN
RCRA Permit Status: Not reported
Referral Id: 223
Source of referral: SUPERFUND
Date Received: 7/6/1987
Staff Assigned: DEP
Remediation Program: SUPERFUND
Date dt_assigned: 7/6/1987
Remediation Complete Approved DEP/Verified by LEP: 7/6/1987
Outcome: INVENTORY
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254245 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K55

NAME: J. B. COGGINS CO.
ADDRESS: 5 CROSS STREET
MERIDEN, CT 06450

Rev: 04/23/2010
ID/Status: 228

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

SDADB:
Waste Id: 14
Waste Type: METALS
Description: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SHWS

EDR ID: S104254245 **DIST/DIR:** 0.319 NE **ELEVATION:** 150 **MAP ID:** K55

NAME: J. B. COGGINS CO. **Rev:** 04/23/2010
ADDRESS: 5 CROSS STREET
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

SHWS:

State ID: 228
PTP Id Number: Not reported
WPC Number: Not reported
EPA ID: CTD000842906
PO Office: Not reported
Lat/Long: 41.55/-72.7917
Location Method: UNK
Groundwater Class: Not reported
Surface Water Qualification: Not reported
Waste Category: METALS, MOH SLUDGE
Disposal Method: LAGOON, IMPOUNDMENT
Sample: False
Other Dept of Env. Protection: RCRA
Updated By: Not reported
Update Program: Not reported
Date Updated: Not reported
Duplicate: False
Program: SUPERFUND
Inventory Date: 7/6/1987
On Inventory: True
Assessed: True
87 Group: RC
87 Origin: INVENTORY
On 87: True
Comments: ALL WASTE REMOVED PURSUANT TO CT HAZARDOUS WASTE MANAGEMENT
REGULATIONS IN 6/12/85. ADDRESS ON TRANSFER FORM 531 CROSS STREET.
5-31 CROSS STREET

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

VCP

EDR ID: S104183860 **DIST/DIR:** 0.321 SSW **ELEVATION:** 135 **MAP ID:** L56

NAME: RADIOLOGY ASSOC, INC. **Rev:** 02/11/2014
ADDRESS: 116 COOK AVENUE
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

VCP:

Transferor (seller): Not reported
Transfee (buyer): Not reported
Certifying Party: City of Meriden
Certifying Party Attn: Lawrence J. Kendz
Certifying Party Title: City Manager
Certifying Party Address: 142 East Main Street
Certifying Party City,St,Zip: Meriden, CT 06450
Voluntary Remediation Site: Yes
Date Received: 03/10/2014
Acknowledge Date: Not reported
Determination Date: Not reported
LEP Verified/DEP: Not reported
Rem Id: 11688
Remediation Location Id: 9190
Date Entered: 03/18/2014
Program: Vol_Rem_X
GAO Site: False
Staff Full Name: Not reported
Super/Date: Not reported
Stage Of Project: Not reported
RP Level Of Activity: Not reported
RP Needed Level Of Activity: Not reported
Staff Level Of Activity: Not reported
Staff Needed Level Of Activity: Not reported
Public Intrest: Not reported
PRP Cooperation: Not reported
Enforcement Status: Not reported
Level Of Complexity: Not reported
Complex Eng Or Sci: False
Complex Due To Public Involvement: False
Politically Complex: False
Complex Enforcement: False
Coordination With Other Bureaus: False
EPA Involvement: False
Staff Prefrence: Not reported
Readiness For Transfer: Not reported
Project Transfer Time: Not reported
Transfer Comments: Not reported
Staff As Of July 2000: Not reported
Initial Staff: Not reported
Type Of Transfer: Voluntary Remediation
Salutation: Mr. Kendz
Relationship To Transfer: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

VCP

EDR ID: S104183860 **DIST/DIR:** 0.321 SSW **ELEVATION:** 135 **MAP ID:** L56

NAME: RADIOLOGY ASSOC, INC. **Rev:** 02/11/2014
ADDRESS: 116 COOK AVENUE
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Audit Date: Not reported
Verif Type: Not reported
Audit Outcome: Not reported
GW: Not reported
Basin: Not reported
1st Payment: 3250
Pay Tag1: 225594
2nd Payment: Not reported
Pay Tag2: Not reported
Rtn: Not reported
Revised: Not reported
ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported
Report Overdue: Not reported
Ext Aprvl Sched: Not reported
License #: Not reported
Project Phase: Not reported
PT Comments: Not reported
EPA Id Number: Not reported
GW Class: Not reported
SW Class: Not reported
AO/C0: Not reported
Water Lead(Y Or N): Not reported
Priority: Not reported
Project Status(A, I Or D): Not reported
Last Updated: Not reported
SR Comments: Not reported
Priority Or Work-Load: Not reported
Status: Not reported
Notes: Not reported
Special Project Name: Not reported
Special Project Comments: Not reported
DOT Project: Not reported
Pt Counter: 0
Project Complete: False
Project Inactive: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

VCP

EDR ID: S104183860 **DIST/DIR:** 0.321 SSW **ELEVATION:** 135 **MAP ID:** L56

NAME: RADIOLOGY ASSOC, INC. **Rev:** 02/11/2014
ADDRESS: 116 COOK AVENUE
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Intl Deposit #: Not reported
Deposit #: Not reported
Spill Case #: Not reported
Diversion Id: 0
Public Notice: Not reported
Rap Received: Not reported
Rap Approved: Not reported
Compliance Category: Not reported
Delete Record: False
ECAF Reviewed By: Not reported
Notlocatable: False
Primaryaddress: False
Aka_sitename: False
Primarysitename: False
Aka_siteaddress: False
Lead: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016356302 **DIST/DIR:** 0.321 SSW **ELEVATION:** 135 **MAP ID:** L57

NAME: FORMER MERIDEN MEDICAL CENTER **Rev:** 03/20/2014
ADDRESS: 116 COOK AVENUE
MERIDEN, CT
NEW HAVEN
SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FORMER MERIDEN MEDICAL CENTER

Property #: Not reported

Parcel size: 2.79

Property Description: This Site is comprised of 2.79-acres and consists of a vacant, approximately 72,473 square foot, brick office building as well as paved areas for parking. The building is a four story structure with no basement. The City of Meriden acquired the property in December of 2009. The most recent active former Site occupant was the Meriden Medical Center. The Site has been vacant since approximately 2000 and was previously occupied by several health care offices since the late 1970s. Prior to that time the Site was part of the former International Silver Company INSILCO, Factory H property, that directly adjoins the Site to the east and was reportedly used as offices. According to FEMA Flood Map No. 090081 0004C, dated November 20, 2000, the Site is located within the 100-year flood plain. In 1987 an environmental investigation on this property and the adjacent 85 Cooper Street property showed petroleum hydrocarbons, volatile organic compounds VOCs and lead present in soil. Lead concentrations in soils exceeded Extraction Procedure Toxicity E.P. Tox Lead United States Environmental Protection Agency USEPA Resource Conservation and Recovery Act RCRA regulations. The lead impacts were reportedly confined to two feet below the pavement. In August 1988 excavation activities were conducted. 1,204 cubic yards of non-hazardous soil and thirty-two truck loads of hazardous soil were removed. Of the 1,204 cubic yards of material, approximately ten cubic yards from Area 2 was impacted with petroleum. Confirmation samples were taken from each excavation area. Remediation activities were complete by January 1989 pursuant to a clean-up plan designed by ERL and approved by the Connecticut Department of Environmental Protection CTDEP. A 10,000 gallon underground heating oil UST is located outside the building, south of Wing C.

Latitude: 41.535085

Longitude: -72.807338

HCM label: Interpolation-Map

Map scale: Not reported

Point of reference: Entrance Point of a Facility or Station

Datum: World Geodetic System of 1984

ACRES property ID: 111768

Start date: Not reported

Completed date: Not reported

Acres cleaned up: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016356302 **DIST/DIR:** 0.321 SSW **ELEVATION:** 135 **MAP ID:** L57

NAME: FORMER MERIDEN MEDICAL CENTER **Rev:** 03/20/2014
ADDRESS: 116 COOK AVENUE
MERIDEN, CT
NEW HAVEN
SOURCE: US Environmental Protection Agency

Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 4800
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: USEPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden, CT
Did owner change: N
Cleanup required: Unknown
Video available: No
Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016356302 **DIST/DIR:** 0.321 SSW **ELEVATION:** 135 **MAP ID:** L57

NAME: FORMER MERIDEN MEDICAL CENTER **Rev:** 03/20/2014
ADDRESS: 116 COOK AVENUE
MERIDEN, CT
NEW HAVEN
SOURCE: US Environmental Protection Agency

Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 2.79
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104084058 **DIST/DIR:** 0.322 ESE **ELEVATION:** 169 **MAP ID:** 58

NAME: OFFICE COMPLEX
ADDRESS: 95 EAST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 30179

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 2070
UST Facility Id: Not reported
LUST Case Id: 30179
Lust Status: Lust Completed
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 11/10/1992
Entry Date: Not reported
Site Case Id: Not reported
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: Not reported
LUST Owner Id: Not reported
UST Event Id: 2069
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104084058 **DIST/DIR:** 0.322 ESE **ELEVATION:** 169 **MAP ID:** 58

NAME: OFFICE COMPLEX
ADDRESS: 95 EAST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 30179

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: True
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: True
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 24
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104084058 **DIST/DIR:** 0.322 ESE **ELEVATION:** 169 **MAP ID:** 58

NAME: OFFICE COMPLEX
ADDRESS: 95 EAST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 30179

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S104084058 **DIST/DIR:** 0.322 ESE **ELEVATION:** 169 **MAP ID:** 58

NAME: OFFICE COMPLEX
ADDRESS: 95 EAST MAIN ST.
MERIDEN, CT 06450

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 30179

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Should be Registered Facility
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S103157201 **DIST/DIR:** 0.338 East **ELEVATION:** 131 **MAP ID:** 59

NAME: JOE GIANNETTI

Rev: 02/11/2014

ADDRESS: 71 PRATT ST
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 32640

SOURCE: CT Department of Energy & Environmental Protection

LUST:

LUST Id: 4515
UST Facility Id: Not reported
LUST Case Id: 32640
Lust Status: Lust Completed
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: False
Diesel: False
Gasoline: False
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 12/09/1996
Entry Date: Not reported
Site Case Id: 9606435
UST Site Id: Not reported
Cost Recovery Spill Case #: Not reported
Old SITS Number: Not reported
Case Log Id: Not reported
Monthly Report Id: 0
UST Owner Id: Not reported
LUST Owner Id: Not reported
UST Event Id: 4619
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S103157201 **DIST/DIR:** 0.338 East **ELEVATION:** 131 **MAP ID:** 59

NAME: JOE GIANNETTI

Rev: 02/11/2014

ADDRESS: 71 PRATT ST
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 32640

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: True
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: True
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Not reported
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: Not reported
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 35
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S103157201 **DIST/DIR:** 0.338 East **ELEVATION:** 131 **MAP ID:** 59

NAME: JOE GIANNETTI

Rev: 02/11/2014

ADDRESS: 71 PRATT ST
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 32640

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: Not reported
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S103157201 **DIST/DIR:** 0.338 East **ELEVATION:** 131 **MAP ID:** 59

NAME: JOE GIANNETTI

Rev: 02/11/2014

ADDRESS: 71 PRATT ST
MERIDEN, CT 06450

ID/Status: Lust Completed
ID/Status: 32640

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: Not reported
Lph Wells: Not reported
User Stamp: Not reported
Date Stamp: Not reported
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: #2 HEATING OIL, , tank removed
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970100 **DIST/DIR:** 0.373 ENE **ELEVATION:** 142 **MAP ID:** 60

NAME: MILLS MEMORIAL HOUSING COMPLEX PARKING LOT **Rev:** 03/20/2014

ADDRESS: 161 STATE STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: MILLS MEMORIAL HOUSING COMPLEX PARKING LOT

Property #: Not reported

Parcel size: 1.02

Property Description: The site was utilized for industrial purposes from the late 1800s until the 1950s. Former uses include manufacturing of stamps and punches, metal working and welding, painting, carriage manufacturing and repair, and manufacturing of sashes, doors, and blinds. Gasoline was formerly stored at the site to power engines used in manufacturing processes. Since 1960 the site has been used as a parking lot for the adjacent Mills Memorial Housing Complex and surrounding businesses

Latitude: 41.5412625

Longitude: -72.7981663

HCM label: Address Matching-House Number

Map scale: Not reported

Point of reference: Entrance Point of a Facility or Station

Datum: North American Datum of 1983

ACRES property ID: 143461

Start date: Not reported

Completed date: Not reported

Acres cleaned up: Not reported

Cleanup funding: Not reported

Cleanup funding source: Not reported

Assessment funding: 1400

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported

Redev. funding source: Not reported

Redev. funding entity name: Not reported

Redevelopment start date: Not reported

Assessment funding entity: EPA

Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 1

Cooperative agreement #: 97182101

Ownership entity: Government

Current owner: Meriden Housing Authority

Did owner change: N

Cleanup required: Unknown

Video available: Not reported

Photo available: Yes

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970100 **DIST/DIR:** 0.373 ENE **ELEVATION:** 142 **MAP ID:** 60

NAME: MILLS MEMORIAL HOUSING COMPLEX PARKING LOT **Rev:** 03/20/2014

ADDRESS: 161 STATE STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Y
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Y
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970100 **DIST/DIR:** 0.373 ENE **ELEVATION:** 142 **MAP ID:** 60

NAME: MILLS MEMORIAL HOUSING COMPLEX PARKING LOT **Rev:** 03/20/2014
ADDRESS: 161 STATE STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 1.02
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S108319524 **DIST/DIR:** 0.409 West **ELEVATION:** 144 **MAP ID:** 61

NAME: H.C.S. ENTERPRISES, LLC
ADDRESS: 293 WEST MAIN STREET
MERIDEN, CT

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 48734

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 0
UST Facility Id: 6979
LUST Case Id: 48734
Lust Status: Lust Completed
Processing Status: Not reported
EPA Reportable: True
Motor Fuel: False
Diesel: False
Gasoline: True
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: False
Piping: False
Overfill: False
Removal: False
Incident Date: 12/13/2006
Entry Date: 04/03/2007
Site Case Id: 200607867
UST Site Id: 1309
Cost Recovery Spill Case #: 0
Old SITS Number: 0
Case Log Id: 0
Monthly Report Id: 0
UST Owner Id: 9283
LUST Owner Id: PCC
UST Event Id: 0
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Bob Poole
2nd Contact EMail: Not reported
2nd Contact Address: Terrasyn Env.
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: 2037561000
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S108319524 **DIST/DIR:** 0.409 West **ELEVATION:** 144 **MAP ID:** 61

NAME: H.C.S. ENTERPRISES, LLC
ADDRESS: 293 WEST MAIN STREET
MERIDEN, CT

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 48734

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Steve Gaura
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: True
Responsible EMail: Not reported
Resp Party Name: Henry Smith - owner
Resp Party Address: Not reported
Resp Party City,St,Zip: Not reported
Resp Party Town Number: UNKNOWN
Resp Party Phone: 8608296389
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 0
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GA

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S108319524 **DIST/DIR:** 0.409 West **ELEVATION:** 144 **MAP ID:** 61

NAME: H.C.S. ENTERPRISES, LLC
ADDRESS: 293 WEST MAIN STREET
MERIDEN, CT

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 48734

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: south east
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlaid: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: True
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: True
Ground Water Gauging: False
Soil Venting: False
Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S108319524 **DIST/DIR:** 0.409 West **ELEVATION:** 144 **MAP ID:** 61

NAME: H.C.S. ENTERPRISES, LLC
ADDRESS: 293 WEST MAIN STREET
MERIDEN, CT

Rev: 02/11/2014
ID/Status: Lust Completed
ID/Status: 48734

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: 0
Lph Wells: 0
User Stamp: allison forrest/ForrestA
Date Stamp: 12/26/2012
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: municipal water, municipal sewer, Harbor Brook 2300 feet southeast,
Sodom Brook ~500 ft west. No potable wells within 500 ft.
Location Desc: Site has operated as a gas station since 1926.
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Not reported
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254244 **DIST/DIR:** 0.419 South **ELEVATION:** 141 **MAP ID:** 62

NAME: INSILCO FACTORY **Rev:** 04/23/2010
ADDRESS: COOPER STREET AND CHERRY STREET **ID/Status:** 1344
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 1344
Rem Master ID: 1100
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: GB
Surface Water Quality Classification: B
Waste Type: CHLR VOC, METALS
Disposal: SPILL/DUMP
Sample Data Available: True
Updated By: HAMEL, M.
Update Program: PTP
Updated: 7/27/1992
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 1270
Source of referral: PTP
Date Received: 7/1/1992
Staff Assigned: HAMEL, M.
Remediation Program: PTP
Date dt_assigned: 7/1/1992
Remediation Complete Approved DEP/Verified by LEP: 7/1/1992
Outcome: PTP
Remedial Id: 685
PTP Id: 0
Remediation Program: SRP
Remediation Program Entered: 7/24/1992

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254244 **DIST/DIR:** 0.419 South **ELEVATION:** 141 **MAP ID:** 62

NAME: INSILCO FACTORY **Rev:** 04/23/2010
ADDRESS: COOPER STREET AND CHERRY STREET **ID/Status:** 1344
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: HAMEL, M.
Remediation Program: PTP
Date dt_assign: 7/1/1992
Project Phase: Not reported
Order issued: False
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: False
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: 137
Order Number: SRD-0081
Date order issued: 5/15/1997
Staff Assigned: HAMEL, M.
Type of Order: O
Order Respondent: BL& A ASSOCIATES, L.P.
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: False
Comments: Not reported
Order Id: 68
Order Number: SRD-0037
Date order issued: 7/24/1992
Staff Assigned: HAMEL, M.
Type of Order: AO
Order Respondent: INSILCO CORP.
Admin Appeal Date: 8/25/1992
Date of Admin Appeal Ruling: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254244 **DIST/DIR:** 0.419 South **ELEVATION:** 141 **MAP ID:** 62

NAME: INSILCO FACTORY

Rev: 04/23/2010

ADDRESS: COOPER STREET AND CHERRY STREET
MERIDEN, CT
NEW HAVEN

ID/Status: 1344

SOURCE: CT Department of Energy & Environmental Protection

Date of Admin Appeal Ruling: Not reported

Date of Final Order: Not reported

Date of Court Appeal: Not reported

Date of Court Ruling: Not reported

Date of Court Ruling: Not reported

Date Order Modified: Not reported

Date Referred to AG: Not reported

Judgement: Not reported

Date of AGR judgement: Not reported

Penalty assessed: 0

Order Complete: Not reported

In compliance: False

Comments: VETERAN'S MEMORIAL HOSPITAL, MORTGAGE HOLDER, WILL UNDERTAKE
REMEDATION.(11/94)

SDADB:

Waste Id: 5

Waste Type: CHLR VOC

Description: Chlorinated Volatile Organic Compounds

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: FACTORY H - 77 COOPER STREET

Property #: Not reported

Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor

Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939.

Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory building.

Latitude: 41.5333545

Longitude: -72.8068704

HCM label: Unknown

Map scale: Not reported

Point of reference: Other Point

Datum: World Geodetic System of 1984

ACRES property ID: 73121

Start date: Not reported

Completed date: Not reported

Acres cleaned up: Not reported

Cleanup funding: Not reported

Cleanup funding source: Not reported

Assessment funding: 67262

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported

Redev. funding source: Not reported

Redev. funding entity name: Not reported

Redevelopment start date: Not reported

Assessment funding entity: EPA

Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Supplemental Assessment

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Accomplishment count: 0
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: No
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.46
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FACTORY H - 77 COOPER STREET
Property #: Not reported
Parcel size: 3.46
Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory building.
Latitude: 41.5333545
Longitude: -72.8068704
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Datum: World Geodetic System of 1984
ACRES property ID: 73121
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 17325
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Supplemental Assessment
Accomplishment count: 0
Cooperative agreement #: 97114801
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: No
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.46
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FACTORY H - 77 COOPER STREET
Property #: Not reported
Parcel size: 3.46
Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory building.

Latitude: 41.5333545
Longitude: -72.8068704
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73121
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 52125
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase II Environmental Assessment
Accomplishment count: 0
Cooperative agreement #: 97114801
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: No
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Past use industrial acreage: 3.46
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FACTORY H - 77 COOPER STREET
Property #: Not reported
Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory building.

Latitude: 41.5333545
Longitude: -72.8068704
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73121
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 2200
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97114801
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: No
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.46
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Cleanup
Property name: FACTORY H - 77 COOPER STREET
Property #: Not reported
Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

building.
Latitude: 41.5333545
Longitude: -72.8068704
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73121
Start date: 01-DEC-08
Completed date: Not reported
Acres cleaned up: .1
Cleanup funding: 1757
Cleanup funding source: US EPA - Brownfields Cleanup Cooperative Agreement
Assessment funding: Not reported
Assessment funding source: Not reported
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: Not reported
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Not reported
Accomplishment count: 0
Cooperative agreement #: 97182201
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: No
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: 0
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.46
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: Meriden, City of
Grant type: Assessment
Property name: FACTORY H - 77 COOPER STREET

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Property #: Not reported
Parcel size: 3.46
Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory building.

Latitude: 41.5333545
Longitude: -72.8068704
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73121
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 8908
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: USEPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Supplemental Assessment
Accomplishment count: 0
Cooperative agreement #: 96110701
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Cleanup required: Yes
Video available: No
Photo available: No
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.46
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: R1 Brownfields TBA (previously Superfund TBA)
Grant type: TBA
Property name: FACTORY H - 77 COOPER STREET
Property #: Not reported
Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory building.

Latitude: 41.5333545
Longitude: -72.8068704
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73121
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 5000
Assessment funding source: US EPA - TBA Funding
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 0
Cooperative agreement #: n/a
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: No
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.46
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Recipient name: R1 Brownfields TBA (previously Superfund TBA)
Grant type: TBA
Property name: FACTORY H - 77 COOPER STREET
Property #: Not reported
Parcel size: 3.46

Property Description: 77 Cooper Street consists of 3.46 acres and is bisected by Harbor Brook. The site lies within the 100-year flood plain and is zoned for manufacturing use. The site contains a 100,000 sq ft multi-story former, brick factory building constructed in 1900. Approximately 3 dust collectors associated with the former manufacturing facility remain on the site as well. A 900 sq ft electrical transformer building, overhead heat conveyance piping, and a large above ground water storage tank also remain on the site. The C. Rogers and Bros. Silverware Manufacturers were in operation at the site in 1884. The

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

International Silver Co. was in operation at the site in 1939. Processes included the manufacturing of silverware including casting, plating, machining, trimming, polishing, buffing, forging, storage, and shipping. The site is currently abandoned and fenced. The City of Meriden recently acquired the site. EPA conducted a removal action in early 2008 to address asbestos contamination within the factory building.

Latitude: 41.5333545
Longitude: -72.8068704
HCM label: Unknown
Map scale: Not reported
Point of reference: Other Point
Datum: World Geodetic System of 1984
ACRES property ID: 73121
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 35000
Assessment funding source: US EPA - TBA Funding
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase II Environmental Assessment
Accomplishment count: 0
Cooperative agreement #: n/a
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Yes
Video available: No
Photo available: No
Institutional controls required: Y
IC Category proprietary controls: Y
IC cat. info. devices: Y
IC cat. gov. controls: Y
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: No
State/tribal program date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

SOURCE: US Environmental Protection Agency

State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Y
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Y
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: Not reported
Past use industrial acreage: 3.46
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1012126908 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M63

NAME: FACTORY H - 77 COOPER STREET
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451

Rev: 03/20/2014

SOURCE: US Environmental Protection Agency

Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CERCLIS

EDR ID: 1010417165 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M64

NAME: FACTORY H
ADDRESS: 77 COOPER STREET
MERIDAN, CT 06451
NEW HAVEN
SOURCE: US EPA

Rev: 10/25/2013
ID/Status: CTN000105724

CERCLIS:
Site ID: 0105724
EPA ID: CTN000105724
Facility County: NEW HAVEN
Short Name: FACTORY H
Congressional District: 05
IFMS ID: 01EE
SMSA Number: Not reported
USGC Hydro Unit: Not reported
Federal Facility: Not a Federal Facility
DMNSN Number: 0.00000
Site Orphan Flag: Not reported
RCRA ID: Not reported
USGS Quadrangle: Not reported
Site Init By Prog: R
NFRAP Flag: Not reported
Parent ID: Not reported
RST Code: Not reported
EPA Region: 01
Classification: Not reported
Site Settings Code: Not reported
NPL Status: Not on the NPL
DMNSN Unit Code: Not reported
RBRAC Code: Not reported
RResp Fed Agency Code: Not reported
Non NPL Status: Removal Only Site (No Site Assessment Work Needed)
Non NPL Status Date: 08/16/07
Site Fips Code: 09009
CC Concurrence Date: / /
CC Concurrence FY: Not reported
Alias EPA ID: Not reported
Site FUDS Flag: Not reported

CERCLIS Site Contact Name(s):
Contact ID: 1000100.00000
Contact Name: TOM HATZOPOULOS
Contact Tel: (617) 918-1284
Contact Title: On-Scene Coordinator (OSC)
Contact Email: hatzopoulos.tom@epamail.epa.gov

Contact ID: 13004278.00000
Contact Name: Margaret Morris
Contact Tel: Not reported
Contact Title: Site Assessment Manager (SAM)

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CERCLIS

EDR ID: 1010417165 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M64

NAME: FACTORY H
ADDRESS: 77 COOPER STREET
MERIDAN, CT 06451
NEW HAVEN
SOURCE: US EPA

Rev: 10/25/2013
ID/Status: CTN000105724

Contact Email: Not reported

Alias Comments: Not reported
Site Description: Not reported

CERCLIS Assessment History:

Action Code: 001
Action: REMOVAL ASSESSMENT
Date Started: 07/25/07
Date Completed: 08/27/07
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: EPA Fund-Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001
Action: INFORMATION REPOSITORY ESTABLISHED
Date Started: / /
Date Completed: 12/19/07
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: EPA Fund-Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001
Action: Public Notice Published
Date Started: / /
Date Completed: 01/07/08
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: EPA Fund-Financed
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CERCLIS

EDR ID: 1010417165 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M64

NAME: FACTORY H
ADDRESS: 77 COOPER STREET
MERIDAN, CT 06451
NEW HAVEN

Rev: 10/25/2013
ID/Status: CTN000105724

SOURCE: US EPA

Action Code: 001
Action: REMOVAL
Date Started: 09/28/07
Date Completed: 03/12/08
Priority Level: Cleaned up
Operable Unit: SITEWIDE
Primary Responsibility: EPA Fund-Financed
Planning Status: Primary
Urgency Indicator: Time Critical
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 002
Action: ISSUE REQUEST LETTERS (104E)
Date Started: / /
Date Completed: 12/21/10
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: Federal Enforcement
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 003
Action: ISSUE REQUEST LETTERS (104E)
Date Started: / /
Date Completed: 12/21/10
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: Federal Enforcement
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001
Action: ISSUE REQUEST LETTERS (104E)
Date Started: / /
Date Completed: 01/20/11
Priority Level: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CERCLIS

EDR ID: 1010417165 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M64

NAME: FACTORY H
ADDRESS: 77 COOPER STREET
MERIDAN, CT 06451
NEW HAVEN
SOURCE: US EPA

Rev: 10/25/2013
ID/Status: CTN000105724

Operable Unit: SITEWIDE
Primary Responsibility: Federal Enforcement
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001
Action: Notice Letters Issued
Date Started: / /
Date Completed: 02/07/11
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: Federal Enforcement
Planning Status: Not reported
Urgency Indicator: Comb Notice/104(e)
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001
Action: UNILATERAL ADMIN ORDER
Date Started: / /
Date Completed: 09/28/11
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: Federal Enforcement
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001
Action: Notice of Intent by All Parties
Date Started: / /
Date Completed: 10/10/11
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: Not reported
Planning Status: Not reported
Urgency Indicator: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CERCLIS

EDR ID: 1010417165 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M64

NAME: FACTORY H
ADDRESS: 77 COOPER STREET
MERIDAN, CT 06451
NEW HAVEN
SOURCE: US EPA

Rev: 10/25/2013
ID/Status: CTN000105724

Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

Action Code: 001
Action: CONSENT AGREEMENT (ADMINISTRATIVE)
Date Started: / /
Date Completed: 12/19/12
Priority Level: Not reported
Operable Unit: SITEWIDE
Primary Responsibility: Federal Enforcement
Planning Status: Not reported
Urgency Indicator: Not reported
Action Anomaly: Not reported

For detailed financial records, contact EDR for a Site Report.:

[Click this hyperlink](#) while viewing on your computer to access
90 additional US CERCLIS Financial: record(s) in the EDR Site Report.

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

BROWNFIELDS

EDR ID: S109591345 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M65

NAME: FORMER FACTORY H-INTERNATIONAL SILVER **Rev:** 10/22/2013
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451
NEW HAVEN
SOURCE: CT Connecticut Brownfields Redevelopment Authority

CT BROWNFIELD:
Acres: 7
Past Use: Manufacturing/Silver
Road Access: Rte 15 /I- 691

BROWNFIELDS 2:
Region: 2
Acreage: 7
Past Use: Silver manufacturing
Contact Party: CBRA

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

VCP

EDR ID: S109591345 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M65

NAME: FORMER FACTORY H-INTERNATIONAL SILVER **Rev:** 02/11/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

VCP:
Transferor (seller): n/a
Transfee (buyer): n/a
Certifying Party: City of Meriden
Certifying Party Attn: Lawrence J. Kendzior
Certifying Party Title: City Manager
Certifying Party Address: 142 East Main Street
Certifying Party City,St,Zip: Meriden, CT 06450
Voluntary Remediation Site: Yes
Date Received: 10/27/2011
Acknowledge Date: 12/20/2011
Determination Date: 12/20/2011
LEP Verified/DEP: Not reported
Rem Id: 10704
Remediation Location Id: 8777
Date Entered: 11/02/2011
Program: Vol_Rem_X
GAO Site: False
Staff Full Name: Jing Chen
Super/Date: 12/21/2011
Stage Of Project: Not reported
RP Level Of Activity: Not reported
RP Needed Level Of Activity: Not reported
Staff Level Of Activity: Not reported
Staff Needed Level Of Activity: Not reported
Public Intrest: Not reported
PRP Cooperation: Not reported
Enforcement Status: Not reported
Level Of Complexity: Not reported
Complex Eng Or Sci: False
Complex Due To Public Involvement: False
Politically Complex: False
Complex Enforcement: False
Coordination With Other Bureaus: False
EPA Involvement: False
Staff Prefrence: Not reported
Readiness For Transfer: Not reported
Project Transfer Time: Not reported
Transfer Comments: Not reported
Staff As Of July 2000: Not reported
Initial Staff: Not reported
Type Of Transfer: Not reported
Salutation: Mr. Kendzior
Relationship To Transfer: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

VCP

EDR ID: S109591345 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M65

NAME: FORMER FACTORY H-INTERNATIONAL SILVER **Rev:** 02/11/2014
ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Audit Date: Not reported
Verif Type: Not reported
Audit Outcome: Not reported
GW: GB
Basin: Not reported
1st Payment: 0
Pay Tag1: Not reported
2nd Payment: Not reported
Pay Tag2: Not reported
Rtn: Not reported
Revised: Not reported
ECAF Received: Not reported
Old Determination Date: Not reported
Redeterminationdate: Not reported
Previous Determination: Not reported
Monitoringoption: Not reported
Postremedialmonitoring: Not reported
Schedule Of I/R: Not reported
Schedule Overdue: Not reported
Aprvl Sched: Not reported
Yr 1 Report: Not reported
Yr 2 Report: Not reported
Report Overdue: Not reported
Ext Aprvl Sched: Not reported
License #: Not reported
Project Phase: Not reported
PT Comments: one of parcels for thesite,see all info inREM10705
EPA Id Number: Not reported
GW Class: Not reported
SW Class: Not reported
AO/C0: Not reported
Water Lead(Y Or N): Not reported
Priority: Not reported
Project Status(A, I Or D): Not reported
Last Updated: Not reported
SR Comments: Not reported
Priority Or Work-Load: Not reported
Status: Not reported
Notes: Not reported
Special Project Name: Not reported
Special Project Comments: Not reported
DOT Project: Not reported
Pt Counter: 0
Project Complete: False
Project Inactive: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

VCP

EDR ID: S109591345 **DIST/DIR:** 0.426 SSW **ELEVATION:** 145 **MAP ID:** M65

NAME: FORMER FACTORY H-INTERNATIONAL SILVER **Rev:** 02/11/2014

ADDRESS: 77 COOPER STREET
MERIDEN, CT 06451
NEW HAVEN

SOURCE: CT Department of Energy & Environmental Protection

Intl Deposit #: Not reported
Deposit #: Not reported
Spill Case #: Not reported
Diversion Id: 0
Public Notice: Not reported
Rap Received: Not reported
Rap Approved: Not reported
Compliance Category: Not reported
Delete Record: False
ECAF Reviewed By: Jing Chen
Notlocatable: False
Primaryaddress: False
Aka_sitename: False
Primarysitename: False
Aka_siteaddress: False
Lead: LEP

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016356303 **DIST/DIR:** 0.429 SSW **ELEVATION:** 147 **MAP ID:** M66

NAME: 85 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 85 COOPER STREET
MERIDEN, CT
NEW HAVEN
SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of
Grant type: Assessment
Property name: 85 COOPER STREET
Property #: Not reported
Parcel size: .33

Property Description: The Site consists of one lot totaling approximately 0.33 acres. It is a vacant lot primarily surrounded by a chain linked fence and is entirely paved, however the pavement is in poor condition and overgrown with vegetation. There are no structures present on the Site. The Site was previously used as a parking lot by the former Meriden Medical Center located at 116 Cook Avenue and it has been vacant since the former Meriden Medical Center became unoccupied in approximately 2000. Prior to that, A former house and outbuilding were present on the Site from at least the 1940s to the late 1960s. The Site has been owned by Cook Avenue Realty, Inc. since 2004. The Site directly adjoins the former INSILCO, Factory H property to the east. According to FEMA Flood Map No. 090081 0004C, dated November 20, 2000, the Site is located within the 100-year flood plain. In 1987 an environmental investigation on this property and the adjacent 116 Cook Avenue property showed lead present in soil. Lead concentrations in soils exceeded Extraction Procedure Toxicity E.P. Tox Lead United States Environmental Protection Agency USEPA Resource Conservation and Recovery Act RCRA regulations. The lead impacts were reportedly identified to four feet below the pavement. In August 1988 excavation activities were conducted. A total of 404 cubic yards of non-hazardous soil was excavated from the Site. In addition, twenty truck loads of hazardous material was generated and transported off-Site. Remediation activities were complete by January 1989 pursuant to a clean-up plan designed by ERL and approved by the Connecticut Department of Environmental Protection CTDEP. In a 2003 GeoQuest Investigation VOCs and metals were reported in groundwater, however the concentrations did not exceed the applicable criteria.

Latitude: 41.5333729
Longitude: -72.8072474
HCM label: Interpolation-Map
Map scale: Not reported
Point of reference: Entrance Point of a Facility or Station
Datum: World Geodetic System of 1984
ACRES property ID: 111786
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016356303 **DIST/DIR:** 0.429 SSW **ELEVATION:** 147 **MAP ID:** M66

NAME: 85 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 85 COOPER STREET
MERIDEN, CT
NEW HAVEN
SOURCE: US Environmental Protection Agency

Cleanup funding source: Not reported
Assessment funding: 1610
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: USEPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden, CT
Did owner change: N
Cleanup required: Unknown
Video available: No
Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Y
Groundwater cleaned: Not reported
Lead contaminant found: Y
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1016356303 **DIST/DIR:** 0.429 SSW **ELEVATION:** 147 **MAP ID:** M66

NAME: 85 COOPER STREET **Rev:** 03/20/2014
ADDRESS: 85 COOPER STREET
MERIDEN, CT
NEW HAVEN
SOURCE: US Environmental Protection Agency

Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Y
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Y
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: Not reported
Past use commercial acreage: .33
Past use industrial acreage: Not reported
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: N

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970105 **DIST/DIR:** 0.439 East **ELEVATION:** 136 **MAP ID:** 67

NAME: 144 PRATT STREET **Rev:** 03/20/2014
ADDRESS: 144 PRATT STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of
Grant type: Assessment
Property name: 144 PRATT STREET
Property #: Not reported
Parcel size: 2.97
Property Description: Property has been used for a mix of commercial and residential uses
in the past. Former owner was the city of Meriden and current owner
is the Meriden Housing Authority.
Latitude: 41.5395194
Longitude: -72.7961444
HCM label: Address Matching-House Number
Map scale: Not reported
Point of reference: Entrance Point of a Facility or Station
Datum: North American Datum of 1983
ACRES property ID: 147383
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 1800
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: Meriden Housing Authority
Did owner change: N
Cleanup required: Unknown
Video available: Not reported
Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970105 **DIST/DIR:** 0.439 East **ELEVATION:** 136 **MAP ID:** 67

NAME: 144 PRATT STREET **Rev:** 03/20/2014
ADDRESS: 144 PRATT STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: 2.97
Past use commercial acreage: Not reported
Past use industrial acreage: Not reported
Future use greenspace acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970105 **DIST/DIR:** 0.439 East **ELEVATION:** 136 **MAP ID:** 67

NAME: 144 PRATT STREET

Rev: 03/20/2014

ADDRESS: 144 PRATT STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

BROWNFIELDS

EDR ID: S109591344 **DIST/DIR:** 0.443 SSW **ELEVATION:** 155 **MAP ID:** 68

NAME: GENERAL HOSPITAL **Rev:** 10/22/2013
ADDRESS: 1 KING PL
MERIDEN, CT
NEW HAVEN
SOURCE: CT Connecticut Brownfields Redevelopment Authority

BROWNFIELDS 2:
Region: 2
Acreage: 2.7
Past Use: Hospital
Contact Party: CBRA

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109595728 **DIST/DIR:** 0.446 ENE **ELEVATION:** 145 **MAP ID:** 69

NAME: GR CUMMINGS CO.

Rev: 02/11/2014

ADDRESS: 198 - 210 STATE STREET
MERIDEN, CT

ID/Status: Investigation
ID/Status: 59108

SOURCE: CT Department of Energy & Environmental Protection

LUST:

LUST Id: 0
UST Facility Id: 3710
LUST Case Id: 59108
Lust Status: Investigation
Processing Status: Not reported
EPA Reportable: False
Motor Fuel: True
Diesel: False
Gasoline: True
Other: False
Other Release: Not reported
No Release: False
Leak: False
Tank: True
Piping: False
Overfill: False
Removal: True
Incident Date: 04/05/2007
Entry Date: 05/29/2009
Site Case Id: 0
UST Site Id: 0
Cost Recovery Spill Case #: 0
Old SITS Number: 0
Case Log Id: 0
Monthly Report Id: 0
UST Owner Id: 2482
LUST Owner Id: Not reported
UST Event Id: 0
Contact Info: Not reported
Contact EMail: Not reported
Site Contact City,St,Zip: 93, CT 06513
2nd Contact: Not reported
2nd Contact EMail: Not reported
2nd Contact Address: Not reported
2nd Contact City,St,Zip: UNKNOWN
2nd Contact Address 2: Not reported
2nd Contact City 2: Not reported
2nd Contact Phone Number: Not reported
2nd Contact Fax Number: Not reported
2nd Contact Type: Not reported
Facility City Num: 80
Site Contact: MCVAC Environmental Services, Inc
Site Contact Address: 481 Grand Avenue

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109595728 **DIST/DIR:** 0.446 ENE **ELEVATION:** 145 **MAP ID:** 69

NAME: GR CUMMINGS CO. **Rev:** 02/11/2014
ADDRESS: 198 - 210 STATE STREET ID/Status: Investigation
MERIDEN, CT ID/Status: 59108

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: New Haven
Site Contact Phone: 2034981427
Site Contact Fax: 2034981429
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: CSC Investments, LLC
Resp Party Address: P.O. Box 219
Resp Party City,St,Zip: Wallingford, CT 06492
Resp Party Town Number: 148
Resp Party Phone: 2032651165
Resp Party Fax: Not reported
Resp Party Name 2: Jeffery Ray
Resp Party Address 2: Not reported
Resp Party Phone 2: 2036716777
Investigator Id: 0
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109595728 **DIST/DIR:** 0.446 ENE **ELEVATION:** 145 **MAP ID:** 69

NAME: GR CUMMINGS CO. **Rev:** 02/11/2014
ADDRESS: 198 - 210 STATE STREET ID/Status: Investigation
MERIDEN, CT ID/Status: 59108

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlaid: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: True
Ground Water Sample: False
Soil Sample: True
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: True
Ground Water Gauging: False
Soil Venting: False
Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109595728 **DIST/DIR:** 0.446 ENE **ELEVATION:** 145 **MAP ID:** 69

NAME: GR CUMMINGS CO.

Rev: 02/11/2014

ADDRESS: 198 - 210 STATE STREET
MERIDEN, CT

ID/Status: Investigation
ID/Status: 59108

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: 0
Lph Wells: 0
User Stamp: Allison Forrest/AForrest
Date Stamp: 11/21/2011
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: Not reported
Location Desc: Not reported
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Not reported
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015969893 **DIST/DIR:** 0.459 ENE **ELEVATION:** 125 **MAP ID:** 70

NAME: CEDAR PARK **Rev:** 03/20/2014

ADDRESS: 62 CEDAR STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of

Grant type: Assessment

Property name: CEDAR PARK

Property #: Not reported

Parcel size: 1.63

Property Description: The site was utilized for residential and commercial purposes from the late 1800 until the 1950s. Since 1960 the site has been used as a public park. Meriden has owned the site since the 1960s. Prior to that the site consisted of approximately 16 different parcels .

Latitude: 41.5407073

Longitude: -72.7961479

HCM label: Address Matching-House Number

Map scale: Not reported

Point of reference: Entrance Point of a Facility or Station

Datum: North American Datum of 1983

ACRES property ID: 144022

Start date: Not reported

Completed date: Not reported

Acres cleaned up: Not reported

Cleanup funding: Not reported

Cleanup funding source: Not reported

Assessment funding: 301

Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement

Redevelopment funding: Not reported

Redev. funding source: Not reported

Redev. funding entity name: Not reported

Redevelopment start date: Not reported

Assessment funding entity: EPA

Cleanup funding entity: Not reported

Grant type: H

Accomplishment type: Phase I Environmental Assessment

Accomplishment count: 1

Cooperative agreement #: 97182101

Ownership entity: Government

Current owner: City of Meriden

Did owner change: N

Cleanup required: Unknown

Video available: Not reported

Photo available: Yes

Institutional controls required: U

IC Category proprietary controls: Not reported

IC cat. info. devices: Not reported

IC cat. gov. controls: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015969893 **DIST/DIR:** 0.459 ENE **ELEVATION:** 125 **MAP ID:** 70

NAME: CEDAR PARK **Rev:** 03/20/2014
ADDRESS: 62 CEDAR STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: 1
Past use commercial acreage: .63
Past use industrial acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015969893 **DIST/DIR:** 0.459 ENE **ELEVATION:** 125 **MAP ID:** 70

NAME: CEDAR PARK **Rev:** 03/20/2014
ADDRESS: 62 CEDAR STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: Not reported

Recipient name: Meriden, City of
Grant type: Assessment
Property name: CEDAR PARK
Property #: Not reported
Parcel size: 1.63

Property Description: The site was utilized for residential and commercial purposes from the late 1800 until the 1950s. Since 1960 the site has been used as a public park. Meriden has owned the site since the 1960s. Prior to that the site consisted of approximately 16 different parcels .

Latitude: 41.5407073
Longitude: -72.7961479
HCM label: Address Matching-House Number
Map scale: Not reported
Point of reference: Entrance Point of a Facility or Station
Datum: North American Datum of 1983
ACRES property ID: 144022
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 1099
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 0
Cooperative agreement #: 96110701
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Unknown
Video available: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015969893 **DIST/DIR:** 0.459 ENE **ELEVATION:** 125 **MAP ID:** 70

NAME: CEDAR PARK **Rev:** 03/20/2014
ADDRESS: 62 CEDAR STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported
IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015969893 **DIST/DIR:** 0.459 ENE **ELEVATION:** 125 **MAP ID:** 70

NAME: CEDAR PARK **Rev:** 03/20/2014
ADDRESS: 62 CEDAR STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: 1
Past use commercial acreage: .63
Past use industrial acreage: Not reported
Future use greenspace acreage: Not reported
Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S110775436 **DIST/DIR:** 0.461 South **ELEVATION:** 162 **MAP ID:** N71

NAME: GETTY STATION

Rev: 02/11/2014

ADDRESS: 213 COLONY RD.
MERIDEN, CT 06450

ID/Status: Cleanup Initiated
ID/Status: 28437

SOURCE: CT Department of Energy & Environmental Protection

LUST:

LUST Id: 411

UST Facility Id: 7042

LUST Case Id: 28437

Lust Status: Cleanup Initiated

Processing Status: Not reported

EPA Reportable: True

Motor Fuel: True

Diesel: False

Gasoline: True

Other: False

Other Release: Not reported

No Release: False

Leak: False

Tank: False

Piping: False

Overfill: False

Removal: False

Incident Date: 06/19/1991

Entry Date: Not reported

Site Case Id: Not reported

UST Site Id: Not reported

Cost Recovery Spill Case #: Not reported

Old SITS Number: 9102367

Case Log Id: Not reported

Monthly Report Id: 0

UST Owner Id: 5266

LUST Owner Id: Not reported

UST Event Id: 410

Contact Info: Not reported

Contact EMail: stevensEES@aol.com

Site Contact City,St,Zip: 101, CT 06473

2nd Contact: Matt Roche (Tyree)

2nd Contact EMail: MRoche@tyreeorg.com

2nd Contact Address: 125 Commerce Drive

2nd Contact City,St,Zip: 18, CT 06804

2nd Contact Address 2: Not reported

2nd Contact City 2: Brookfield

2nd Contact Phone Number: 2037400450

2nd Contact Fax Number: 2039485033

2nd Contact Type: Not reported

Facility City Num: 80

Site Contact: Theodore Stevens (Stevens Engineering and Environmental Services, LLC)

Site Contact Address: 10 Carafa Terrace

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S110775436 **DIST/DIR:** 0.461 South **ELEVATION:** 162 **MAP ID:** N71

NAME: GETTY STATION

Rev: 02/11/2014

ADDRESS: 213 COLONY RD.
MERIDEN, CT 06450

ID/Status: Cleanup Initiated
ID/Status: 28437

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: North Haven
Site Contact Phone: 2032488222
Site Contact Fax: 2032480444
Site Contact Type: LEP
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Power Test Reality Co. LTD Partnership
Resp Party Address: 175 Sunnyside Boulevard
Resp Party City,St,Zip: Plainview, NY 118031521
Resp Party Town Number: Not reported
Resp Party Phone: 2034672536
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: Not reported
Resp Party Phone 2: Not reported
Investigator Id: 24
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GB

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S110775436 **DIST/DIR:** 0.461 South **ELEVATION:** 162 **MAP ID:** N71

NAME: GETTY STATION

Rev: 02/11/2014

ADDRESS: 213 COLONY RD.
MERIDEN, CT 06450

ID/Status: Cleanup Initiated
ID/Status: 28437

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: 8.10 to 9.58 ftbg
Areas Of Concern: Not reported
Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlayed: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: False
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: False
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S110775436 **DIST/DIR:** 0.461 South **ELEVATION:** 162 **MAP ID:** N71

NAME: GETTY STATION

Rev: 02/11/2014

ADDRESS: 213 COLONY RD.
MERIDEN, CT 06450

ID/Status: Cleanup Initiated
ID/Status: 28437

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False
DEP Closure Letter: False
Referred To: Not reported
No Wells: 13
Lph Wells: 0
User Stamp: allison forrest/ForrestA
Date Stamp: 01/22/2014
Correspondence: Not reported
Environmental Impact: Not reported
FollowUp: Not reported
GW Comments: No public water supply wells within 1,000 ft or water supply wells within 500 ft of site.
Location Desc: Surficial Geology: sand overlying finesBedrock Geology: New Haven Arkose, a red, pink, and gray coarse-grained, locally conglomeratic arkose interbedded with brick red shaley siltstone and fine-grained arkosic sandstone.
NOV Comments: Not reported
Release Desc: Not reported
Running Comments: Spills Files, UST Enforcement Files, Remediation Files, and LUST FilesOpen LUST Cases:0091-02367
Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188031 **DIST/DIR:** 0.461 South **ELEVATION:** 162 **MAP ID:** N72

NAME: GETTY PETROLEUM **Rev:** 04/23/2010
ADDRESS: 213 COLONY STREET **ID/Status:** 4457
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4457
Rem Master ID: 4539
PTP Id: 948
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4615
Source of referral: PTP
Date Received: 10/30/1991
Staff Assigned: Not reported
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 10/30/1991
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188031 **DIST/DIR:** 0.461 South **ELEVATION:** 162 **MAP ID:** N72

NAME: GETTY PETROLEUM **Rev:** 04/23/2010
ADDRESS: 213 COLONY STREET **ID/Status:** 4457
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188022 **DIST/DIR:** 0.479 SSW **ELEVATION:** 153 **MAP ID:** 73

NAME: PERSONAL EXPRESSIONS **Rev:** 04/23/2010
ADDRESS: 35 MERIDIAN STREET **ID/Status:** 4461
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4461
Rem Master ID: 4543
PTP Id: 960
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4620
Source of referral: PTP
Date Received: 3/24/1992
Staff Assigned: Not reported
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 3/24/1992
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188022 **DIST/DIR:** 0.479 SSW **ELEVATION:** 153 **MAP ID:** 73

NAME: PERSONAL EXPRESSIONS **Rev:** 04/23/2010
ADDRESS: 35 MERIDIAN STREET **ID/Status:** 4461
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254256 **DIST/DIR:** 0.483 NW **ELEVATION:** 132 **MAP ID:** 74

NAME: RAGEDINO **Rev:** 04/23/2010
ADDRESS: 4-10 AMES AVENUE **ID/Status:** 762
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 762
Rem Master ID: 580
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: GB
Surface Water Quality Classification: B
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: NEVILLE, T.
Update Program: D&A
Updated: 5/27/1997
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 723
Source of referral: COMPLAINT
Date Received: 1/31/1990
Staff Assigned: NEVILLE, T.
Remediation Program: D&A
Date dt_assigned: 5/9/1997
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254256 **DIST/DIR:** 0.483 NW **ELEVATION:** 132 **MAP ID:** 74

NAME: RAGEDINO **Rev:** 04/23/2010
ADDRESS: 4-10 AMES AVENUE **ID/Status:** 762
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970104 **DIST/DIR:** 0.488 ESE **ELEVATION:** 157 **MAP ID:** 75

NAME: 62 TWISS STREET **Rev:** 03/20/2014
ADDRESS: 62 TWISS STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

US BROWNFIELDS:

Recipient name: Meriden, City of
Grant type: Assessment
Property name: 62 TWISS STREET
Property #: Not reported
Parcel size: .21
Property Description: Property past use is residential, formerly owned by Peter J. Preisner. Property is currently owned by the City of Meriden and consists of a vacant lot.
Latitude: 41.5380554
Longitude: -72.795634
HCM label: Address Matching-House Number
Map scale: Not reported
Point of reference: Entrance Point of a Facility or Station
Datum: North American Datum of 1983
ACRES property ID: 147382
Start date: Not reported
Completed date: Not reported
Acres cleaned up: Not reported
Cleanup funding: Not reported
Cleanup funding source: Not reported
Assessment funding: 1400
Assessment funding source: US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding: Not reported
Redev. funding source: Not reported
Redev. funding entity name: Not reported
Redevelopment start date: Not reported
Assessment funding entity: EPA
Cleanup funding entity: Not reported
Grant type: H
Accomplishment type: Phase I Environmental Assessment
Accomplishment count: 1
Cooperative agreement #: 97182101
Ownership entity: Government
Current owner: City of Meriden
Did owner change: N
Cleanup required: Unknown
Video available: Not reported
Photo available: Yes
Institutional controls required: U
IC Category proprietary controls: Not reported
IC cat. info. devices: Not reported
IC cat. gov. controls: Not reported
IC cat. enforcement permit tools: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970104 **DIST/DIR:** 0.488 ESE **ELEVATION:** 157 **MAP ID:** 75

NAME: 62 TWISS STREET **Rev:** 03/20/2014
ADDRESS: 62 TWISS STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

IC in place date: Not reported
IC in place: Not reported
State/tribal program date: Not reported
State/tribal program ID: Not reported
State/tribal NFA date: Not reported
Air contaminated: Not reported
Air cleaned: Not reported
Asbestos found: Not reported
Asbestos cleaned: Not reported
Controlled substance found: Not reported
Controlled substance cleaned: Not reported
Drinking water affected: Not reported
Drinking water cleaned: Not reported
Groundwater affected: Not reported
Groundwater cleaned: Not reported
Lead contaminant found: Not reported
Lead cleaned up: Not reported
No media affected: Not reported
Unknown media affected: Not reported
Other cleaned up: Not reported
Other metals found: Not reported
Other metals cleaned: Not reported
Other contaminants found: Not reported
Other contams found description: Not reported
PAHs found: Not reported
PAHs cleaned up: Not reported
PCBs found: Not reported
PCBs cleaned up: Not reported
Petro products found: Not reported
Petro products cleaned: Not reported
Sediments found: Not reported
Sediments cleaned: Not reported
Soil affected: Not reported
Soil cleaned up: Not reported
Surface water cleaned: Not reported
Unknown found: Not reported
VOCs found: Not reported
VOCs cleaned: Not reported
Cleanup other description: Not reported
Num. of cleanup and re-dev. jobs: Not reported
Past use greenspace acreage: Not reported
Past use residential acreage: .21
Past use commercial acreage: Not reported
Past use industrial acreage: Not reported
Future use greenspace acreage: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

US BROWNFIELDS

EDR ID: 1015970104 **DIST/DIR:** 0.488 ESE **ELEVATION:** 157 **MAP ID:** 75

NAME: 62 TWISS STREET

Rev: 03/20/2014

ADDRESS: 62 TWISS STREET
MERIDEN, CT 06450

SOURCE: US Environmental Protection Agency

Future use residential acreage: Not reported
Future use commercial acreage: Not reported
Future use industrial acreage: Not reported
Greenspace acreage and type: Not reported
Superfund Fed. landowner flag: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109595729 **DIST/DIR:** 0.496 West **ELEVATION:** 133 **MAP ID:** O76

NAME: MERIDEN SUNOCO **Rev:** 02/11/2014
ADDRESS: 357 WEST MAIN STREET - 363 WEST MAIN STREET
MERIDEN, CT ID/Status: Cleanup Initiated
ID/Status: 59109

SOURCE: CT Department of Energy & Environmental Protection

LUST:
LUST Id: 0
UST Facility Id: 7115
LUST Case Id: 59109
Lust Status: Cleanup Initiated
Processing Status: Not reported
EPA Reportable: True
Motor Fuel: True
Diesel: False
Gasoline: False
Other: True
Other Release: Waste Oil
No Release: False
Leak: False
Tank: True
Piping: False
Overfill: False
Removal: True
Incident Date: 03/18/2008
Entry Date: 05/29/2009
Site Case Id: 0
UST Site Id: 1426
Cost Recovery Spill Case #: 0
Old SITS Number: 0
Case Log Id: 0
Monthly Report Id: 0
UST Owner Id: 3818
LUST Owner Id: Not reported
UST Event Id: 0
Contact Info: Not reported
Contact Email: Not reported
Site Contact City,St,Zip: UNKNOWN
2nd Contact: Robert Poole (Lenard Engineering, Inc.)
2nd Contact Email: poole@lenard-eng.com
2nd Contact Address: 1768 Storrs Road
2nd Contact City,St,Zip: 78, CT 06268
2nd Contact Address 2: PO Box 580
2nd Contact City 2: Storrs
2nd Contact Phone Number: 8604294921
2nd Contact Fax Number: 8604291367
2nd Contact Type: Project Manager
Facility City Num: 80
Site Contact: Not reported
Site Contact Address: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109595729 **DIST/DIR:** 0.496 West **ELEVATION:** 133 **MAP ID:** O76

NAME: MERIDEN SUNOCO **Rev:** 02/11/2014
ADDRESS: 357 WEST MAIN STREET - 363 WEST MAIN STREET
MERIDEN, CT ID/Status: Cleanup Initiated
ID/Status: 59109

SOURCE: CT Department of Energy & Environmental Protection

Site Contact Add 2: Not reported
Site Contact City 2: Not reported
Site Contact Phone: Not reported
Site Contact Fax: Not reported
Site Contact Type: Not reported
Department Contact 1: Not reported
Department Contact 2: Not reported
Referral Source: Not reported
Offsite Source: False
Date Referred: Not reported
Emergency: False
Private Heating Fuel: False
Commercial Heating Fuel: False
Commercial HF < 2100 Gal.: False
Commercial HF > 2100 Gal.: False
Commercial HF - Size Unk: False
No LUST Site: False
Cost Recvry Prgm Candidate: False
OCSR Complete: False
Follow Up Flag: False
Alternate Water Supply: False
Relocation: False
Responsible Party: False
Responsible EMail: Not reported
Resp Party Name: Aldin Associates, LP
Resp Party Address: 77 Sterling Road
Resp Party City,St,Zip: CT 06128
Resp Party Town Number: Not reported
Resp Party Phone: 8609741400
Resp Party Fax: Not reported
Resp Party Name 2: Not reported
Resp Party Address 2: P.O. Box 28045
Resp Party Phone 2: 2039741400
Investigator Id: 0
Follow Update: Not reported
Area Lextent: Not reported
Annual Precipitation: Not reported
Affected Population: Not reported
Population Setting: Not reported
Ground Water Direction: Not reported
Ground Water Gradient: Not reported
Hydro Basin: Not reported
Drastic: Not reported
Geo Setting: Not reported
Ground Water Classification: GA

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109595729 **DIST/DIR:** 0.496 West **ELEVATION:** 133 **MAP ID:** O76

NAME: MERIDEN SUNOCO **Rev:** 02/11/2014
ADDRESS: 357 WEST MAIN STREET - 363 WEST MAIN STREET
MERIDEN, CT ID/Status: Cleanup Initiated
ID/Status: 59109

SOURCE: CT Department of Energy & Environmental Protection

Receptor: Not reported
Ground Water Flow Direction: Not reported
Ground Water Depth: Not reported
Areas Of Concern: Not reported
Free Product Inches: 0
Fund Date: Not reported
Fund Planned: No
Fund Obligated: No
Fund Outlaid: No
Fund Judgment: No
Fund Recovered: No
Cellar Borings: False
Install Micro Wells: False
Ground Water Sample: False
Soil Sample: True
Soil Gas: False
Site Inspect: False
Soil Excavate: False
Geo Probe: False
Survey: False
Potable Well Sample: False
Sample MWS: False
Ground Water Gauging: False
Soil Venting: False
Active: True
NOV Action: None
NOV Issued: Not reported
NOV Due: Not reported
NOV Received: Not reported
NOV Closed: Not reported
NOV Disc Date: Not reported
NOV Issued Date: Not reported
NOV Compliance Sched: Not reported
NOV Admin Order: Not reported
NOV Referred To Ag: Not reported
Stop All NOV Actions: False
Release Invest Rpt: False
DEP App Letter 1: False
Correct Action Plan: False
DEP App Letter 2: False
Rem Sys Install: False
Rem Sys Install Date: Not reported
Closure Date: Not reported
Rem Sys Monitoring Rpt: False
Qrtly Gwater Mon Rpts: False

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

LUST

EDR ID: S109595729 **DIST/DIR:** 0.496 West **ELEVATION:** 133 **MAP ID:** O76

NAME: MERIDEN SUNOCO

Rev: 02/11/2014

ADDRESS: 357 WEST MAIN STREET - 363 WEST MAIN STREET
MERIDEN, CT

ID/Status: Cleanup Initiated
ID/Status: 59109

SOURCE: CT Department of Energy & Environmental Protection

Closure Req Rpt: False

DEP Closure Letter: False

Referred To: Not reported

No Wells: 0

Lph Wells: 0

User Stamp: allison forrest/forresta

Date Stamp: 02/03/2014

Correspondence: Not reported

Environmental Impact: Not reported

FollowUp: Not reported

GW Comments: Sodom Brook is ~150 ft to the northwest of site. The site is serviced by public water and municipal sewer. All 61 developed properties within 500 ft of site were connected to public water according to the 2008 Sensitive Receptor Survey.

Location Desc: Surficial Geology: sandy fill and/or sand with trace to little silt and trace cobbles overlying bedrock. Bedrock Geology: Bedrock is ~17-18 ftbg and is the New Haven Arkose Formation, a red-brown arkosic sandstone, mudstone, and shale.

NOV Comments: Not reported

Release Desc: Not reported

Running Comments: Spills Files, UST Enforcement Files, and LUST Files Open LUST

Cases: F80-07115 (waste oil) F80-07115 (gasoline) is linked to CF 1426

Work Performed: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104563185 **DIST/DIR:** 0.496 West **ELEVATION:** 133 **MAP ID:** O77

NAME: AMERICAN OIL CHANGE CORP.
ADDRESS: 321-327 WEST MAIN STREET
MERIDEN, CT

Rev: 04/23/2010
ID/Status: 4446

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4446
Rem Master ID: 4528
PTP Id: 936
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4604
Source of referral: PTP
Date Received: 8/7/1991
Staff Assigned: Not reported
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 8/7/1991
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104563185 **DIST/DIR:** 0.496 West **ELEVATION:** 133 **MAP ID:** O77

NAME: AMERICAN OIL CHANGE CORP.
ADDRESS: 321-327 WEST MAIN STREET
MERIDEN, CT

Rev: 04/23/2010
ID/Status: 4446

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188032 **DIST/DIR:** 0.551 SE **ELEVATION:** 279 **MAP ID:** 78

NAME: GUEST COMPANY INC. **Rev:** 04/23/2010
ADDRESS: 49 ELM STREET **ID/Status:** 4458
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4458
Rem Master ID: 4540
PTP Id: 949
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4616
Source of referral: PTP
Date Received: 6/7/1994
Staff Assigned: Not reported
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 6/7/1994
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188032 **DIST/DIR:** 0.551 SE **ELEVATION:** 279 **MAP ID:** 78

NAME: GUEST COMPANY INC.
ADDRESS: 49 ELM STREET
MERIDEN, CT

Rev: 04/23/2010
ID/Status: 4458

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104563192 **DIST/DIR:** 0.557 SW **ELEVATION:** 174 **MAP ID:** 79

NAME: ZIMERMAN, JOSEPH M.D. **Rev:** 04/23/2010
ADDRESS: 319 HANOVER STREET **ID/Status:** 4467
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4467
Rem Master ID: 4549
PTP Id: 965
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4626
Source of referral: PTP
Date Received: 1/5/1987
Staff Assigned: PEASE, R.
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 1/5/1987
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104563192 **DIST/DIR:** 0.557 SW **ELEVATION:** 174 **MAP ID:** 79

NAME: ZIMERMAN, JOSEPH M.D. **Rev:** 04/23/2010
ADDRESS: 319 HANOVER STREET **ID/Status:** 4467
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104563188 **DIST/DIR:** 0.601 WNW **ELEVATION:** 133 **MAP ID:** P80

NAME: DAVELLA MOTORS, INC. **Rev:** 04/23/2010
ADDRESS: 41 CAPITOL AVENUE **ID/Status:** 4453
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:
Facility ID: 4453
Rem Master ID: 4535
PTP Id: 2758
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4611
Source of referral: PTP
Date Received: 7/23/1998
Staff Assigned: Not reported
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 7/23/1998
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104563188 **DIST/DIR:** 0.601 WNW **ELEVATION:** 133 **MAP ID:** P80

NAME: DAVELLA MOTORS, INC.

Rev: 04/23/2010

ADDRESS: 41 CAPITOL AVENUE
MERIDEN, CT
NEW HAVEN

ID/Status: 4453

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CORRACTS

EDR ID: 1000280297 **DIST/DIR:** 0.612 East **ELEVATION:** 158 **MAP ID:** 81

NAME: MILLER CO THE **Rev:** 03/11/2014
ADDRESS: 99 CENTER ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: US EPA

CORRACTS:

EPA ID: CTD001147974
EPA Region: 01
Area Name: ENTIRE FACILITY
Actual Date: 20091009
Action: CA075LO - CA Prioritization, Facility or area was assigned a low
corrective action priority
NAICS Code(s): 331421
Copper Rolling, Drawing, and Extruding
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CTD001147974
EPA Region: 01
Area Name: ENTIRE FACILITY
Actual Date: 20120810
Action: CA400 - Date For Remedy Selection (CM Imposed)
NAICS Code(s): 331421
Copper Rolling, Drawing, and Extruding
Original schedule date: 20120810
Schedule end date: Not reported

EPA ID: CTD001147974
EPA Region: 01
Area Name: ENTIRE FACILITY
Actual Date: 20120810
Action: CA550RC
NAICS Code(s): 331421
Copper Rolling, Drawing, and Extruding
Original schedule date: 20120810
Schedule end date: Not reported

EPA ID: CTD001147974
EPA Region: 01
Area Name: ENTIRE FACILITY
Actual Date: 20121031
Action: CA725YE - Current Human Exposures Under Control, Yes, Current Human
Exposures Under Control has been verified
NAICS Code(s): 331421
Copper Rolling, Drawing, and Extruding
Original schedule date: Not reported
Schedule end date: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

CORRACTS

EDR ID: 1000280297 **DIST/DIR:** 0.612 East **ELEVATION:** 158 **MAP ID:** 81

NAME: MILLER CO THE **Rev:** 03/11/2014
ADDRESS: 99 CENTER ST
MERIDEN, CT 06450
NEW HAVEN
SOURCE: US EPA

EPA ID: CTD001147974
EPA Region: 01
Area Name: ENTIRE FACILITY
Actual Date: 20121031
Action: CA750YE - Migration of Contaminated Groundwater under Control, Yes,
Migration of Contaminated Groundwater Under Control has been verified
NAICS Code(s): 331421
Copper Rolling, Drawing, and Extruding
Original schedule date: Not reported
Schedule end date: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254247 **DIST/DIR:** 0.614 WNW **ELEVATION:** 127 **MAP ID:** P82

NAME: MAGNAKLEEN **Rev:** 04/23/2010
ADDRESS: 54 CAPITOL AVENUE **ID/Status:** 1947
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 1947
Rem Master ID: 2314
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: CHLR VOC, HYDRO/OIL
Disposal: DRYWELL, SPILL/DUMP, UST
Sample Data Available: False
Updated By: POST, M.
Update Program: CORE
Updated: 8/17/1994
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 1806
Source of referral: REMEDIAL
Date Received: 8/17/1994
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254247 **DIST/DIR:** 0.614 WNW **ELEVATION:** 127 **MAP ID:** P82

NAME: MAGNAKLEEN **Rev:** 04/23/2010
ADDRESS: 54 CAPITOL AVENUE **ID/Status:** 1947
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

SDADB:
Waste Id: 5
Waste Type: CHLR VOC
Description: Chlorinated Volatile Organic Compounds

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254225 **DIST/DIR:** 0.624 ENE **ELEVATION:** 150 **MAP ID:** 83

NAME: KINGS CLEANERS & LAUNDRY CENTER **Rev:** 04/23/2010
ADDRESS: 326 CENTER STREET **ID/Status:** 2996
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 2996
Rem Master ID: 3422
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: GB
Surface Water Quality Classification: B
Waste Type: CHLR VOC
Disposal: SPILL/DUMP
Sample Data Available: True
Updated By: HAMEL, M.
Update Program: PTP
Updated: 4/2/2000
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 2809
Source of referral: PTP
Date Received: 5/8/1997
Staff Assigned: HAMEL, M.
Remediation Program: PTP
Date dt_assigned: 5/9/1997
Remediation Complete Approved DEP/Verified by LEP: 7/30/1997
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254225 **DIST/DIR:** 0.624 ENE **ELEVATION:** 150 **MAP ID:** 83

NAME: KINGS CLEANERS & LAUNDRY CENTER **Rev:** 04/23/2010
ADDRESS: 326 CENTER STREET **ID/Status:** 2996
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

SDADB:
Waste Id: 5
Waste Type: CHLR VOC
Description: Chlorinated Volatile Organic Compounds

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188011 **DIST/DIR:** 0.635 SSW **ELEVATION:** 123 **MAP ID:** 84

NAME: SPENCER'S GARAGE **Rev:** 04/23/2010
ADDRESS: 274 COOK AVENUE **ID/Status:** 4465
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 4465
Rem Master ID: 4547
PTP Id: 2366
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4624
Source of referral: PTP
Date Received: 8/22/1988
Staff Assigned: Not reported
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 8/22/1988
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188011 **DIST/DIR:** 0.635 SSW **ELEVATION:** 123 **MAP ID:** 84

NAME: SPENCER'S GARAGE **Rev:** 04/23/2010
ADDRESS: 274 COOK AVENUE **ID/Status:** 4465
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: 1004455400 **DIST/DIR:** 0.678 East **ELEVATION:** 146 **MAP ID:** 85

NAME: UNION MFG CO **Rev:** 04/23/2010
ADDRESS: 290 PRATT ST **ID/Status:** 1639
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:
Facility ID: 1639
Rem Master ID: 1655
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: HYDRO/OIL
Disposal: SPILL/DUMP
Sample Data Available: False
Updated By: ZIMMERMAN, D.
Update Program: FPRE
Updated: 2/7/1994
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 1511
Source of referral: WATER
Date Received: 2/7/1994
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: 1004455400 **DIST/DIR:** 0.678 East **ELEVATION:** 146 **MAP ID:** 85

NAME: UNION MFG CO **Rev:** 04/23/2010
ADDRESS: 290 PRATT ST **ID/Status:** 1639
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

SDADB:
Waste Id: 11
Waste Type: HYDRO/OIL
Description: Hydrocarbons and/or Fuel Oil

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188025 **DIST/DIR:** 0.681 SE **ELEVATION:** 278 **MAP ID:** 86

NAME: CITY OF MERIDEN **Rev:** 04/23/2010
ADDRESS: 41 HIGH STREET **ID/Status:** 4451
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:
Facility ID: 4451
Rem Master ID: 4533
PTP Id: 940
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4609
Source of referral: PTP
Date Received: 11/1/1988
Staff Assigned: Not reported
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 11/1/1988
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104188025 **DIST/DIR:** 0.681 SE **ELEVATION:** 278 **MAP ID:** 86

NAME: CITY OF MERIDEN

Rev: 04/23/2010

ADDRESS: 41 HIGH STREET
MERIDEN, CT
NEW HAVEN

ID/Status: 4451

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254257 **DIST/DIR:** 0.802 SE **ELEVATION:** 275 **MAP ID:** 87

NAME: SILVER CITY GLASS **Rev:** 04/23/2010
ADDRESS: 122 CHARLES STREET **ID/Status:** 753
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 753
Rem Master ID: 571
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: 41.535
Longitude: -72.7917
Lat/Long Determined By: UNK
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: METALS, CYANIDE
Disposal: SEPTIC
Sample Data Available: False
Updated By: BOTTI, T.
Update Program: D&A
Updated: 4/25/1996
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: True
Site Archived from CERCLIS: False
Archive Date: Not reported
EPA's Removal at Site: False
Deferred to another EPA Program: False
EPA Env Priority Initiative Site: False
Federal Facility: False
Site on EPA's National Priority List: False
Part of an NPL site: False
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 714
Source of referral: RCRA
Date Received: 3/6/1987
Staff Assigned: BOTTI, T.
Remediation Program: D&A
Date dt_assigned: 2/17/1989
Remediation Complete Approved DEP/Verified by LEP: 1/26/1995
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254257 **DIST/DIR:** 0.802 SE **ELEVATION:** 275 **MAP ID:** 87

NAME: SILVER CITY GLASS **Rev:** 04/23/2010
ADDRESS: 122 CHARLES STREET **ID/Status:** 753
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported
SDADB:
Waste Id: 14
Waste Type: METALS
Description: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254227 **DIST/DIR:** 0.829 SSW **ELEVATION:** 163 **MAP ID:** 88

NAME: DUFFY PROPERTY **Rev:** 04/23/2010
ADDRESS: 382 COOK AVENUE **ID/Status:** 2991
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:
Facility ID: 2991
Rem Master ID: 2592
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: 41.5256
Longitude: -72.8086
Lat/Long Determined By: UNK
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: CHLR VOC, METALS
Disposal: DRYWELL
Sample Data Available: False
Updated By: BOBOWICZ, H. A.
Update Program: D&A
Updated: 6/28/1997
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 2804
Source of referral: RCRA
Date Received: 6/16/1997
Staff Assigned: BOBOWICZ, H. A.
Remediation Program: D&A
Date dt_assigned: 6/28/1997
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254227 **DIST/DIR:** 0.829 SSW **ELEVATION:** 163 **MAP ID:** 88

NAME: DUFFY PROPERTY **Rev:** 04/23/2010
ADDRESS: 382 COOK AVENUE **ID/Status:** 2991
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

SDADB:
Waste Id: 5
Waste Type: CHLR VOC
Description: Chlorinated Volatile Organic Compounds

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: 1000423902 **DIST/DIR:** 0.837 ESE **ELEVATION:** 278 **MAP ID:** 89

NAME: AS YOU LIKE IT CLEANERS **Rev:** 04/23/2010
ADDRESS: 367 E MAIN ST **ID/Status:** 4448
MERIDEN, CT 06450
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:
Facility ID: 4448
Rem Master ID: 4530
PTP Id: 3172
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 4606
Source of referral: PTP
Date Received: 6/17/1999
Staff Assigned: FRIGON, R. L .
Remediation Program: PTP
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: 6/17/1999
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: 1000423902 **DIST/DIR:** 0.837 ESE **ELEVATION:** 278 **MAP ID:** 89

NAME: AS YOU LIKE IT CLEANERS **Rev:** 04/23/2010
ADDRESS: 367 E MAIN ST **ID/Status:** 4448
MERIDEN, CT 06450
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254259 **DIST/DIR:** 0.857 SSE **ELEVATION:** 303 **MAP ID:** 90

NAME: THE EUREKA PRESS INC. **Rev:** 04/23/2010
ADDRESS: 264 BROAD STREET **ID/Status:** 875
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 875
Rem Master ID: 1293
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: WW SLUDGES
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 827
Source of referral: ISWS
Date Received: 5/18/1990
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254259 **DIST/DIR:** 0.857 SSE **ELEVATION:** 303 **MAP ID:** 90

NAME: THE EUREKA PRESS INC. **Rev:** 04/23/2010
ADDRESS: 264 BROAD STREET **ID/Status:** 875
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254262 **DIST/DIR:** 0.888 SE **ELEVATION:** 284 **MAP ID:** 91

NAME: VALERIO ALBARELLO, INC.
ADDRESS: 41-45 PARKER AVENUE
MERIDEN, CT 06450

Rev: 04/23/2010
ID/Status: 3169

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 3169
Rem Master ID: 3211
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: 41.532
Longitude: -72.7908
Lat/Long Determined By: UNK
Ground Water Quality Classification: GB
Surface Water Quality Classification: A
Waste Type: METALS, HYDRO/OIL
Disposal: SPILL/DUMP, UST
Sample Data Available: False
Updated By: FRIGON, R. L .
Update Program: PTP
Updated: 8/1/1998
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 2973
Source of referral: PTP
Date Received: 5/19/1998
Staff Assigned: FRIGON, R. L .
Remediation Program: PTP
Date dt_assigned: 6/6/1998
Remediation Complete Approved DEP/Verified by LEP: 8/31/1998
Outcome: PTP
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254262 **DIST/DIR:** 0.888 SE **ELEVATION:** 284 **MAP ID:** 91

NAME: VALERIO ALBARELLO, INC.
ADDRESS: 41-45 PARKER AVENUE
MERIDEN, CT 06450

Rev: 04/23/2010
ID/Status: 3169

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

SDADB:
Waste Id: 14
Waste Type: METALS
Description: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254249 **DIST/DIR:** 0.900 NNE **ELEVATION:** 170 **MAP ID:** 92

NAME: MERIDEN-STINEHOUR, INC. **Rev:** 04/23/2010
ADDRESS: 47 BILLARD STREET **ID/Status:** 876
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 876
Rem Master ID: 1294
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: CHEMICAL LIQUID, SLUDGES
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 828
Source of referral: ISWS
Date Received: 5/18/1990
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254249 **DIST/DIR:** 0.900 NNE **ELEVATION:** 170 **MAP ID:** 92

NAME: MERIDEN-STINEHOUR, INC. **Rev:** 04/23/2010
ADDRESS: 47 BILLARD STREET **ID/Status:** 876
MERIDEN, CT

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254248 **DIST/DIR:** 0.960 SW **ELEVATION:** 130 **MAP ID:** 93

NAME: MERIDEN FOUNDRY DUMP SITE **Rev:** 04/23/2010
ADDRESS: COE AVENUE AND HANOVER ROAD **ID/Status:** 740
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 740
Rem Master ID: 558
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: Not reported
Update Program: Not reported
Updated: Not reported
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 702
Source of referral: COMPLAINT
Date Received: 1/31/1990
Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assigned: Not reported
Remediation Complete Approved DEP/Verified by LEP: Not reported
Outcome: Not reported
Remedial Id: Not reported
PTP Id: Not reported
Remediation Program: Not reported
Remediation Program Entered: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254248 **DIST/DIR:** 0.960 SW **ELEVATION:** 130 **MAP ID:** 93

NAME: MERIDEN FOUNDRY DUMP SITE **Rev:** 04/23/2010
ADDRESS: COE AVENUE AND HANOVER ROAD **ID/Status:** 740
MERIDEN, CT
NEW HAVEN
SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: Not reported
Remediation Program: Not reported
Date dt_assign: Not reported
Project Phase: Not reported
Order issued: Not reported
Order Number: Not reported
Date order issued: Not reported
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: Not reported
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: Not reported
Order Number: Not reported
Date order issued: Not reported
Staff Assigned: Not reported
Type of Order: Not reported
Order Respondent: Not reported
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: Not reported
Comments: Not reported

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254250 **DIST/DIR:** 0.970 NE **ELEVATION:** 168 **MAP ID:** 94

NAME: MRM INDUSTRIES, INC. **Rev:** 04/23/2010
ADDRESS: 508 NORTH COLONY STREET **ID/Status:** 1017
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Site Discovery and Assessment:

Facility ID: 1017
Rem Master ID: 1369
PTP Id: Not reported
WPC Number: Not reported
Postal District: Not reported
Latitude: Not reported
Longitude: Not reported
Lat/Long Determined By: Not reported
Ground Water Quality Classification: Not reported
Surface Water Quality Classification: Not reported
Waste Type: Not reported
Disposal: Not reported
Sample Data Available: False
Updated By: FRIGON, R. L .
Update Program: USP
Updated: 1/26/2000
Date Created: Not reported
Duplicate: False
EPA CERCLIS Id: Not reported
Number EPA RCRIS Id: Not reported
Site on EPA's CERCLIS: Not reported
Site Archived from CERCLIS: Not reported
Archive Date: Not reported
EPA's Removal at Site: Not reported
Deferred to another EPA Program: Not reported
EPA Env Priority Initiative Site: Not reported
Federal Facility: Not reported
Site on EPA's National Priority List: Not reported
Part of an NPL site: Not reported
RCRA Generator Status: Not reported
RCRA Permit Status: Not reported
Referral Id: 959
Source of referral: LOCAL GOV
Date Received: 6/4/1991
Staff Assigned: WACHT, F. J.
Remediation Program: D&A
Date dt_assigned: 6/4/1991
Remediation Complete Approved DEP/Verified by LEP: 6/4/1991
Outcome: USP
Remedial Id: 324
PTP Id: 956
Remediation Program: III
Remediation Program Entered: 9/18/1995

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254250 **DIST/DIR:** 0.970 NE **ELEVATION:** 168 **MAP ID:** 94

NAME: MRM INDUSTRIES, INC. **Rev:** 04/23/2010
ADDRESS: 508 NORTH COLONY STREET **ID/Status:** 1017
MERIDEN, CT 06450

SOURCE: CT Department of Energy & Environmental Protection

Staff Assigned: RISCASSI, T.
Remediation Program: USP
Date dt_assign: Not reported
Project Phase: GWM
Order issued: True
Order Number: SRD-0062
Date order issued: 9/18/1995
Remedial Investigation Start: Not reported
Remedial Investigation Completed: Not reported
Remedial Design Start: Not reported
Remedial Design complet: Not reported
Remedial Action Start: Not reported
Remedial Action Completed: Not reported
Date Oper/ maintenance Started: Not reported
GW monitoring: False
Remediation complete Approved DEP/Verified by LEP: Not reported
Order Id: 121
Order Number: SRD-0061
Date order issued: 9/18/1995
Staff Assigned: RISCASSI, T.
Type of Order: CO
Order Respondent: MERIDEN MANUFACTURING ASSISTANCE AGENCY
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: False
Comments: Not reported
Order Id: 122
Order Number: SRD-0062
Date order issued: 9/18/1995
Staff Assigned: RISCASSI, T.
Type of Order: CO
Order Respondent: WALBRO AUTOMOTIVE CORPORATION
Admin Appeal Date: Not reported
Date of Admin Appeal Ruling: Not reported

- Continued on next page -

Site Detail Report

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

SDADB

EDR ID: S104254250 **DIST/DIR:** 0.970 NE **ELEVATION:** 168 **MAP ID:** 94

NAME: MRM INDUSTRIES, INC.

Rev: 04/23/2010

ADDRESS: 508 NORTH COLONY STREET
MERIDEN, CT 06450

ID/Status: 1017

SOURCE: CT Department of Energy & Environmental Protection

Date of Admin Appeal Ruling: Not reported
Date of Final Order: Not reported
Date of Court Appeal: Not reported
Date of Court Ruling: Not reported
Date of Court Ruling: Not reported
Date Order Modified: Not reported
Date Referred to AG: Not reported
Judgement: Not reported
Date of AGR judgement: Not reported
Penalty assessed: Not reported
Order Complete: Not reported
In compliance: False
Comments: Not reported

Database Descriptions

NPL: NPL National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices. NPL - National Priority List Proposed NPL - Proposed National Priority List Sites.

NPL Delisted: DELISTED NPL The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate. DELISTED NPL - National Priority List Deletions

CERCLIS: CERCLIS CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL. CERCLIS - Comprehensive Environmental Response, Compensation, and Liability Information System

NFRAP: CERCLIS-NFRAP Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site. CERCLIS-NFRAP - CERCLIS No Further Remedial Action Planned

RCRA COR ACT: CORRACTS CORRACTS identifies hazardous waste handlers with RCRA corrective action activity. CORRACTS - Corrective Action Report

RCRA TSD: RCRA-TSDF RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste. RCRA-TSDF - RCRA - Treatment, Storage and Disposal

RCRA GEN: RCRA-LQG RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. RCRA-LQG - RCRA - Large Quantity Generators RCRA-SQG - RCRA - Small Quantity Generators. RCRA-CESQG - RCRA - Conditionally Exempt Small Quantity Generators.

Federal IC / EC: US ENG CONTROLS A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health. US ENG CONTROLS - Engineering Controls Sites List US INST CONTROL - Sites with Institutional Controls.

ERNS: ERNS Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances. ERNS - Emergency Response Notification System

Database Descriptions

State/Tribal CERCLIS: SHWS State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state. SHWS - Inventory of Hazardous Disposal Sites SDADB - Site Discovery and Assessment Database.

State/Tribal SWL: SWF/LF Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites. SWF/LF - List of Landfills/Transfer Stations

State/Tribal LTANKS: LUST Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state. LUST - Leaking Underground Storage Tank List INDIAN LUST R7 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R5 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R9 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R4 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R6 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R1 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R8 - Leaking Underground Storage Tanks on Indian Land. INDIAN LUST R10 - Leaking Underground Storage Tanks on Indian Land.

State/Tribal Tanks: UST Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program. UST - Underground Storage Tank Data AST - Marine Terminals and Tank Information. INDIAN UST R6 - Underground Storage Tanks on Indian Land. INDIAN UST R7 - Underground Storage Tanks on Indian Land. INDIAN UST R8 - Underground Storage Tanks on Indian Land. INDIAN UST R10 - Underground Storage Tanks on Indian Land. INDIAN UST R4 - Underground Storage Tanks on Indian Land. INDIAN UST R5 - Underground Storage Tanks on Indian Land. INDIAN UST R1 - Underground Storage Tanks on Indian Land. INDIAN UST R9 - Underground Storage Tanks on Indian Land.

State/Tribal IC / EC: AUL Environmental Land Use Restriction sites. AUL - ELUR Sites

State/Tribal VCP: VCP Sites involved in the Voluntary Remediation Program. VCP - Voluntary Remediation Sites

ST/Tribal Brownfields: BROWNFIELDS BROWNFIELDS 2 - Brownfields Inventory. A brownfield site is generally defined as "real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant or contaminant?" BROWNFIELDS 2 - Brownfields Inventory

US Brownfields: US BROWNFIELDS Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs. US BROWNFIELDS - A Listing of Brownfields Sites

Other Haz Sites: US CDL A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments. US CDL - Clandestine Drug Labs

Database Descriptions

Local Land Records: CT PROPERTY A listing of sites that meet the definition of a hazardous waste establishment. They can be generators, dry cleaners, furniture strippers, etc. These sites have been sold to another owner. CT PROPERTY - Property Transfer Filings

Spills: HMIRS Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT. HMIRS - Hazardous Materials Information Reporting System SPILLS - Oil & Chemical Spill Database. SPILLS 90 - SPILLS90 data from FirstSearch.

Other: RCRA NonGen / NLR RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste. RCRA NonGen / NLR - RCRA - Non Generators TRIS - Toxic Chemical Release Inventory System. TSCA - Toxic Substances Control Act. FTTS - FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act). FTTS INSP - FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act). SSTS - Section 7 Tracking Systems. ICIS - Integrated Compliance Information System. PADS - PCB Activity Database System. MLTS - Material Licensing Tracking System. RADINFO - Radiation Information Database. FINDS - Facility Index System/Facility Registry System. RAATS - RCRA Administrative Action Tracking System. BRS - Biennial Reporting System. LWDS - Connecticut Leachate and Wastewater Discharge Sites. CT MANIFEST - Hazardous Waste Manifest Data. INDIAN RESERV - Indian Reservations. US AIRS (AFS) - Aerometric Information Retrieval System Facility Subsystem (AFS). CPCS - Contaminated or Potentially Contaminated Sites. PRP - Potentially Responsible Parties. FEDLAND - Federal and Indian Lands. US AIRS MINOR - Air Facility System Data.

Database Sources

NPL: EPA

Updated Quarterly

NPL Delisted: EPA

Updated Quarterly

CERCLIS: EPA

Updated Quarterly

NFRAP: EPA

Updated Quarterly

RCRA COR ACT: EPA

Updated Quarterly

RCRA TSD: Environmental Protection Agency

Updated Quarterly

RCRA GEN: Environmental Protection Agency

Updated Quarterly

Federal IC / EC: Environmental Protection Agency

Varies

ERNS: National Response Center, United States Coast Guard

Updated Annually

State/Tribal CERCLIS: Department of Energy & Environmental Protection

No Update Planned

State/Tribal SWL: Department of Energy & Environmental Protection

Updated Annually

State/Tribal LTANKS: Department of Energy & Environmental Protection

Updated Semi-Annually

State/Tribal Tanks: Department of Energy & Environmental Protection

Updated Semi-Annually

Database Sources

State/Tribal IC / EC: Department of Energy & Environmental Protection

Varies

State/Tribal VCP: Department of Energy & Environmental Protection

Varies

ST/Tribal Brownfields: Department of Energy & Environmental Protection

Varies

US Brownfields: Environmental Protection Agency

Updated Semi-Annually

Other Haz Sites: Drug Enforcement Administration

Updated Quarterly

Local Land Records: Department of Energy & Environmental Protection

Updated Semi-Annually

Spills: U.S. Department of Transportation

Updated Annually

Other: Environmental Protection Agency

Varies

Street Name Report for Streets near the Target Property

Target Property: 88 GROVE STREET
MERIDEN, CT 06451

JOB: 81649.14

Street Name	Dist/Dir	Street Name	Dist/Dir
Barristers Ct	0.07 East		
Brooks St	0.22 ENE		
Butler St	0.10 SW		
Church St	0.00 South		
Cliff St	0.04 NNE		
Colony St	0.14 ESE		
Crown St	0.23 SE		
E Main St	0.14 SE		
Fairmount St	0.05 WSW		
Foster Ct	0.17 North		
Foster St	0.21 NNE		
Garden St	0.25 WNW		
Gold St	0.25 SSE		
Goodwill Ave	0.16 WNW		
Grove St	0.00 --		
Hanover St	0.15 SSE		
Hickory St	0.24 WNW		
Hillside Ave	0.07 West		
Lewis Ave	0.19 WNW		
Lincoln Ct	0.21 NE		
Lincoln St	0.16 ENE		
Linsley Ave	0.22 West		
Maple Br	0.12 WSW		
Maple St	0.11 WNW		
Mount Pleasant St	0.22 North		
North St	0.22 NW		
Perkins St	0.20 SE		
Pine St	0.19 WNW		
Pratt St	0.24 ESE		
Prospect St	0.04 WNW		
Railroad Ave	0.16 ESE		
Ramp	0.13 SE		
Randolph Ave	0.18 WSW		
S Colony St	0.14 SE		
S Grove St	0.08 South		
Sherman Pl	0.05 East		
Springdale Ave	0.15 NNE		
State Hwy 71	0.16 WSW		
State St	0.18 ESE		
Union St	0.17 NNE		
W Cliff St	0.08 WNW		
W Main St	0.08 South		
Washington Hts	0.09 NE		
Washington Pl	0.10 ENE		
Washington St	0.13 NNE		


Environmental FirstSearch

1.000 Mile Radius

ASTM MAP: NPL, RCRACOR, STATES Sites



88 GROVE STREET MERIDEN, CT 06451

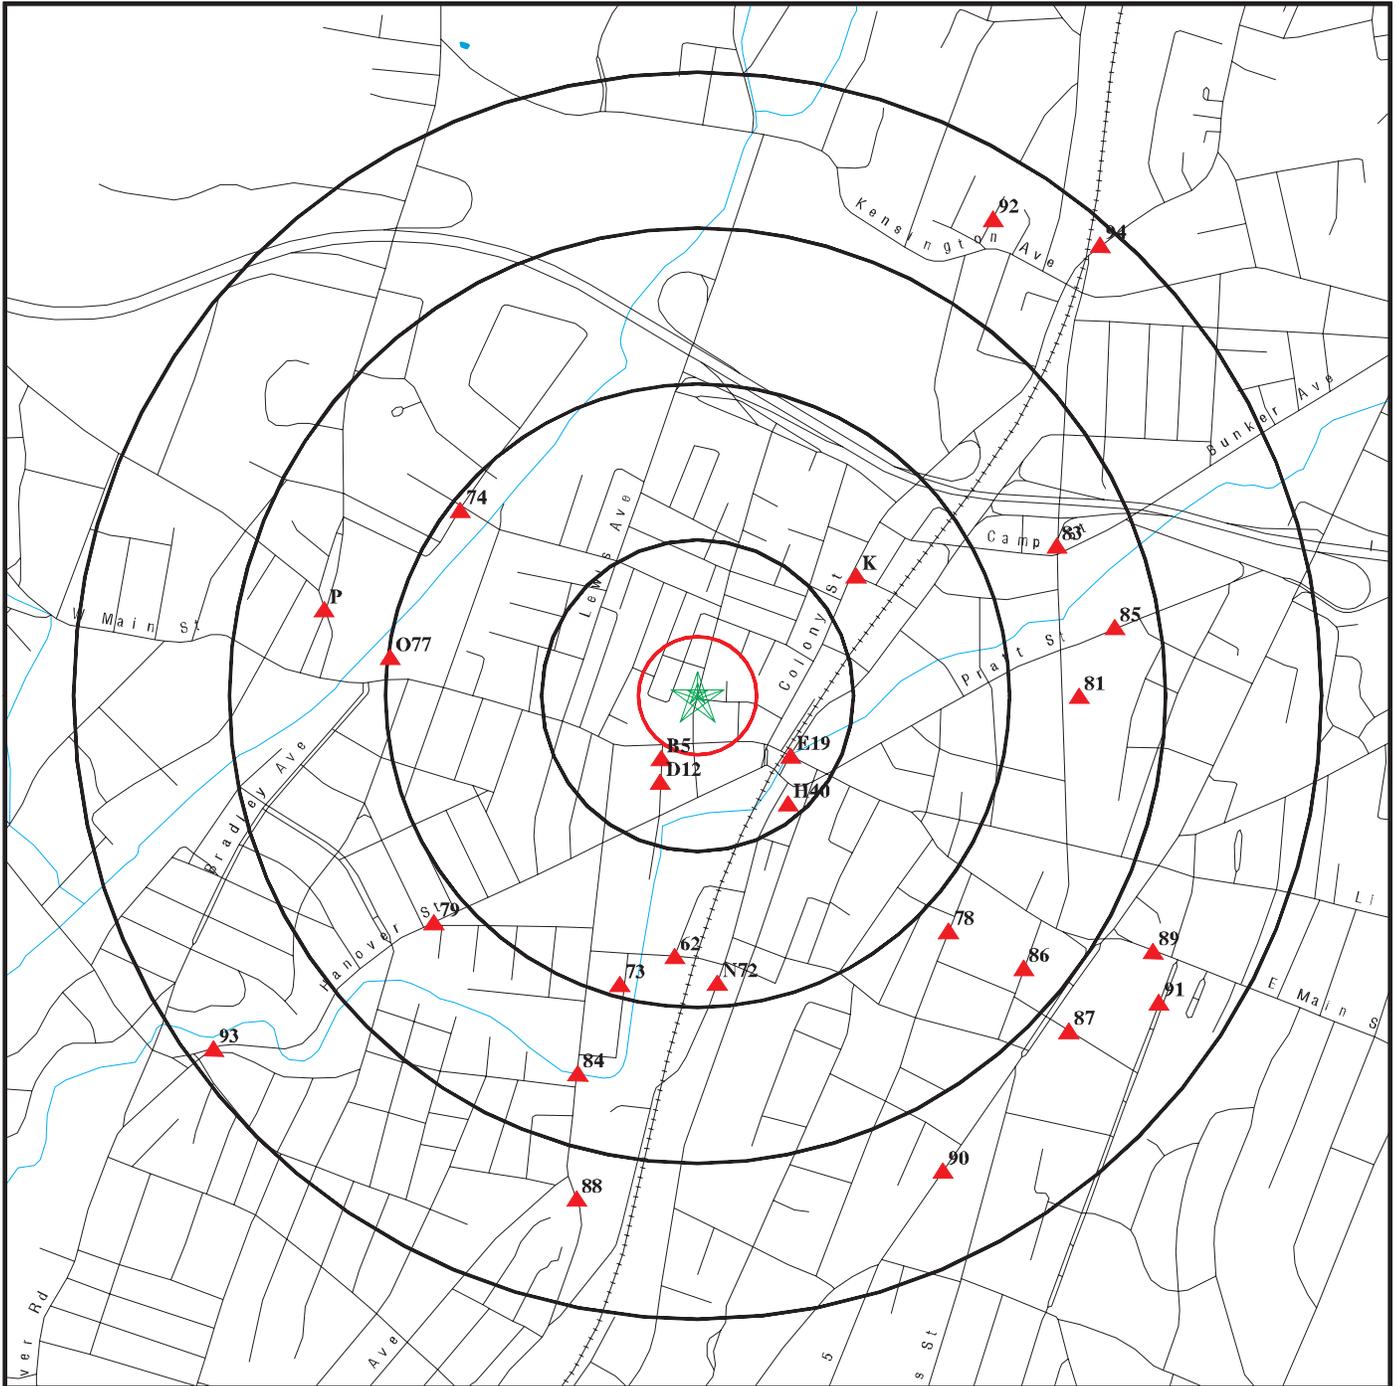

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius


- ★ Target Property (Latitude: 41.5393 Longitude: 72.8048)
- ▲ Identified Sites
- ▨ Indian Reservations BIA
- ▧ National Priority List Sites

Environmental FirstSearch

0.500 Mile Radius
ASTM MAP: CERCLIS, RCRATSD, LUST, SWL



88 GROVE STREET MERIDEN, CT 06451

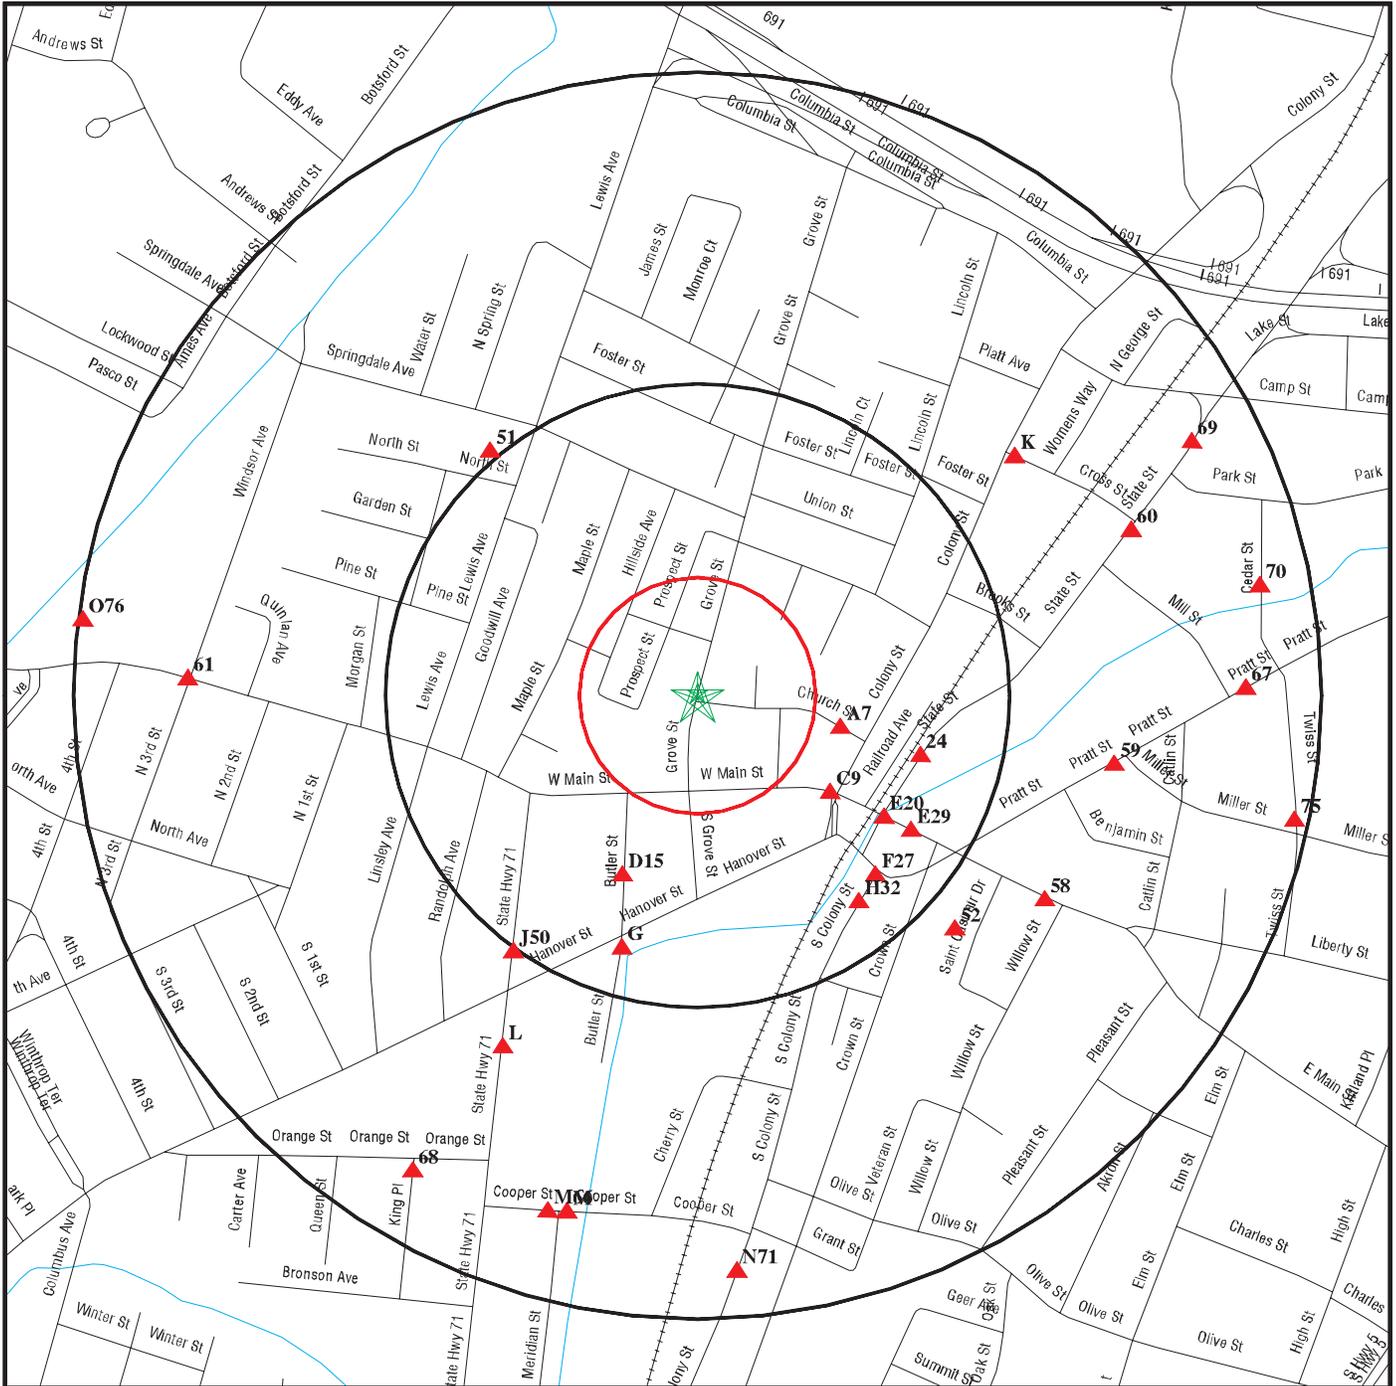

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius

- ★ Target Property (Latitude: 41.5393 Longitude: 72.8048)
- ▲ Identified Sites
- ▭ Indian Reservations BIA
- ▭ National Priority List Sites

Environmental FirstSearch

0.25 Mile Radius

ASTM MAP: RCRAGEN, ERNS, UST, FED IC/EC, METH LABS



88 GROVE STREET MERIDEN, CT 06451



Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius


- ★ Target Property (Latitude: 41.5393 Longitude: 72.8048)
- ▲ Identified Sites
- Indian Reservations BIA
- National Priority List Sites

Environmental FirstSearch

0.25 Mile Radius
Non ASTM Map, Spills, FINDS



88 GROVE STREET MERIDEN, CT 06451

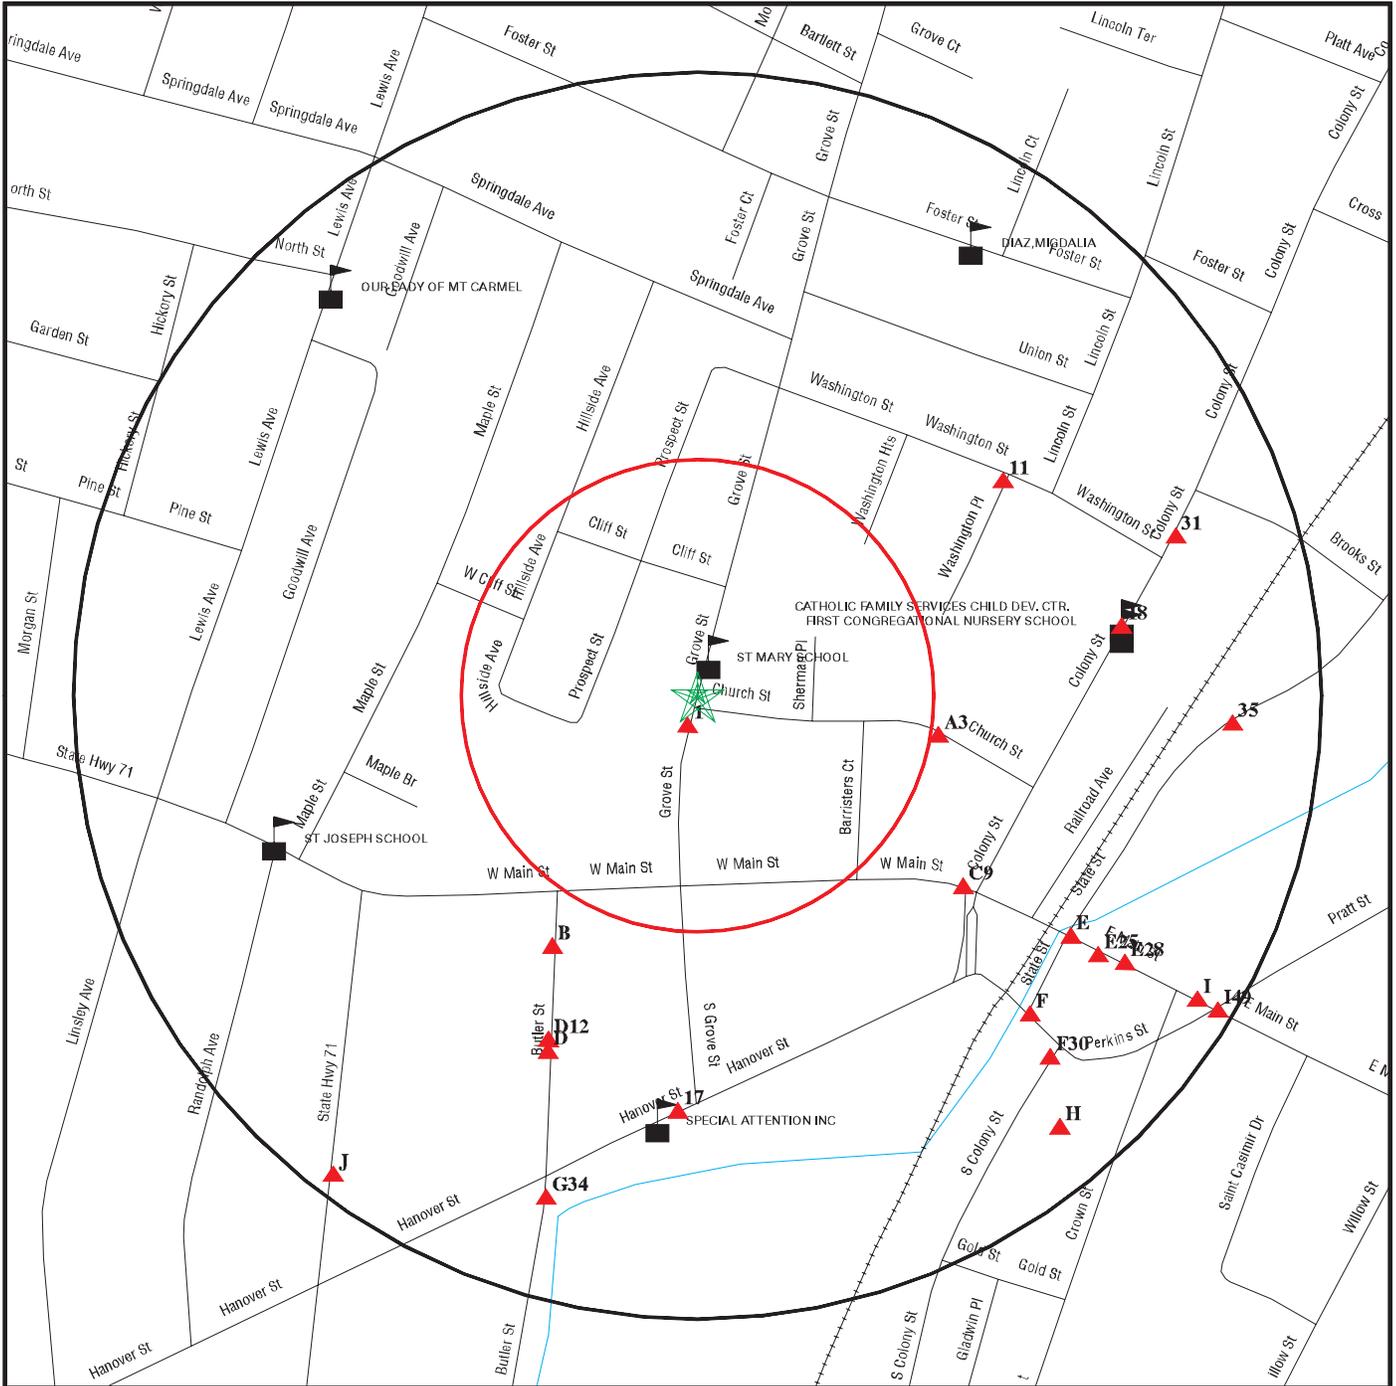

Black Rings Represent Qtr. Mile Radius; Red Ring Represents 500 ft. Radius

- ★ Target Property (Latitude: 41.5393 Longitude: 72.8048)
- ▲ Identified Sites
- Sensitive Receptors
- ▣ National Priority List Sites
- ▨ Indian Reservations BIA

Site location Map

Topo: 0.75 Mile Radius



88 GROVE STREET MERIDEN, CT 06451



Map Image Position: TP
Map Reference Code & Name: 41072-E7 Meriden
Map State(s): CT
Modified Date: 1992



Appendix C: CTDEEP List of Contaminated or Potentially Contaminated Sites

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Abs Pumps, Inc.	140 Pond View Drive	Property Transfer – Form III Investigation started	9/19/2011					
Active Auto Exxon (danby's Service Station)	1100 East Main Street	Leaking Underground Storage Tanks – Completed						
Agc Inc.	106 Evansville Ave.	Inventory of Hazardous Waste Disposal Sites						
Agc, Inc.	106 Evansville Avenue	Leaking Underground Storage Tanks – Completed						
Agc, Incorporated	106 Evansville Avenue	Property Transfer – Form III Remediation Started		5/28/2016				
Agc, Incorporated	106 Evansville Avenue	Voluntary Remediation: CGS 22a.-133x Investigation started	9/3/2009					
Algonquin Gas Transmission	1401 North Colony Road	Voluntary Remediation: CGS 22a.-133x Investigation started	6/11/1996					
Algonquin Gas Transmission Co.	1401 No. Colony Rd.	Leaking Underground Storage Tanks – Rem. Started						
Algonquin Gas Transmission Company	1401 North Colony Road	Property Transfer – Form III Investigation started	10/22/2002					
Amf Cuno	400 Research Parkway	Property Transfer – Form III Investigation started	7/31/2009					
Antonowicz Residence	72 Jerome Avenue	Leaking Underground Storage Tanks – Pending						
Apa Transport Facility	475 Research Parkway	Voluntary Remediation: CGS 22a.-133x Investigation started	12/16/2002					
Aplicare, Inc.	550 Research Parkway	Property Transfer – Form III Investigation started	3/15/2012					
As U Like It Cleaners	518 West Main Street	Inventory of Hazardous Waste Disposal Sites						
As U Like It Cleaners	530 West Main St.	Leaking Underground Storage Tanks – Pending						

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
As You Like It Cleaners Of Meriden	367 East Main Street	Property Transfer – Form III Investigation started	9/7/1999					
As-u-like-it Cleaners	367 East Main Street	Property Transfer – Form III Investigation started	1/7/2008					
At&t Meriden Wc (#7807)	1441 North Colony Raod	Leaking Underground Storage Tanks – Completed						
At&t Meriden Co #7801	27 Butler Street	Leaking Underground Storage Tanks – Investigation						
Atlas Container Corporation	119 Empire Avenue	CERCLIS						
Atlas-aero Corporation	85 Tremont Street	Property Transfer – Form III Investigation started	6/10/2003					
Bertha Southland	156 Balwin St.	Leaking Underground Storage Tanks – Completed						
Boucher's Service Station	652 W. Main Street	Leaking Underground Storage Tanks – Investigation						
Broad Street Sunoco	143 Broad Street	Leaking Underground Storage Tanks – Completed						
C.n Flagg & Co., Inc. (former Edge-tek)	450 Murdock Avenue	Leaking Underground Storage Tanks – Rem. Started						
Cabin Restaurant / Anthony Paguni	Colony Street, Brooks Street	Leaking Underground Storage Tanks – Rem. Started						
Capital Car Wash	365 South Broad Street	Leaking Underground Storage Tanks – Rem. Started						
Carrabetta Enterprise Apts.	Stoddard Rd.	Leaking Underground Storage Tanks – Completed						
Carrol Kowalski	46 Leslie Drive	Leaking Underground Storage Tanks – Completed						
Central Connecticut Volvo (former Salka And Sons, Inc.)	30 Pomeroy Avenue	Leaking Underground Storage Tanks – Rem. Started						

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
City Of Meriden, Bob Mercaldi	Silver Lake Pump Station, Silver Lake Road	Leaking Underground Storage Tanks – Completed						
Cl&p	56 Cooper Street	Property Transfer – Form III Investigation started	3/21/2007					
Colonial Custom Cleaners	9 Butler Street	Property Transfer – Form III						
Colony Market	640 Old Colony Road	Leaking Underground Storage Tanks – Rem. Started						
Connecticut Color, Inc	127 Pomeroy Avenue	Property Transfer – Form III Investigation started	3/25/2010					
Connecticut Color, Inc.	127 Pomeroy Avenue	Property Transfer – Form III Investigation started	3/10/2010					
Cook Residence	691 Paddock Ave.	Leaking Underground Storage Tanks – Completed						
Coscuna Property	137 Atkins St.	Leaking Underground Storage Tanks – Pending						
Cox Cable	687 East Main Street	Leaking Underground Storage Tanks – Completed						
Crc Chrome Corporation	169-r Pratt Street	Property Transfer – Form III						
Crown Plastics	900 Old Colony Road	Inventory of Hazardous Waste Disposal Sites						
Crown Plastics, Inc.	896 Old Colony Road (aka 900 Old Colony Road)	Property Transfer – Form III Investigation started	3/25/1999					
Ct Dot	265 Cook Avenue	Leaking Underground Storage Tanks – Pending						
Ct Dot	Rte. 5 & Rte. 15	Leaking Underground Storage Tanks – Completed						
Ct. National Bank	1 West Main St.	Leaking Underground Storage Tanks – Completed						

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Cumberland Farms #668	937 Broad Street	Leaking Underground Storage Tanks – Completed						
Cumberland Farms, Inc, Station 649	1087 Old Colony Road	Leaking Underground Storage Tanks – Completed						
Cuno Facility (former)	Carl Ave.	Leaking Underground Storage Tanks – Pending						
Cuno Incorporated	400 Research Parkway	CERCLIS						
Cuno, Inc.	400 Research Parkway	Inventory of Hazardous Waste Disposal Sites						
Cvs - Meriden - Bob Contact	839 East Main Street	Leaking Underground Storage Tanks – Completed						
Danby's A-1 Gulf	872 East Main Street To 882 East Main Street	Leaking Underground Storage Tanks – Rem. Started						
Danby's Gulf	1125 East Main Street	Leaking Underground Storage Tanks – Investigation						
Dcys Altobello Center	1 Undercliff Road	Leaking Underground Storage Tanks – Completed						
Dps Police Academy	285 Preston Ave.	Leaking Underground Storage Tanks – Completed						
Dr Mal Damisuk	111 Hillcrest Terrace	Leaking Underground Storage Tanks – Completed						
Dr. Hamp Pratt	108 Hillcrest Terrace	Leaking Underground Storage Tanks – Completed						
Dry Cleaners & Petrol Plus Gas Station (former Amoco)	885-889, 893, 903 & 927 East Main Street	Leaking Underground Storage Tanks – Rem. Started						
East Main Street Sunoco (former Dry Cleaners)	893 East Main Street To 903 East Main Street	Leaking Underground Storage Tanks – Rem. Started						
Esposito Automotive	394 West Main Street	Property Transfer – Form III Investigation started	9/27/2007					

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Eyelet Specialties	North Brown St.	Leaking Underground Storage Tanks – Completed						
E-z Mart (former Petro Plus)	271 East Main Street	Leaking Underground Storage Tanks – Rem. Started						
Fas Mart #314	1101 East Main Street	Voluntary Remediation: CGS 22a-133x						
Fas Mart #314 (former Db #917 And Ct Petroleum Marketers, Inc.)	1101 East Main Street	Leaking Underground Storage Tanks – Completed						
Food Bag (citgo)	561 West Main Street	Leaking Underground Storage Tanks – Rem. Started						
Former Gas Station	978 Broad Street	Leaking Underground Storage Tanks – Pending						
Former O'loughlin Property	137 Atkins St	Leaking Underground Storage Tanks – Completed						
Frank Davella, Owner	387 West Main St.	Leaking Underground Storage Tanks – Completed						
G.t Tires	155 Colony Street	Leaking Underground Storage Tanks – Completed						
Geer Residence	126 Atkins St	Leaking Underground Storage Tanks – Pending						
Getty Petroleum	213 Colony Street	Property Transfer – Form III Remediation Started			1/15/2013			
Getty Service Station #590	934 East Main Street	Leaking Underground Storage Tanks – Completed						
Giovanni Residence	56 Harness Drive	Leaking Underground Storage Tanks – Completed						
Gr Cummings Co.	198 - 210 State Street	Leaking Underground Storage Tanks – Investigation						
Guida's Dairy	1355 North Broad Street	Leaking Underground Storage Tanks – Completed						

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Guida-siebert Co. / City Of Meriden	1331-1355 North Broad Street	Property Transfer – Form III Remediation Complete	1/27/1999			1/28/2008	NO	
Gvo #683 (former Getty Station #6832)	407 West Main Street	Leaking Underground Storage Tanks – Rem. Started						
H. Comp Centers	328 Kensington Rd.	Leaking Underground Storage Tanks – Completed						
H.c.s. Enterprises, Llc	293 West Main Street	Leaking Underground Storage Tanks – Completed						
Hanover Towers	76 Butler Street	Leaking Underground Storage Tanks – Completed						
Hawthorne Reality (former Litterbug Inc.)	784 Old Colony Road	Leaking Underground Storage Tanks – Completed						
Henny Penny (formerly Vinnie's Auto)	2 Main Street	Leaking Underground Storage Tanks – Rem. Started						
Henny-penney Gasoline Service Station (bob's Garage)	446 North Colony Street	Leaking Underground Storage Tanks – Rem. Started						
Horace C. Wilcox Technical High School	298 Oregon Road	Leaking Underground Storage Tanks – Completed						
Insilco	160 Corporate Court	Property Transfer – Form III Investigation started	2/10/2011					
Insilco	550 Research Parkway	Property Transfer – Form III Investigation started	2/10/2011					
Insilco Corp.	500 South Broad Street	Inventory of Hazardous Waste Disposal Sites						
Insilco Corp.	500 South Broad Street	Property Transfer – Form III Investigation started	10/30/2001					
Insilco Corp.	550/590 Research Parkway	Property Transfer – Form III						
International Silver Company, Factory H	104 Butler Street	Voluntary Remediation: CGS 22a.-133x Remediation Started	12/20/2011	5/3/2012				

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
International Silver Company, Factory H	77 Cooper Street	Voluntary Remediation: CGS 22a.-133x Remediation Started	12/20/2011	5/3/2012				
Intersection Of W. Main & Centennial	Intersection Of W. Main & Centennial	Leaking Underground Storage Tanks – Pending						
J. B. Coggins Co.	5 Cross Street	Inventory of Hazardous Waste Disposal Sites						
Jbcm Co. (j. B. Coggins Co.)	5-31 Cross Street	Property Transfer – Form III						
Joanel Labs	551 Center St.	Leaking Underground Storage Tanks – Completed						
Joe Giannetti	71 Pratt St	Leaking Underground Storage Tanks – Completed						
John Barry School	Unknown	Leaking Underground Storage Tanks – Completed						
Kenneth Hall	436 Preston Ave	Leaking Underground Storage Tanks – Completed						
Kings Cleaners & Laundry Center	326 Center Street / 142-144 Camp Street	Property Transfer – Form III Investigation started	5/30/1997					
Kogut Florist & Garden Center, Inc.	50 Yale Avenue	Leaking Underground Storage Tanks – Completed						
Kwik Mart	80 Cook Ave.	Leaking Underground Storage Tanks – Rem. Started						
Litterbug, Inc.	784 Old Colony Road	Property Transfer – Form III Investigation started	1/5/2011					
Lockhart Residence	48 Laurel Heights	Leaking Underground Storage Tanks – Pending						
Malerba Service Station	155 Colony Street	Leaking Underground Storage Tanks – Completed						
Marian Rogus (home Owner)	58 Fremont St	Leaking Underground Storage Tanks – Completed						

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Meriden Auction Rooms	381 East Main Street	Leaking Underground Storage Tanks – Completed						
Meriden Enterprise Center	289 & 290 Pratt Street	Property Transfer – Form III Remediation Started	5/28/2004	5/16/2006				
Meriden Hub	1 & 77 State Street & 30 & 50 East Main St	Voluntary Remediation: CGS 22a.-133x Remediation Started	8/1/2008	6/29/2012				
Meriden Maintenance Facility	239 Miller Avenue	Leaking Underground Storage Tanks – Pending						
Meriden Markhem Airport	213 Evansville Road	Leaking Underground Storage Tanks – Investigation						
Meriden Public Schools	164 Centennial Avenue	Leaking Underground Storage Tanks – Rem. Started						
Meriden Senior Center	22 West Main St.	Leaking Underground Storage Tanks – Investigation						
Meriden Sunoco	357 West Main Street - 363 West Main Street	Leaking Underground Storage Tanks – Investigation						
Mike Rich 0110316-537-47258 Phone	70 Holiday Hill	Leaking Underground Storage Tanks – Completed						
Miller Brothers Site	476 Pratt Street	Property Transfer – Form III Remediation Started	5/18/2010	7/25/2012				
Miller Co.	99 Center St.	Leaking Underground Storage Tanks – Completed						
Miller Company	99 Center Street	Property Transfer – Form III Remediation Started	1/9/2004	7/20/2012				
Mobil Retail Station #10750 (#06-f9v)	954 East Main Street	Leaking Underground Storage Tanks – Completed						
Mobil Service Station 10705 (01-ewn)	954 East Main Street	Property Transfer – Form III Investigation started	3/17/2011					
Mobil Station (ferrigno Property)	133 Capitol Ave	Leaking Underground Storage Tanks – Completed						

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Mrm Industries, Inc.	508 North Colony Street	Property Transfer – Form III					YES	
Mrm Industries, Inc.	508 North Colony Street	Property Transfer – Form III						
Mulcahy Complex	294 Colony Road	Leaking Underground Storage Tanks – Rem. Started						
Napier Co. / Victoria	74 Cambridge Street	Property Transfer – Form III Investigation started	6/9/1999					
Napier Co. / Victoria	74 Cambridge Street	Property Transfer – Form III Investigation started	10/11/2000					
Napier Co. / Victoria	74 Cambridge Street	Property Transfer – Form III Remediation Complete	3/3/2003			2/15/2007	YES	No Residential Use, Inaccessible Soil, Environmentally Isolated Soil
Nieghbors To Sikorski Residence	132 Converse St.	Leaking Underground Storage Tanks – Pending						
North End Auto Parts	963 North Colony Road	Leaking Underground Storage Tanks – Completed						
Northeast Electrical Testing, Inc.	450 Murdock Avenue	Property Transfer – Form IV Remediation Started	4/16/2003	4/16/2003				
Office Complex	95 East Main St.	Leaking Underground Storage Tanks – Completed						
Orum Silver Company	51 South Vine Street	Property Transfer – Form III Remediation Started	4/27/2009	10/25/2012				
Paint By Wayne	1781 & 1801-1803 Broad Street	Property Transfer – Form III Investigation started	5/23/1996					
Paint By Wayne	1781-1801 North Broad Street	Property Transfer – Form III Investigation started	12/3/1999					
Paul Gullo #067092 (former Getty Service Station)	213 Colony Street	Leaking Underground Storage Tanks – Rem. Started						
Petrol Plus	1015 Broad St.	Leaking Underground Storage Tanks – Completed						

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Phillips Property	North Colony Road & Hicks Avenue	CERCLIS						
Phillips Property	Sw Corner North Colony Road And Hicks Road	Inventory of Hazardous Waste Disposal Sites						
Platt High School	220 Coe Avenue	Leaking Underground Storage Tanks – Completed						
Pratt Associates	290 Pratt Street	Leaking Underground Storage Tanks – Completed						
Production Equipment Co.	401 Liberty St.	Leaking Underground Storage Tanks – Completed						
Pyramid Technologies, Inc.	48 Elm Street	Property Transfer – Form III Investigation started	1/29/2009					
Quality Quick Lube	510 Broad St.	Leaking Underground Storage Tanks – Completed						
Quinlan Russell (j.b. Coggins)		Haz Waste Land Disposal Notifiers						
Radio Frequency Systems, Inc.	200 Pond View Drive	Property Transfer – Form III Investigation started	6/8/2012					
Robert Preet	444 North Colony Street	Leaking Underground Storage Tanks – Completed						
Roger Sherman School	Liberty St.	Leaking Underground Storage Tanks – Completed						
Safe T Tank Corporation	25 Powers Drive	Property Transfer – Form III Investigation started	10/14/2005					
Saint Johnsbury Trucking Company	1550 North Colony Road	Leaking Underground Storage Tanks – Investigation						
Salmandra Properties	328 Paddock St.	Leaking Underground Storage Tanks – Completed						
Salvation Army	23 St.casimer St Salvation Army	Leaking Underground Storage Tanks – Completed						

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Schiller	29 Carpenter Hights	Leaking Underground Storage Tanks – Completed						
Shell Facility #100051	934 Broad Street	Property Transfer – Form III Investigation started	5/15/2007					
Sikorski Residence	135 Atkins St.	Leaking Underground Storage Tanks – Pending						
Silver City Association (former Body Shop)	34 High Street	Property Transfer – Form III Investigation started	5/2/2000					
Silver City Autobody	11 High Street	Property Transfer – Form III Investigation started	9/22/2004					
Silver City Tire	152-160 Colony Street	Property Transfer – Form III Investigation started	10/31/2012					
Silverhill Business Center (former Ymca)	500 South Broad Street	Leaking Underground Storage Tanks – Completed						
Snet	1441 North Colony Road	Property Transfer – Form III Remediation Started	9/23/2002	10/29/2010				
Sorber Property	158 Converse St.	Leaking Underground Storage Tanks – Pending						
Specialty Printing Associates, Llc	127 Pomeroy Avenue	Property Transfer – Form III Investigation started	7/8/2004					
Spencer	22 Greenway Pl	Leaking Underground Storage Tanks – Completed						
State Police Complex	Meriden Rd.	Leaking Underground Storage Tanks – Completed						
Stop & Shop Supermarket Co.	Parker Ave. & East Main St.	Leaking Underground Storage Tanks – Completed						
Three Guys Marketing Llc	55 Newton Street	Leaking Underground Storage Tanks – Pending						
Ti Group Automotive Systems	45 & 48 Gracey Avenue	Property Transfer – Form III Investigation started	1/12/2009					

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Ti Group Automotive Systems, Llc	508 & 580 North Colony Street	Property Transfer – Form III						
Tom's Service Center	256 Broad St.	Leaking Underground Storage Tanks – Completed						
Tucker Mechanical Division Of J.c. Higgins Corp.	355-367 Research Parkway	Property Transfer – Form III Investigation started	9/27/2012					
United Oil Recovery Inc.	136 - 140 Gracey Avenue	Property Transfer – Form III Investigation started	5/27/2011					
United Oil Recovery Inc.	136-140 Gracey Avenue	Property Transfer – Form III Investigation started	5/27/2011					
Unknown	134 Glenhill Rd	Leaking Underground Storage Tanks – Completed						
Unknown	231 West Main Street	Leaking Underground Storage Tanks – Completed						
Unknown	Lewis & Springdale Aves.	Leaking Underground Storage Tanks – Completed						
Valerio Albarello	41 Parker Ave	Leaking Underground Storage Tanks – Completed						
Valerio Albarello, Inc.	41 Parker Avenue	Property Transfer – Form III Investigation started	2/22/2008					
Valerio Albarello, Inc.	41-45 Parker Avenue	Property Transfer – Form III Investigation started	7/21/1998					
Veterns Memorial Medical Center	Lewis Ave Across From Meridan Square	Leaking Underground Storage Tanks – Rem. Started						
Vinnie's Sunoco	2 Main Street	Property Transfer – Form III						
Wayne Grant	100 Myren St	Leaking Underground Storage Tanks – Completed						
Westfield Care And Rehabilitation Center	65 Westfield Rd.	Leaking Underground Storage Tanks – Completed						

List of Contaminated or Potentially Contaminated Sites

“Hazardous Waste Facilities” as defined by Section 22a-134f of the Connecticut General Statutes

TOWN OF: MERIDEN

<u>Name</u>	<u>Address</u>	<u>Site Definition</u>	<u>Investigation Started</u>	<u>Remediation Started</u>	<u>Post Remedial Monitoring Started</u>	<u>Remediation Completed</u>	<u>ELUR</u>	<u>ELUR Type</u>
Westvaco Corporation	119 & 129 Empire Avenue	Property Transfer – Form III Investigation started	1/29/1996					
Westvaco Corporation	Empire Avenue	Inventory of Hazardous Waste Disposal Sites						
Weyerhaeuser Company	119 Empire Avenue	Property Transfer – Form III Investigation started	11/14/2001					
Yellow Cab Co.	877 North Colony Rd.	Leaking Underground Storage Tanks – Completed						
Zebs Auto Upholstery (former Meriden Motors)	1821 North Broad St.	Leaking Underground Storage Tanks – Completed						



Appendix D: List of Significant Environmental Hazards Reported to the CTDEEP

List of Significant Environmental Hazards Reported to the DEP*Period covering 8/01/2002 through 2/28/2014***Ashford**

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 70 Perry Hill Road	8/21/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP discussed with the environmental consultant additional sampling data obtained for nearby threatened wells that shows there was no pollution in the wells. DEP requested that the data be submitted for detailed review.	No specific abatement action necessary.

Avon

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Avon Municipal Landfill 281 Huckleberry Hill Road	7/5/2007	Pollution was detected in a supply well but is below standards.	DEP directed the town to identify wells within 500 feet and continue to conduct an already approved landfill monitoring program.	Sampled residential wells and installed new monitoring well for landfill. Monitoring program continuing.
Mobil Service Station No. 01-363 411 West Main Street	6/9/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	The DEP directed the property owner to confirm if a neighboring supply well exists and, if so, sample the well for constituents of concern.	Access to the threatened well was not granted; sampling not done. In 2013 DEEP sampled the threatened well and no contaminants of concern were detected. Owner is conducting site investigation and remediation under the property transfer program.
Village Cleaners & Tailors 183 West Main Street	11/22/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well, identify supply wells within 500 feet, and sample any identified wells for pollutants detected at the site.	Five wells identified within 500 feet but they are upgradient and not at risk. Volatile organic compounds not detected in on-site drinking water supply well. Site is undergoing investigation and remediation under Property Transfer Program.

Barkhamsted

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Hitchcock Chair Company (Plant 2) 13 Riverton Road	7/26/2007	Petroleum above the groundwater protection criteria threatens a supply well.	DEP directed the property owner to submit a post-remedial monitoring report to document impact is not migrating off-site.	Removed impacted soil, monitoring 20 wells semi-annually for natural attenuation of petroleum hydrocarbons.
Lightstat Inc. 22 West Hill Road	5/8/2012	Pollution was detected in a drinking water well but is below standards.	DEEP directed the property owner to maintain an existing filter system and to monitor groundwater.	Owner is maintaining a filter system on the impacted well.
Lombard Ford 385 New Hartford Road	10/7/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby supply wells.	Majority of soil already removed; groundwater monitoring indicates no contaminants of concern.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Barkhamsted

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
S & S Holding, LLC 404 New Hartford Road	1/14/2010	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to expand their inventory of water supply wells to a radius of 1000 ft and to continue to sample identified potable supply wells.	Potable supply wells continue to be monitored with no contaminants detected

Berlin

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Best Cleaners 138 Mill Street	1/23/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP required additional sampling of a nearby identified well and identification of any other drinking water wells within 500 feet of the site.	A receptor survey was conducted and one well was identified. This well has been sampled five times in the past six years and no target analytes have been detected. Investigation has been completed and remediation is on-going at the site.
EIS Brake Parts (former) 129 Worthington Ridge	3/4/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet from the site for pollutants detected at the site.	11 potable wells were identified and 8 of them were sampled. Pollution was either not detected or detected but below standards. Monitoring program was implemented. Site issues will be addressed under Property Transfer Program.
Northeast Utilities - Berlin Campus Settling Basin 107 Selden Street	10/1/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to submit a plan to identify the extent of polluted soil and to remove the polluted soil.	Warning signs were posted and fence was installed to limit the potential contact with polluted soil. Remediation of the impacted soil is overseen by the DEEP's PCB Unit.

Bethany

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Chemtura - Bethany Agriculture R & D Facility 74 Amity Road	9/4/2007	Pollution was detected in a supply well (not used for drinking) above standards, and in another supply well below standards.	The property owner provided a survey of wells in the vicinity with the notification. DEP directed the property owner to provide additional technical information, and a work plan to sample a subset of wells identified in the vicinity of the site.	All on-site wells were resampled, including supply wells, and no chemicals of concern were detected above drinking water standards. Given this additional info, DEP concluded that it would not be necessary to sample off-site water supply wells.
Pleasant View Garage 119-127 Amity Road	5/26/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the identified nearby wells for pollutants detected at the site.	Source of pollution removed, and monitoring data shows affected wells are significantly below standards. No additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Bethany

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence 166 Humiston Drive	12/13/2012	Pollution was detected in a drinking water well above standards.	DEEP has been notified by the current owner that the property is unoccupied. Prior to reoccupation, provisions should be made to retest and provide filtration or an alternative source of water as needed to prevent exposure to identified pollution.	166 Humiston and surrounding properties sampled for volatile organic chemicals. All wells were non-detect for the pollutant that triggered Hazard Notification.

Bethel

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
88 Plumtrees 88 Plumtrees Road	6/7/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	On-site and six (6) abutting potable wells analyzed for volatile organic chemicals (VOCs). None of the samples had detectable concentrations of VOCs. Additional sampling pending.
Blackstone Industries Inc. 16 Stony Hill Road	5/12/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the two on-site supply wells and to sample the nearest, identified wells surrounding the site for pollutants detected at the site.	Source of pollution removed. 7 wells identified and 7 wells sampled; pollution not detected. On-site groundwater monitoring program implemented.
Mountain Laurel Plaza 66-68 Stony Hill Road	6/8/2006	Pollution was detected in a drinking water well but is below standards; pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample both on-site supply wells and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Two on-site and off-site water supply wells identified. Pollution was not detected in two on-site and one off-site well tested. Monitoring program implemented.
Parcel 82 Stony Hill Road	2/16/2007	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to re-sample the onsite supply well and the monitoring well at the septic system for pollutants detected at the site.	Property vacant. On-site well abandoned. No additional abatement action necessary.

Bethlehem

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 135 & 147 Main Street South	5/5/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the monitoring well and to sample the on-site well for pollutants detected at the site.	All wells sampled, pollution not detected or detected significantly below standards. No additional hazard abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Bloomfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Office location of The Hartford 1 Griffin Road South	11/20/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to submit a drinking water well receptor survey with a parcel map identifying drinking water supply wells; and also determine if dieldrin in groundwater is coming from an upgradient source.	Drinking water well receptor survey submitted on 2/2/10 and no threatened wells were identified. No further action necessary.
Residential Property 452 Tunxis Avenue Extension	10/26/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the owner to identify and sample wells within 500 ft and continue to monitor the onsite supply well and monitoring wells quarterly until pollution meets standards.	Impacted soil removed, passive venting system installed and monitoring wells continue to be monitored.

Bolton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Bolton High School 72 Brandy Street	5/4/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Four wells sampled, pollution not detected. Continuing monitoring program to be implemented.
Mike's Citgo 1135 Boston Turnpike	6/3/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	On-site well tested and non-detect for the pollutants at the site. Four nearby wells continue to be evaluated by DEEP.
Mobil Station # 10172 (01-F9V) 129 Boston Turnpike	5/26/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and identified wells within 500 feet for pollutants detected at the site.	Six wells sampled. Pollution not detected or significantly below standards. Monitoring program implemented. No additional abatement action necessary.
Precision Landscaping 280 West Street	2/21/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Wells identified and sampled, pollution either not detected or detected but below standards.

Bozrah

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Mimmo's Service Center 421 Salem Turnpike	10/18/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Three wells identified and sampled, pollution either not detected or detected but below standards. DEEP evaluating results to determine next steps.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Branford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Branford Landfill Tabor Drive	5/6/2003	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not actually discharge to the nearby surface water. The pollution does not in fact threaten aquatic life.	No specific hazard abatement action necessary. Monitoring to continue pursuant to Landfill requirements.
Shoreline Trailer Court Mobile Home 509-545 East Main Street	10/19/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP determined that remediation already in progress will address the hazard.	Site has been remediated pursuant to an engineered control that effectively eliminates direct contact with pollutants. No additional hazard abatement action necessary.

Bridgeport

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Black Rock Ship Yard (former) 10 Brewster Street	11/14/2005	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the owner to arrange for the prospective purchaser to include evaluation of the threat to surface water and aquatic life in planned investigation and remedial activity.	Prospective purchaser backed out, property is still vacant. Groundwater threat to surface water evaluated by DEEP for site specific conditions and determined to not significantly impact surface water and aquatic life.
BP Service Station # 5089 (former) 3956 Main Street	4/3/2003	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP's Leaking Underground Tank Program is working with the property owner to investigate the site. DEP initiated an investigation of soil vapor beneath the building.	Sampling of indoor air quality shows that air pollution is not at levels that pose a significant risk. DEP letter (4/7/06) requested active groundwater remediation.
Braxton Mens Shop 1168 Stratford Avenue	2/2/2004	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary.
Colombus Elementary School 275 George Street	9/7/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	Property owner proposed to cover polluted soil with filter fabric and clean fill to limit exposure risk as a temporary measure. DEP directed the property owner to proceed with the proposed action and provide a report of actions taken at the site.	Covered polluted soil with filter fabric and 6 inches of clean fill as interim measure. City plans to submit plan for final remedy to EPA for review and approval in October 2010.
Conco Medical 380 Horace Street	8/21/2002	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that access to the site and polluted soils is restricted, limiting the potential for contact. DEP requested that all persons with access be made aware of the condition.	Access to polluted soil is restricted; no specific hazard abatement action necessary.
General Electric Company 1285 Boston Avenue	8/20/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the site is secure, limiting the potential for contact.	Access to polluted soil is restricted; no specific hazard abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Bridgeport

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
General Electric Company 1285 Boston Avenue	1/25/2007	Pollution detected in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the site is secure, limiting the potential for contact.	Access to polluted soil is restricted; no specific hazard abatement action is necessary for polluted soil.
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to evaluate the threat to surface water, aquatic life, and sediment quality.	Remediation pending for impacts to surface water body.
General Electric Company 1285 Boston Avenue	7/29/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the site is secure, limiting the potential for contact.	Access to polluted soil is restricted; no specific hazard abatement action is necessary for polluted soil.
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to evaluate the threat to surface water, aquatic life, and sediment quality.	Remediation pending for impacts to surface water body.
Hoffman Fuel Company of Bridgeport 156 East Washington Avenue	1/5/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure and post warning signs to limit unknowing access to the polluted soil until the site is cleaned up.	Access is restricted, site-wide remediation pending under Property Transfer Program.
Metro North station 2289+42	9/19/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soils are on a fenced active railroad line, limiting the potential for contact.	Warning signs will be posted and soil will be properly managed if disturbed by construction.
Post Office Arcade Mall 991-1019 Main Street	6/25/2007	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary.
Remington Arms Company, Inc. (former) 939 Barnum Avenue	1/16/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence or secure the area to limit access to the polluted soil.	Warning signs posted, site secured and fence installed to limit the potential for contact with polluted soil.
Remington Arms Company, Inc. (former) 939 Barnum Avenue	2/5/2004	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to evaluate the nature, extent and degree of groundwater pollution to determine the threat to surface water and aquatic life near the site.	Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Bristol

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Bank of America 26 East Main Street (Forestville)	11/15/2005	Groundwater polluted with fuel oil above standards may threaten a drinking water well.	DEP directed the property owner to conduct a well receptor survey within 500 feet of the site and to sample any wells identified for petroleum compounds.	Well receptor survey was completed and no drinking water supply wells were identified. Additionally, monitoring wells were installed at the site and sampled, petroleum hydrocarbons were not detected. No further action is required.
Peabody Landscaping 53 Mines Road	10/18/2004	Pollution detected in groundwater above standards may threaten a drinking water well. Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to sample identified nearby wells for pollutants detected at the site. DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	Wells identified and sampled. Laboratory analytical results indicated no site related pollutants detected in the supply wells. No specific hazard abatement action necessary for indoor air quality.
Pump Station 13 Julia Road	12/1/2004	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data and determined the reported pollution was not confirmed. DEP directed the property owner to sample the potentially affected wells monthly for pollutants detected at the site, and provide bottled water if needed.	Monitoring program implemented.
Yankee Gas Service Company Riverside Avenue	5/9/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area, limiting the potential for contact.	Polluted soil subsequently removed from site. No additional abatement action necessary.

Brookfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
A. J. Tuck Company 32 Tuck Road	1/3/2007	Pollution was detected in two drinking water wells but is below standards.	DEP directed the property owner to sample the on-site supply well and an off-site supply well (at 34 Tuck Rd) on a quarterly basis and to identify wells up to 500 feet away from the site.	All wells within 500 feet sampled, and pollution was either not detected or was detected but below standards. Monitoring program implemented.
Avon Auto & Equipment 303 Federal Road	6/29/2004	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data for the well and determined that pollution is not in fact present, and water is safe for human consumption.	No additional hazard abatement action necessary.
Brookfield Square 270 Federal Road	11/30/2004	Pollution was detected in a drinking water well but is below standards.	DEP is sampling adjacent wells and directed the property owner to identify wells up to 500 feet away from the site for pollutants detected at the site, and to recommend further actions.	Five of five wells sampled. Pollution was not detected or was detected significantly below standards. No additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Brookfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Elmbrook Plaza 632 & 640 Federal Road	5/9/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	7 wells identified and 7 wells sampled. Pollution not detected. No additional hazard abatement action necessary.
Greentree Toyota (former) 465 Federal Road	4/27/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the on-site and nearby identified wells within 500 feet for pollutants detected at the site.	All wells sampled, pollution either not detected or detected but below standards. No additional hazard abatement action necessary. Investigation and remediation on-going at site.
Kimchuk (former) 34 Del Mar Drive	5/20/2005	Pollution was detected in a drinking water well above standards.	DEP required no action, because there is already a treatment filter on the supply well and nearby locations also have alternate supplies of potable water.	Area potable supply wells sampled. All pollution detected was below criteria or being treated. Public water supply expanded to cover the affected area.
Mobil Station #11350 (01-280) 83 Federal Road	5/20/2010	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite well and identified private wells for pollutants detected at the site.	Eight wells identified. Four wells regulated by Dept. of Public Health. Other four wells sampled. Pollution either not detected or detected below standards. Monitoring program for supply wells implemented.
Rapid Power Technologies 18 Old Grays Bridge Road	2/14/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 1000 feet away from the site for pollutants detected at the site.	No wells within 500 feet. Six wells within 1,000 feet were sampled. Pollution was not detected. Two wells sampled quarterly as required by Department of Public Health. Source of pollution removed. No additional hazard abatement action necessary.
Rapid Power Technologies (former) 58 Old Grays Bridge Road	12/29/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, and install a fence and secure the area to limit access to the polluted soil until the site is cleaned up.	Warning signs posted. Temporary fence installed. Site secured. Personnel informed. Further actions pending.
Rapid Power Technologies (former) 58 Old Grays Bridge Road	4/3/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, install a fence to limit access to the polluted soil until the site is cleaned up, and to submit a plan to eliminate the risk to human health.	Warning signs posted. Temporary fence installed. Site secured. Personnel informed. Further actions pending.
Residential Property 5 Hidden Brook Drive	12/28/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed sampling data. Pollution in the drinking water well was not detected. DEP directed the property owner to proceed with removal of polluted soils, re-test the drinking water well, and report soil and groundwater post-remediation results.	Polluted soil removed. Pollution not detected in water supply well on-site. Additional abatement activities completed for site. Results pending.

Brookfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Shell Facility #100058 138 Federal Road	12/2/2011	Pollution was detected in drinking water wells, with some above standards and some below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the threatened wells for the pollutants detected at the site.	7 wells identified and 1 (on-site) well sampled. Pollution either not detected or detected below standards. 1 well owner denied access. 1 well is upgradient. Pollution not detected in 4 other wells. Monitoring program implemented for on-site well.
Shell Facility #136291 49 Federal Road	1/10/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	All wells have been sampled with varying levels of pollution detected. The property owner, under consent order with DEP, has implemented a program to monitor impacted wells and maintain filter systems.
Shell Facility #136291 (former) 49 Federal Road	7/7/2009	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide an alternate supply of potable water for polluted on-site water supply well and to continue monitoring this well on a quarterly basis.	On-site well sampled; pollution detected but below action levels. Monitoring program implemented.
Ship Shape Cleaners (Former) 106 Federal Road	1/8/2013	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEEP reviewed information provided and directed the property owner to continue with planned vapor mitigation and monitoring and groundwater treatment and monitoring.	Source of pollution remediated. Vent system installed to prevent impact on indoor air quality. Monitoring program implemented for groundwater and soil vapor.
Shopping Plaza 106 Federal Road	5/8/2008	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample the on-site water supply well and two nearby water supply wells on a quarterly basis for the pollutants detected at the site.	Building demolished in 2011. Source of pollution removed. Water supply wells abandoned and affected sites connected to public water in early 2012. No additional abatement actions necessary.
Shopping Plaza 106 Federal Road	5/30/2006	Pollution was detected in a drinking water well above standards. Polluted groundwater and soil beneath an occupied building could affect indoor air quality.	DEP reviewed information provided and determined the affected well already has a monitored treatment system. DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action.	Building demolished in 2011, eliminating risk to indoor air. Source of pollution removed. Water supply wells abandoned and affected sites connected to public water in early 2012. No additional abatement actions necessary.
ShopRite Plaza 143 Federal Road	8/30/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample identified wells within 500 feet for pollutants detected at the site.	8 wells within 500 ft. 2 public wells monitored by DPH. Pollution detected in 2 supply wells below action level. Filter systems installed. 4 other private wells tested; pollution not detected. Monitoring program for groundwater and supply wells.
Sunland Marine 419 Federal Road	8/21/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby wells for pollutants detected at the site.	On-site supply well and four monitoring wells sampled. Pollution not detected. No additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Brookfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Texaco Facility #100058 138 Federal Road	1/10/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	7 wells identified and 1 (on-site) well sampled. Pollution either not detected or detected below standards. 1 well owner denied access. 1 well is upgradient. Pollution not detected in 4 other wells. Monitoring program implemented for on-site well.
Wentworth Laboratories 500 Federal Road	9/26/2008	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to re-sample the onsite supply well and identify wells up to 500 feet away from the site.	Drinking water well re-sampled and inventory of supply wells conducted. Re-sampling of well confirmed low level of Barium, significantly below standards. No additional sampling necessary for hazard evaluation or abatement.

Brooklyn

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Eggs, Inc. Route 205 & Vina Lane	5/27/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Well potentially at risk is connected to public water; no other wells known to be at risk.
Saveway Petroleum 49 South Main Street	6/14/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample six nearby drinking water wells for volatile organic compounds and petroleum hydrocarbons.	## wells identified and # wells sampled, pollution either not detected or detected but below standards. [Monitoring program implemented.]

Burlington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Crescent Real Estate (Manufacturing) 700 George Washington Turnpike	6/22/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample monitoring wells for contaminants of concern.	Monitoring well did not contain contaminants of concern.

Canaan

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Falls Village Citgo, (PC#007710) Route 7 & Route 63 (Intersection)	3/30/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well on a quarterly basis until remediation of the site is complete and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Nearby wells tested and no pollution detected. Quarterly monitoring program on-going for on-site supply well, monitoring wells, and surface water. Dept. of Public Health also reviewing data.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Canaan

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Hitchcock Brothers, Inc. 78 High Street	2/21/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed potable water supply well sampling data. Pollution is not in fact present in the well and does not pose a risk to supply wells.	Monitoring data shows threatened well not affected. No additional hazard abatement action necessary.

Canterbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Willimantic Waste Paper Co. 133 Packer Road	5/27/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Consultant identified potable wells within 500 foot radius. Sampled 5 wells; one additional house appeared to be vacant and was not sampled. No contaminants detected.

Canton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Church of Jesus Christ of Latter-Day Saints 27 Lawton Road	5/22/2007	Explosion hazard exists due to the release of propane from a storage tank	DEP directed the property owner to continue to monitor threatened residential properties for volatilization and explosion risks.	Monitoring wells were sampled and levels within wells no longer exhibit explosion hazard. No additional hazard abatement action necessary.
Commercial Property 3 Albany Turnpike	10/11/2011	Pollution was detected in a drinking water well but is below standards.	DEEP requested confirmation resampling of the supply well and determination of the pollution source. If groundwater is the source DEEP requested an inventory of all drinking water wells within 500 feet.	Onsite underground tanks removed and onsite drinking water resampled and well was not contaminated
Mobil Service Station No. 01-QQD 306 Albany Turnpike	6/10/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample residential wells within 500 feet of the site for pollutants detected at the site.	Potable drinking water supply wells were sampled and did not contain any contaminants of concern
Residence 23 Lovely Street	5/9/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to conduct a receptor survey and continue to sample 21 and 23 Lovely Street for contaminants of concern.	Onsite and nearest downgradient drinking water supplies were sampled and did not contain pollutants associated with the hazard.
Station No. 17771 (Former) 306 Albany Turnpike	6/12/2012	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to conduct the work identified in the hazard notification.	Bottled water is being provided by responsible party.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Canton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Unknown Source Albany Turnpike/12 Dunham Road	4/15/2009	Pollution was detected in a drinking water well above standards. Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to provide bottled water to any future tenant at 198 Albany Turnpike / 12 Dunham Road. DEP indicated it will collect a confirmation sample to verify contaminant is present within the drinking supply well.	Impacted well tested twice; both times contaminants of concern were not detected.

Chaplin

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Chaplin Mobil 17 Willimantic Road	8/13/2008	Pollution detected in groundwater above standards may threaten nearby drinking water wells.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at site.	6 wells identified and 6 wells sampled, pollution either not detected or detected but below standards. No further monitoring necessary.
Fin Fur & Feather Club 213 Chewink Road	4/5/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened well quarterly for the pollutants detected at the site, and advise DEP of any changes, and provide a plan to abate the hazard.	Treatment system installed at downgradient property. Abatement plans implemented. No further action necessary.

Cheshire

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Cheshire BP 901 West Main Street	7/29/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and identified wells within 1000 feet for pollutants detected at the site.	Three drinking water supply wells were identified as being within 1,000 feet of the site. All samples were reported as below laboratory detection limits.
Cheshire Landfill Waterbury Road (Route 70)	5/23/2005	Pollution was detected in a drinking water well but is below standards.	DEP required continued sampling of the well for pollutants detected at the site.	Monitoring to continue pursuant to Landfill requirements.
Cheshire Landfill Waterbury Road (Route 70)	12/3/2002	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample wells up to 100 feet from the site for pollutants detected at the site.	Additional sampling conducted, pollution below standards. Monitoring program implemented.
Cheshire Landfill Waterbury Road (Route 70)	11/28/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to continue an established monitoring program, and evaluate trends in the pollutant that was detected.	Monitoring to continue pursuant to Landfill requirements.
Cheshire Veterinary Hospital 1568-1572 South Main Street	9/29/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample potable wells identified up to 500 feet of the site for pollutants detected at the site.	Property owner has conducted an inventory of wells within 500 feet.

Cheshire

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence 485 Moss Frams Road	5/20/2008	Pollution was detected in a drinking water well but is below standards.	DEP directed the Town of Cheshire to continue an established monitoring program, and evaluate trends of the pollutant that was detected.	Potable well and monitoring wells at Cheshire landfill have been routinely monitored by the Town of Cheshire. MTBE was reported as non-detected in the potable well and less than applicable standards in landfill monitoring wells.
Residential Property 2298 Waterbury Road (aka 2289)	2/22/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	Wells identified and sampled. No pollutants associated with this notification detected above standards.

Chester

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 62 Spring Street	4/5/2005	Pollution by fuel oil was detected in a shallow drinking water well.	DEP reviewed actions taken and determined they adequately addressed the pollution problem.	A new drinking water well had already been installed in an area not affected by the pollution. No additional hazard abatement action necessary.
Roli Enterprises LLC 20 Denlar Drive	1/29/2004	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	Building currently vacant. No specific hazard abatement action necessary. DEP recommended periodic monitoring of well.

Clinton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Richards Farm 71 Killingworth Turnpike	7/16/2012	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to provide bottled water to property with polluted wells. Town contacted owner of nearest residence and will sample drinking water well as soon as possible.	Property owner is providing bottled water to property and has posted signs directing persons using the property not to drink the water from the tap. Pollution is not migrating off-site; no the need to monitor off-site drinking water wells.

Colchester

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Columbia Cleaners (former) 67 Lebanon Avenue	11/15/2006	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to submit a plan to characterize the impact on indoor air quality and develop a remedy to limit the impact.	Proposal to determine extent of contamination and install sub-slab venting system is pending. Nearby drinking water supply wells identified and tested; no impact found. Investigation/remediation (if needed) to continue under Property Transfer Program.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Colchester

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 24 Comstock Bridge Road	10/27/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Four potable wells were identified downgradient of the site and were sampled twice and no pollutant was detected. The onsite potable well was installed with a filtration system and was monitored annually, as well as onsite monitoring wells.

Columbia

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Collins Garage 177 Route 66	6/10/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and sample nearby wells for pollutants detected at the site.	Nearby wells identified and sampled, pollution not detected. Monitoring program implemented and onsite remediation ongoing.
Residential property 66-68 Route 87	11/13/2013	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to check and remove any visible free product from the well, install a second carbon filter canister, and conduct periodic testing of the well for the pollutants present at the site.	On-site well remains impacted with fuel-oil. Neighboring wells tested and are not impacted by release. DEEP continues to work with property owners and their respective attorneys to address pollution abatement and drinking water issues.

Coventry

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
7-Eleven Store # 32520 2711 Boston Turnpike (Route 44)	10/23/2007	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Additional groundwater monitoring was conducted and nearby drinking water wells were tested; no problems were identified. No further monitoring is needed provided conditions do not change.
Coventry Landfill Route 31	5/27/2003	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not in fact significantly threaten aquatic life at the time it was reported.	No specific hazard abatement action necessary. Monitoring to continue pursuant to Landfill requirements.
Coventry Landfill Route 31	6/3/2004	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not in fact significantly threaten aquatic life at the time it was reported.	No specific hazard abatement action necessary. Monitoring to continue pursuant to Landfill requirements.
Coventry Pizza 1467 South Street	10/14/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	5 wells identified and the three closest downgradient wells sampled, pollution either not detected or detected but below standards. Semi-annual monitoring program implemented for two years. No further monitoring necessary.

Coventry

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence (Former Farm) 10 Grant Hill Road	2/26/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the identified wells within 500 feet to the west, south and east of the site for the pollutants present on the site.	Property owner sampled nearby drinking water wells. Contaminated soils excavated from source area. Steady state groundwater plume does not appear to pose risk to receptors. No drinking water wells are present within 500' downgradient of plume.

Cromwell

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Scheu Nursery (former) Geer & Woodside Streets (Intersection)	12/10/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined there was in fact no significant hazard risk for the current land use. DEP also directed the property owner to identify and sample wells within 500 feet for pollutants detected at the site.	Polluted soil was removed from the site during development; no additional hazard abatement action necessary. Drinking water wells were identified and sampled and no pollutants associated with the site were detected; no further monitoring required.
Shell Facility #136296 (former) 131 Berlin Road	8/15/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to resample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	A treatment system was installed on the affected well. No pollutants above standards were detected in the remaining drinking water supply wells along nearby Kirby Road.
Sunoco 164 West Street	11/10/2005	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened well quarterly for the pollutants detected at the site.	Site investigation was conducted and impacted soil was removed. On-site potable well was monitored between 2005 and 2008, and in 2013. Results were below laboratory detection limits. No other potable wells located with 500 feet of the site.

Danbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
345 Main Street LLC 345 Main Street	3/5/2008	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action, if necessary.	Vent system installed to prevent impact on indoor air quality. Monitoring program implemented including automatic alarms inside building.
Aberdeen property 11-27 East Franklin Street	4/4/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	As an interim measure, DEP directed the property owner to inform persons with potential for exposure, post warning signs and install a fence to limit access to the polluted soil until the site is cleaned up.	Polluted soil was removed; no additional hazard abatement action is necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Danbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Amphenol Corporation 33 East Franklin Street	3/18/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement and in a secure and fenced area, limiting the potential for contact.	Polluted soil removed. No further abatement action necessary.
CL&P Triangle 11A Substation Triangle Street	11/8/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Warning signs posted; site is secure fenced electrical substation limiting the potential for contact with polluted soil.
Colonial Ford Prep Center 93 Sand Pit Road	2/24/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to verify the existence of, and sample, nearby wells for pollutants detected at the site.	Two wells identified and sampled. One year monitoring program implemented. Pollution not detected or detected significantly below standards. No additional hazard abatement action necessary.
Commercial Property 32-34 Newtown Road	5/31/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the two identified downgradient wells for pollutants detected at the site and to provide an alternate supply of potable water/treatment for properties with polluted wells.	Both downgradient wells sampled, pollution either not detected or detected but below standards. Original detection found to be result of sewer line break. After repairs, pollution not detected in new well. No further abatement action required.
Emhart Technologies LLC, Heli-Coil Facility 4 Shelter Rock Lane	3/29/2012	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEEP directed the property owner to submit a plan to develop a remedy to limit the impact of pollution on indoor air quality and to conduct sensitive receptor survey to evaluate if any residences could be affected by the groundwater plume.	Installed vapor extraction system under affected building. Monitoring program implemented for groundwater and soil vapor.
Exxon RAS #3-5664 112 Federal Road	2/14/2003	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data and determined that pollution is below standards, and the water is safe for human consumption.	DEP reviewed information provided and determined that the two affected wells have been abandoned, eliminating the exposure risk, and that groundwater pollution does not significantly threaten aquatic life. No additional abatement action necessary.
Exxon Station (former) 112 Federal Road	2/28/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the off-site threatened well, unless arrangements have been made to connect the location to public water.	Property connected to public water and well properly abandoned. No additional hazard abatement action necessary.
John's Automotive Service Center 85 Mill Plain Road	4/22/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP required additional sampling of on-site water supply well for pollutants detected at the site.	On-site well sampled. Pollution not detected. Site connected to municipal water. On-site well not abandoned and used in monitoring program.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Danbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Mobil Service Station #01-GFO 112 Newtown Road	2/9/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the five nearest threatened wells and provide bottled water to occupants if results exceed standards.	Four of five water supply wells identified were sampled. One owner denied access. Gasoline constituents were not detected in any of the supply wells. No additional abatement action necessary.
Mobil Station # 11722 (01-DVC) 54 Padanaram Road	5/21/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the nearby identified wells within 500 feet for pollutants detected at the site.	2 of 3 nearby wells where owners allowed access were sampled. Pollution not detected. Groundwater conditions no longer present hazard condition. No additional abatement action necessary.
Noaro Property 24 Pond Crest Road	9/24/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data and determined that water in the well at risk remained potable and recommended periodic sampling of the well until remediation is complete.	Source of pollution removed. No additional hazard abatement action necessary.
Norbert E. Mitchell Co., Inc. 7 Federal Road	7/6/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to periodically sample the onsite well for pollutants detected at the site, until polluted soil on the site is remediated. (No other drinking water wells were identified within 500 feet of the site.)	One water supply well identified (on-site well) and sampled, pollution not detected. Semi-annual monitoring program implemented.
Residence 21 Hawthorne Cove Road	10/23/2012	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to continue to test the on-site water supply well quarterly for the pollutants detected at the site. DEEP will further evaluate testing at neighboring wells in conjunction with the local health department.	Source of pollution removed. Water treatment was installed on on-site supply well. Neighboring wells tested, where access granted, and pollution was not detected. Monitoring program implemented for on-site water supply well.
Residence 5 Timber Crest Drive	1/27/2009	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data for the affected well and determined pollution is not in fact present in the well. DEP directed the property owner to continue to sample the well and to advise DEP of any changes.	Well resampled, pollution not detected. Monitoring program implemented, pollution not detected. Impacted soil removed from tank grave. No additional abatement action necessary.
Residential Property 216 Westville Avenue Ext.	1/15/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data showing that the well at risk was not polluted.	Source of pollution removed. No additional hazard abatement action necessary. DEP recommended periodic sampling of the well.
Residential Property 11 Sturdevant Drive	9/21/2004	Pollution was detected in a drinking water well above standards.	DEP required additional sampling of on-site and nearby wells for pollutants detected at the site.	Source of pollution removed. Additional sampling found no detectable pollution. No additional hazard abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Danbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Texaco Facility #100061 3 Mountain View Road	10/15/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Twelve wells identified and ten wells sampled. Pollution not detected or significantly below standards. Source of pollution removed. No additional hazard abatement action necessary.

Darien

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Former Residence 155R Nearwater Lane	12/9/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed the information and determined that the reported condition does not represent a hazard because the results of the subsequent receptor survey indicate that there are no private drinking water supply wells within 500 feet of the property.	No additional abatement action necessary.
Residential Property 31 Hancock Lane	2/10/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample on-site and nearby wells for pollutants detected at the site.	At-risk supply wells sampled and no pollution detected. Groundwater remediation implemented. No additional hazard abatement action necessary.

Deep River

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Parcel 168 Main Street	11/10/2003	Pollution was detected in a drinking water well but is below standards.	DEP identified a responsible party and required provision of a safe supply of drinking water.	Water treatment system installed by responsible party at property with polluted well. No additional hazard abatement action necessary.

Derby

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
DoT property (former) Main Street	1/24/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to eliminate the risk to human health.	Polluted soil removed; no additional hazard abatement action necessary.

Durham

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Alliance Energy 24 Main Street	1/18/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the well on-site and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Alliance sampled on-site supply well and wells 500 feet away from the site for the pollution detected at the site. A treatment system was installed on one well documented above standards. Alliance will continue to monitor this system.

Durham

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Durham Firehouse 41-51 Main Street	9/10/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	The town identified one well within 500 feet of the site and sampled the well. No contamination related to the site was detected.
Grippe's Mobil 349 Main Street	1/26/2006	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Two potable wells were installed with filter systems. There are also two other gasoline stations nearby: former Shell Station and former Dairy Mart. Other potable wells were monitored by other two gasoline stations.
Residential Property 220 Main Street	8/29/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	Pollution source removed, surrounding residences within 500 feet were sampled for petroleum. No concentrations of petroleum were detected in excess of laboratory detection limits.
Shell Facility #136301 (former) 336 Main Street	7/7/2009	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten drinking water wells.	DEP required additional sampling of onsite and other three nearby identified wells for metals detected at the site.	A well receptor survey within a 500-foot radius of the site was conducted and four potable wells were identified. All four wells have been sampled regularly since 1995 and they are on water treatment system previously installed by DEP.

East Granby

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Airport 66 150 Rainbow Road	6/24/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to take actions identified in the notification, to remove impacted soil and groundwater from site during underground storage tank (UST) replacement activities	Underground tanks and impacted soil removed and groundwater remediation conducted. Monitoring wells sampled and downgradient wells did not contain contaminants of concern.
East Granby Citgo 2 School Street	4/28/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened wells for the pollutants detected at the site, and advise DEP of any changes. DEP also required the owner to continue to evaluate and characterize soil and groundwater impacts.	Onsite groundwater below action levels.

East Haddam

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
7-Eleven Store # 32526 4 Falls Road	7/29/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue routine sampling of the onsite supply well and to identify and sample wells up to 500 feet downgradient from the site for pollutants detected at the site.	On-site and downgradient wells were sampled and no volatile organic chemicals were detected. On-going monitoring of on-site drinking water well and groundwater monitoring wells will continue.
Residence 17 Plains Road [Moodus]	4/3/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	On-site and abuting drinking water wells sampled. Pollution was non-detect. Continued monitoring of drinking water well being performed by property owner.

East Hampton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Belltown Motors 80 East High Street	8/1/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and nearby identified wells within 500 feet for pollutants detected at the site.	Belltown Motors completed a receptor survey identifying 13 wells. Twelve of the thirteen were sampled. One resident refused. No chemicals associated with the site were detected in the drinking water samples.
CL&P East Hampton Service Center 22 East High Street	4/10/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the threatened wells for the pollutants detected at the site.	CL&P sampled the eight identified wells in May 2012 and the detected compounds were below standards. These wells were historically sampled by CL&P. CL&P will submit documents to demonstrate that plume is stable and risks to these wells are low.
Commercial Parcel 5 East High Street & 6 North Main Street	8/18/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	The potable wells identified were sampled for petroleum and it was not detected. Contaminated soils were excavated for offsite disposal. No further action is required.
Ghezzi Motors (former) 13 Watrous Street	8/26/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	On-site supply well was sampled and was non-detected. 13 offsite potable wells were identified and sampled. DEEP monitors 7 of them.
Parcel 103 Main Street	8/26/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Two nearby wells were sampled and target compounds were below standards.
Summit Thread Powerhouse (former) 13 Watrous Street	1/13/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	An engineered control was approved for the site to be a paved parking lot. Operation and maintenance of the engineered control is required.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

East Hampton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Water Tower Property Walnut Avenue	7/27/2006	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide an alternate supply of potable water for polluted wells and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	A well receptor survey was conducted in 2006. Sampling indicated exceedances of dieldrin. CTDEEP installed treatment systems at those properties that have exceedances.
West High Street Area West High Street	10/31/2005	Pollution was detected in a drinking water well above standards.	DEP directed DoT to resample all wells that reported elevated concentrations, above standards, of arsenic or lead.	DoT resampled the wells that had detected arsenic and lead, and bottled water was provided at the locations where these pollutants were above standards.

East Hartford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Pratt and Whitney 400 Main Street	10/31/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed the information and determined that the conditions were similar to those in a previous notification, and were addressed by actions taken under that notification.	No specific additional abatement action was required; condition being addressed by site-wide RCRA corrective action.
Pratt and Whitney Willgoos Turbine Laboratory Pent Road	10/31/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to maintain existing fencing that prevents access to polluted soil and to implement remediation following complete site assessment.	Fence was constructed to prevent access to polluted soil and warning signs were posted; remediation will occur following site assessment.
Pratt and Whitney 400 Main Street	12/29/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to maintain fencing and restrict access until the impacted soil is remediated.	Site is in a remedial program and impacted soil will be removed following completion of site investigation. Access to impacted soil is restricted by fencing.
Residence 79 Shawnee Road	1/8/2008	Polluted groundwater near an occupied building could affect indoor air quality.	DEP directed the property owner to conduct a soil gas study to determine if polluted groundwater poses a risk to indoor air quality.	Soil vapor was collected and testing did not detect contaminants that would adversely affect indoor air quality.

East Haven

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Cinque Industrial Park 509 Laurel Street	11/6/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to identify the extent of polluted soil, notify site occupants, and limit access to the polluted soil.	Property owner submitted plan for investigation.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

East Lyme

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
York Correctional Institution 201 West Main Street	7/11/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed sampling data and determined a hazard condition does not currently exist based on the data collected from nearby groundwater monitoring wells and the distance from the source area to the supply wells.	No specific hazard abatement action necessary.

East Windsor

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Golden Gavel Auction House 149 North Road	2/3/2005	Pollution was detected in a drinking water well above standards, and other pollution detected in groundwater above standards may threaten this drinking water well.	DEP directed the property owner to provide bottled water as an alternate supply of potable water until resampling confirms the origin of the pollution reported.	Origin of Lead pollution determined to be from piping in residential property not groundwater. No additional hazard abatement action necessary since no actionable pollution condition.
Mobil Service Station #01-E53 (former) 276 Main Street	12/6/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue with current plans for site investigation and remediation, and to sample nearby residential wells for the contaminants of concern.	Receptor survey conducted and drinking water supply wells surrounding subject property were sampled and were below the detection limit for the contaminants of concern.
Mobil Service Station #01-GAQ 157 North Road	9/14/2005	Pollution was detected in a drinking water well but is below standards, and pollution detected in groundwater above standards may threaten drinking water wells.	DEP directed the property owner to sample the polluted well quarterly for pollutants detected at the site, and sample identified downgradient wells.	Where access was granted the supply wells surrounding the subject property were sampled and were below the detection limit for the contaminants of concern. Continued to sample on-site well quarterly.

Easton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence 220 Banks Road	6/29/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP is working with the property owner to investigate the extent of the pollution and to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Source of pollution removed to the extent possible, monitoring program implemented.
Residence 427 Center Road	11/7/2011	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to resample the onsite well for pollutants detected at the site and continue to use bottled water, and also recommended changing the filter in an installed treatment system.	Monitoring data shows threatened wells not affected and source of pollution was removed. No additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Easton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 78 Mile Common	10/14/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	Source of pollution removed. The well water supply has been determined potable. No other wells within 500 feet of release area.

Ellington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
CRRA Ellington Landfill Sadds Mill Road (Route 140)	9/15/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue to sample the threatened well and report results to DEP.	No specific hazard abatement action necessary; threatened well already monitored regularly and pollution not detected. Monitoring of well is ongoing under Landfill requirements.
O.J. Thrall, Inc. 78 Abbott Road	11/14/2011	Pollution was detected in a monitoring water well but is below standards.	DEEP directed the property owner to conduct the action described in the significant environmental hazard report. Once the supply well is reactivated it will be resampled. If still impacted a mitigation plan will be implemented.	The supply well is currently not in use.
Residential Property 132 Mountain Street	11/18/2009	Pollution was detected in a drinking water well above standards; pollution was detected in a drinking water well but is below standards; and pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide bottled water to impacted properties, continue quarterly monitoring of drinking water supply wells, expand receptor survey and generate a remedial plan to cleanup remaining impacted soil.	All residential wells sampled and were non-detect for petroleum hydrocarbons. Remediation conducted to remove onsite underground oil tank.

Enfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
CT DoC Enfield Small Arms Range North side of Sandhill Road	7/15/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to eliminate the risk to human health.	Impacted soil excavated and disposed off-site. No additional hazard abatement action necessary.
D & K Holdings Co., LLC 114 Broad Brook Road	11/12/2003	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample wells up to 1000 feet from the site for pollutants present at the site.	DEP installs treatment systems at wells if found to be polluted above standards. DEP Consent Order with Town provides for subsequent connection of impacted and threatened homes to public water.
D & K Holdings Co., LLC 114 Broad Brook Road	9/16/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	DEP installs treatment systems at wells if found to be polluted above standards. DEP Consent Order with Town provides for subsequent connection of impacted and threatened homes to public water.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Enfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Enrico Fermi High School 124 North Maple Street	4/4/2006	Pesticide pollution in the top two feet of soil may pose a risk to human health as a result of direct contact. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP acknowledged actions already taken adequately limit access to polluted soil, and requested further study to delineate the problem and develop a remedy, and also evaluate potential impact on groundwater.	Field capped with 6 to 12 inches of clean fill to prevent direct exposure to impacted soil, other grassed areas also covered with clean fill.
The Hanson-Whitney Company 116 Broad Brook Road	11/5/2003	Pollution was detected in a drinking water well above standards.	DEP recommended the continued use of bottled water. DEP indicated it is also currently evaluating reported pollution in this area.	Property now vacant with no water use. No additional hazard abatement action necessary. DEP investigation ongoing.

Essex

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Tuscarora Incorporated (former Verplex) 25 Middlesex Turnpike	3/3/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil had already been removed to a stockpile for off-site disposal. DEP directed the property owner to provide a report to DEP of the actions taken at the site.	Soil excavated from polluted area and stockpiled for disposal.

Fairfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Fairprene (former) 85 Mill Plain Road	8/27/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact. Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to delineate the extent of surface soil and groundwater exceeding applicable hazard thresholds and eliminate potential exposure pathways.	Site being remediated under Property Transfer Program.
Mercedes Benz of Fairfield 450 Scofield Avenue	9/27/2013	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is under pavement and in a secure and fenced area, limiting the potential for contact.	Access is restricted; no specific abatement action necessary.
Railroad Bridge North Benson Road	1/3/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a restricted-access rail corridor, limiting the potential for contact.	Access is restricted because site is in fenced rail corridor; no specific hazard abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Fairfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Tide Mill 2425 Post Road	1/29/2009	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary
Universal Thread Grinding Company 30 Chambers Street	8/26/2002	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to submit a plan to determine if indoor air quality is being affected and, if so, recommend a course of action.	Sampling of soil gas shows that pollution levels are below levels that pose a significant risk to indoor air. Additional remedial actions implemented. Groundwater and soil vapor monitoring program implemented.

Farmington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
College Highway Substation 201 Waterville Road	8/31/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access is restricted; no specific hazard abatement action necessary.
Commercial Property 232 Colt Highway (Route 6)	1/24/2005	Pollution was detected in a drinking water well but is below standards, and other pollution detected in groundwater above standards may also threaten this drinking water well.	DEP determined that no action is required because the well is the only well in the area, is currently unused, and the detected pollution in it is significantly less than the standard.	Well not in use; no specific hazard abatement action necessary. DEP recommended retesting the well when it is again in service.
Dell Manufacturing Company 4 Right Lane	7/5/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to conduct an abatement action which includes removal of PCB-impacted soil.	Highest concentrations were removed and further removal is pending EPA approval of plan.
Farmington Automotive 352 Scott Swamp Road	2/21/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data for two threatened wells and found no pollution in the well water.	No additional hazard abatement action necessary
FM2330 1387 Farmington Avenue	12/20/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to conduct the proposed abatement action. The groundwater will be sampled and the threatened potable well will be monitored annually. If groundwater conditions change additional abatement actions will be conducted.	Threatened well sampled and did not detect any contaminant of concern. Will be sampled annually until groundwater remediated.
Mobil Service Station #01-QQF 435 Main Street	5/18/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to collect samples from the threatened supply well and provide an alternate supply of drinking water if contamination is detected.	Nearby supply well was sampled and no volatile organic chemicals were detected. On-site monitoring wells will continue to be sampled.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Farmington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 74 West Avon Road	11/5/2004	Pollution was detected in a drinking water well, with some compounds above standards and other compounds below standards. Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to sample the polluted well quarterly and advise DEP of any changes. DEP determined the polluted soil has already been removed, eliminating the exposure risk.	A treatment system on the impacted well provides potable water. Supply wells on abutting properties have been tested and no pollution was detected. Polluted soil removed; no hazard additional abatement action necessary.
Residential Property 231 Coppermine Road	10/10/2002	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data and determined pollution is significantly below standards, and the water is safe for human consumption.	No specific hazard abatement action necessary.

Franklin

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
7-Eleven 15 Route 32	8/1/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP required additional sampling of onsite and two nearby identified wells for pollutants detected at the site.	On-site well and two nearby wells sampled and were not impacted by groundwater plume. Ongoing monitoring of groundwater being conducted at the site.
7-Eleven 15 Route 32	4/12/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample potable water supply wells up to 500 feet away from the site for pollutants detected at the site.	Two wells identified and sampled, pollution either not detected or detected but below standards.
Kahn Tractor & Equipment 520 Pond Road	11/6/2007	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to identify potable water supply wells up to 500 feet away from the site and to sample downgradient wells pursuant to a plan previously approved by the Department.	All wells sampled. On-site well has pollutants present, but filter system installed and maintained by owner. Off-site wells were non-detect. Long-term monitoring of area wells and maintenance of filter being conducted under approved plan.

Glastonbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Best Cleaners 2759 Main Street	2/6/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the operator to implement their proposed actions, including an inventory and sampling of nearby potable water supply wells, and also evaluate the potential for vapor migration into buildings.	Wells identified by investigation were sampled with no detection of pollution. Site is undergoing investigation and remediation under Property Transfer Program.

Glastonbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Glastonbury Gage (former) 184 Commerce Street	6/11/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence or secure the area to limit contact with the polluted soil.	Polluted soil removed; no additional hazard abatement action necessary.
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to resample the groundwater to further evaluate the threat to surface water.	Well retested; source investigation ongoing under Property Transfer Program.
Residential Property 57 High Ridge Road	6/9/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the threatened wells periodically for pollutants detected at the site, and create a long-term monitoring plan.	Remedial system installed; residential water supply well sampled and no volatile organic compounds detected above standards. Also, no volatile organic compounds detected in most downgradient monitoring wells.
Shell Facility #136314 2088 Hebron Avenue	12/3/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Three wells identified and sampled, pollution not detected or significantly below standards. No further hazard abatement action necessary.

Goshen

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Public Works Department 38 Torrington Road	11/6/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to re-sample the onsite supply well for pollutants detected at the site.	On-site well tested; pollution not detected. DEEP advised local health department to continue to monitor annually. No further abatement action necessary.
Residence 76 Old Middle Street	8/18/2011	Pollution was detected in a drinking water well above standards, and in another drinking water well pollution was detected but is below standards.	DEEP directed the property owner to provide treatment for the on-site polluted well, continue to monitor affected residences, and submit a plan for evaluating the pollution source. DEEP to install a treatment system on other polluted well.	Ten wells identified within 500 feet and ten wells tested. Pollution found at two residences above standards and one residence below standards. Filter treatment systems installed at three residences. Monitoring program implemented for 7 residences.

Greenwich

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Fairview Country Club 1241 King Street	2/7/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the identified wells within 500 feet for pollutants detected at the site.	Identified well was sampled, pollution was not detected. Monitoring program implemented.
Greenwich High School 10 Hillside Road	11/8/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is in a secure, restricted, and fenced-in area, limiting the potential for contact.	No additional abatement action necessary; long term remedy implementation continues.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Greenwich

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Hasco Electric (former) 84 South Water Street	10/27/2006	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine the extent of groundwater and/or soil gas pollution exceeding the hazard threshold criteria, determine if indoor air is adversely affected, and identify drinking water wells within 500 feet.	Extent of groundwater and soil vapor exceeding hazard threshold criteria appears to be limited to the on-site building which remains vacant; no wells were identified within 500 ft.
High Tower Trading, LLC 1275 King Street	11/4/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue sampling the threatened wells for the pollutants detected at the site and advise DEP of any changes.	Source removed; monitoring program implemented.
Ludor Corporation 371 East Putnam Avenue	8/7/2008	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary.
Merritt Parkway Rest Stop - Greenwich Merritt Parkway	3/24/2010	Pollution detected in groundwater above standards may threaten a drinking water well.		
Residence 10 Lockwood Drive [Old Greenwich]	8/22/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed information provided and determined that the source of pollution had been removed and no wells had been identified within 500 feet of the property, thereby eliminating the potential for exposure.	No additional abatement action necessary.
Riverside Cleaners (former) 1130 East Putnam Avenue	11/16/2007	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and, if so, provide a remedial action plan.	Remediation (excavation and off-site disposal) of source area initiated Oct 2009.

Griswold

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Griswold C-Store, LLC 659 Voluntown Road	6/17/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the on-site well, and identify and sample wells up to 250 feet from the site, for pollutants detected at the site.	Three wells identified and sampled, pollution either not detected or below standards.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Groton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Colonial Apartments 2350 Gold Star Highway	3/5/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data showing that the well at risk was not polluted.	No additional hazard abatement action necessary. DEP recommended periodic retesting until remediation of the site is complete.
Mystic Oral School Oral School Road [Mystic]	1/10/2014	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, and install a fence or secure the area to limit access to the polluted soil until the site is cleaned up.	Action pending.

Guilford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
AM International / Oce-Bruning / Arkwright 385 Long Hill Road	9/5/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the polluted monitoring well quarterly for the pollutant detected at the site and advise DEEP of any changes to concentrations.	Action pending.
Mobil Service Station #01-QBA 1164 Boston Post Road	7/1/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Downgradient wells on site have been non-detect for the target compounds. Additional monitoring is ongoing.
Residential Property 103 Daniel Avenue	6/23/2006	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to maintain and monitor an installed treatment system for the polluted well, provide a list of wells inventoried in the area, and expand the sampling program to other nearby wells.	A treatment system has been provided to remove constituents of concern from the affected water supply well.

Haddam

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
CT Yankee Atomic Power Co. 362 Injun Hollow Road	8/11/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to install a fence to limit access to the polluted soil until the site is cleaned up.	Polluted soil removed; no additional hazard abatement action necessary.
Hall Farm Estate Haddam Neck Road	11/1/2006	Pollution above standards was detected in a total of six drinking water wells, two of which are not in use. Pollution below standards was detected in two drinking water wells.	DEP requested the notifier's client and/or property owner to provide an alternate supply of potable water to properties with wells polluted above Drinking Water Standards, and to provide a plan to monitor affected and potentially affected wells.	Wells in vicinity of a suspected release area have been identified and sampled; bottled water is being provided to affected residences.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Haddam

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Jaspers (former) 206 Saybrook Road	12/31/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the former property owner to resample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Groundwater sampled in 11 residential wells within 500 feet of the subject site. No contaminants associated with the notification (SEHN) were identified in groundwater in any of the residential water supply wells.
Maple Avenue Area (Higganum) Maple Avenue [Higganum]	9/15/2005	Pollution was detected in drinking water wells above standards; also, pollution was detected in other drinking water wells but is below standards.	DEP directed the notifying party to provide bottled water to property with polluted wells above criteria, and to establish a long-term monitoring program for the impacted wells.	DEP provided a filter system to one residential property. DoT has provided bottled water to several businesses.
Mike's Auto Service LLC 1573 Saybrook Road	1/17/2007	Pollution was detected in a drinking water well but at a level substantially below standards.	DEP reviewed data for the affected well, and determined contamination in the well is significantly below standards, and the water is safe for human consumption.	No additional hazard abatement action necessary.
Tylerville BP Facility #61-11042 (former) 1598 Saybrook Road	6/23/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well, sample wells within 500 ft. that have not yet been sampled, and provide sample results and a map of supply well locations previously identified.	19 wells identified and 16 wells sampled, 2 commercial properties with pollution above standards found, advised of condition, and are now using bottled water as an alternative supply. Monitoring and DEP actions ongoing.
Tylerville BP Facility #61-11042 [Former] 1598 Saybrook Road	5/9/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP recommended actions to be taken in a letter addressed to Mr. Michael Devino, dated May 18, 2011. Please refer to this letter for the recommended actions.	Site is now under DEEP enforcement order. Responsible party is actively monitoring potable water wells in the area.

Hamden

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Cables Property 87 Kimberly Road	8/21/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample any wells up to 750 feet away from the site for pollutants detected at the site.	Two wells were identified within 750 ft.: 87 Kimberly was sampled and non-detect, 61 Kimberly could not be sampled because the property is condemned. Sampled well pollutants were found at levels below drinking water standards.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Hamden

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Laurel View Country Club 310 West Shepard Avenue	6/30/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample onsite (if any) and nearby wells for pollutants detected at the site.	Downgradient supply wells along Paradise Ave. sampled, all non-detect. On-site soil sampling non-detect for volatile organic chemicals and petroleum.
		Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP indicated that notification regarding petroleum hydrocarbons in surface soil is not required under the law.	Petroleum is not a defined significant hazard; no action was required.

Hartford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
151 New Park LLC 151 New Park Avenue	10/6/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to investigate the site under the Property Transfer Program and maintain temporary containment with vegetation and fencing to limit access to polluted soil until exposure risk is eliminated.	Temporary containment in place with vegetation and fencing until site is remediated under the Property Transfer Program.
Hartford Economic Development Commission 13 Wolcott Street	11/25/2002	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined the polluted soil is under pavement and in a fenced area, limiting the potential for contact.	Access to polluted soil is limited; no specific hazard abatement action necessary.
Residence 465-467 New Britain Avenue	5/1/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to implement plan to remove and replace contaminated soil.	Soil removal conducted following house restoration.
Residence 19 Julius Street	6/12/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a work plan with a schedule to remove lead paint impacted soil.	All lead hazards have been abated to meet lead abatement program requirements.
Residential Property 279-281 Sargeant Street	12/4/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is covered by plastic, limiting the potential for contact, and will be evaluated and removed upon completion of the painting project.	Area covered with temporary plastic tarp until soil removed pursuant to work plan.
Residential Property 514-516 Hillside Avenue	12/4/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to conduct work to mitigate lead paint contaminated soil proposed in a submitted soil abatement plan.	Area covered with temporary plastic tarp until soil removed pursuant to work plan.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Hartford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 308 Edgewood Street	10/28/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is covered by plastic, limiting the potential for contact, and will be evaluated and removed upon completion of the painting project.	Impacted soil covered with plastic until the area is excavated and soil is removed.
South Meadows Station, Mid-Connecticut RRF Reserve Road (Gate 20)	12/23/2002	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is limited; no specific hazard abatement action necessary.

Harwinton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Harwinton Citgo 166 Burlington Road	4/15/2008	Pollution was detected in a drinking water well above standards. Pollution was detected in a different drinking water well but is below standards.	DEP directed the property owner to continue providing bottled water until a filter system is installed on the impacted well, and implement a monitoring program for threatened wells.	Water treatment system installation completed/ tested. Monitoring program continued for threatened wells.
Harwinton Citgo 166 Burlington Road	7/19/2005	Pollution was detected in a drinking water well, with some compounds above standards and other compounds below standards.	DEP directed the property owner to sample the threatened wells periodically for pollutants detected at the site, and connect the affected property to municipal water service.	Investigated all wells and hooked up impacted wells to municipal water.
Reynolds Foundry (former) 131 Clearview Ave	2/17/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to implement the actions proposed in part IV of the Significant Environmental Hazard Notification, which include identifying and sampling nearby supply wells and further evaluating the source of pollution.	Receptor survey was conducted and the downgradient wells were tested detecting no contaminants of concern

Hebron

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Hebron Citgo 70 Main Street	5/17/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Water main installed in 2009 through Consent Order. All impacted wells connected to public water. Other wells are monitored by Drake Petroleum.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Hebron

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Hebron XtraMart Route 66 & Route 316	12/23/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Additional sampling conducted. Bottled water provided to properties where pollution was above standards pending water treatment system installations. Monitoring on-going for threatened wells.
Hebron XtraMart (Drake Petroleum) 37 Main Street	7/19/2006	Pollution was detected in a drinking water well but is below standards.	DEP required additional sampling of nearby identified wells within 500 feet for pollutants detected at the site.	Water main installed in 2009 through Consent Order. All impacted wells connected to public water. No further abatement action necessary.

Kent

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Bulls Bridge Garage 337 Kent Road (US Route 7)	12/12/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue to sample the on-site supply well and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Well receptor survey found drinking water wells on adjacent properties. On and off-site wells sampled and pollution not detected. Quarterly monitoring program implemented for on-site and nearest off-site well.-
Kent Substation Route 341	5/12/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is restricted because it is within a fenced electrical substation.

Killingly

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Commercial Property 405 Lake Road	12/11/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to assess the impact to downgradient receptors in consultation with the DEP.	Several wells identified and 9 wells sampled, pollution either not detected or detected but below standards. DEEP sampled wells through 2012 and determined no further monitoring necessary.
Dayville XtraMart 439 Hartford Turnpike (Route 101)	8/25/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the polluted wells quarterly for the pollutants detected at the site. DEP also requested that the property owner implement a proposed soil vapor survey.	Monitoring plan impemented.
Hopkins Wellfield south of intersection Rt 12 & Rt 101	12/27/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened and polluted wells periodically for the pollutants detected at the site, and advise DEP of any changes.	Crystal Water Company continues to sample this well.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Killingly

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
MPI Label Systems 24 Doring Drive	8/7/2007	Pollution was detected in a drinking water well above standards. Pollution was detected in a different drinking water well but is below standards.	DEP directed the property owner to provide bottled water to the properties with polluted wells.	Carbon filters installed at two homes. On-going monitoring being performed by DEEP.

Ledyard

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Mobil Home Park 940 Long Cove Road	4/9/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide treatment for polluted wells, and a report of additional actions taken.	New well drilled on property.
		Pollution in top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined the polluted soil has been removed, eliminating the exposure risk.	Polluted soil removed; no additional hazard abatement action necessary.

Lisbon

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Lisbon Mobil 107 River Road	4/22/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Well survey completed. Nearby wells sampled for pollutants present and no contaminants detected. Site undergoing long term monitoring.

Litchfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Commercial Property 725 Bantam Road	1/24/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample identified nearby wells for pollutants detected at the site.	Nearby wells re-sampled in February 2011 to confirm that the 2007 hazard condition had not impacted any of the nearby wells. All results were non-detect. No additional abatement action necessary.

Madison

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
East River Foundry (former) 82 Nathans Lane	4/5/2007	Pollution detected in groundwater that discharges to surface water may pose a threat to aquatic life.	DEP directed the property owner to evaluate the nature, extent and degree of groundwater pollution to determine the threat to surface water and aquatic life near the site, and also provide sample results for drinking water wells.	Polluted soil on site remediated; action pending on requested groundwater evaluation.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Madison

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
East River Foundry (former) 82 Nathans Lane	2/15/2005	Pollution detected in groundwater that discharges to surface water may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to evaluate the pollution migration and the threat to surface water and aquatic life.	Property ownership transferred to Town of Madison, site investigation and remedial action to be taken by town as part of site redevelopment. See notification by town 4/5/2007.

Manchester

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Commercial Property 42 Prospect Street	10/16/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to install a fence and post signs around the impacted area. DEP also required submittal of receptor survey information and additional sampling of groundwater for lead.	Receptor survey was conducted and no potable supply wells were identified. Lead was not detected in the groundwater.
Commercial Property 5 & 7 Tolland Turnpike	2/21/2006	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide an alternate supply of potable water and identify wells within 500 feet.	No wells identified within 500 ft down gradient. A carbon filter system has been installed on the onsite impacted well.
Dean Machine/Precision Metals Testing (former) 102 Colonial Road & 372 Progress Drive	11/15/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP indicated it is already aware of this condition; and that the party submitting the notification was not required to do so under the law.	Threatened well is monitored by the Town.
Gulf Gasoline Station 128 Tolland Turnpike	12/1/2004	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to resample the supply well periodically until a filter is installed or a public water connection is made.	Receptor survey was conducted identifying 2 potable wells. Wells were sampled for contaminant of concern and both were below drinking water action level.
Mobil Service Station No. 01-QQ5 240 Middle Turnpike West	6/9/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	The DEP directed the property owner to confirm if a neighboring supply well exists and, if so, sample the well for pollutants detected at the site.	No wells were found to be within 500 feet of the groundwater pollution; no additional abatement action necessary.
Residence 159 School Street	7/13/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to provide an abatement plan to remove impacted soil.	Soil to be removed following house restoration. Soil removal project is out to bid.
Town of Manchester Charter Oak Well Field 192 Charter Oak Street	6/6/2008	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the Town to identify and sample other nearby supply wells and develop a work plan to investigate the source area of the pollution.	Receptor survey identified one private supply well; water sample did not detect contaminants above drinking water standards.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Mansfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Dick's Automotive 644 Middle Turnpike	12/14/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify wells up to 500 feet away from the site.	Eastern Highlands Health District sampled drinking water wells in the area and no impacts were noted.
Husky Mobil (Drake Petroleum Co) 607 Middle Turnpike (Route 44) [Storrs]	12/27/2007	Pollution was detected in a drinking water well above standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Sampling of neighboring well performed. Carbon filter installed. DEP issued Order to Drake Petroleum for pollution abatement and monitoring and maintenance of Carbon filter.
Mobile Service Station #01-G1P 7 Storrs Road	8/30/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide a copy of the already completed sensitive receptor survey, and investigate sidegradient and downgradient surface water features within 500 feet of the release for signs of surface water contamination.	Alex Caisse Spring well located about 300 feet from site. Spring has not been impacted by plume. No other wells or receptors identified. Ongoing monitoring being performed at the site.
Residential Property 986 Storrs Road	10/17/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Additional sampling conducted, pollution not detected or below standards.

Marlborough

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Old Marlborough Village 74 South Main Street	10/9/2002	Pollution was detected in a drinking water well but is below standards.	DEP reviewed information provided and determined the pollution in the well was below standards, and the water is safe for human consumption.	Further sampling to be conducted as part of public water supply monitoring as required by Department of Public Health.

Middlebury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Lake Quassapaug Amusement Park, Inc. 2132 Middlebury Road	5/3/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Source of pollution removed. Two supply wells identified and two wells tested. Pollution not detected. Monitoring program implemented for groundwater and supply wells.
TranFarm Associates I, LLC 124 Tranquility Road	9/4/2003	Pollution was detected in a drinking water well, with one compound above standards and one compound below standards.	DEP reviewed additional sampling data and determined pollution is significantly below standards, and the water is safe for human consumption.	No additional hazard abatement action necessary. DEP recommended periodic sampling for the pollutants detected at the site.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Middletown

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Best Cleaners 522 South Main Street	2/28/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to implement their proposed plan which includes sampling of the potable well identified.	One potable well was identified and tested. Site pollutants were not detected in the well water. Site groundwater is monitored on an annual basis.
Bills Auto Parts 1462 Saybrook Road	11/18/2004	Pollution was detected in a drinking water well below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site, and to provide bottled water or treatment for property with polluted wells.	Two underground petroleum storage tanks and associated contaminated soil were removed from the site in 2005. Additional well water sampling to confirm there is no remaining pollution is pending.
Color Mart 41 Broad Street	3/22/2004	Pollution was detected in a drinking water well but is below standards.	DEP reviewed additional sampling data and determined pollution is below standards, and the water is safe for human consumption. DEP recommended periodic sampling of the well until completion of planned connection to public water.	No additional hazard abatement action necessary.
CT DoT Maintenance Facility Paddock Road	1/27/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample identified wells up to 500 feet from the site for pollutants detected at the site.	A well receptor survey was completed and identified 6 residential wells. These wells were tested for volatile organic chemicals in 2004 and 2010 and none were detected. The leaking line was replaced and impacted soil was removed.
Long Lane School 170 Long Lane	2/17/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP staff are already involved with a detailed cleanup of the site. The site is secure and there are plans to deal with any remaining contamination throughout the site including but not limited to pesticides and coal ash.	No specific abatement action necessary. The hazard conditions are being addressed by on-going soil excavation.
Long Lane School 170 Long Lane	10/10/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to continue to provide information to the Department as part of a continued site wide investigation and remediation. The property is under DEP oversight for remediation due to a 1999 property transfer.	DEEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.
Quality Insulation, Inc. 1996 Saybrook Road	4/29/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample all identified wells within 500 feet for pollutants detected at the site.	Wells identified and sampled. No additional hazard abatement action necessary.

Middletown

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Sumner Creek LLC 20 Mill Street	1/5/2007	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to resample the groundwater to further evaluate the threat to surface water and aquatic life.	Nine monitoring wells have been installed at the site. Zinc and copper continue to exceed the standards. The site is addressed under the Property Transfer Program.
Wesleyan University Long Lane Campus 170 Long Lane	5/17/2007	Presence of coal ash throughout the site may pose a risk to human health as a result of direct contact.	DEP directed the property owner to continue to provide information to the Department as part of a continued site wide investigation and remediation. The property is under DEP oversight for remediation due to a 1999 property transfer.	DEEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.

Milford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
120 Wampus LLC 120 Wampus Lane	11/15/2012	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific abatement action necessary.
Commercial Property 561-587 New Haven Avenue	2/15/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact. Polluted groundwater beneath an occupied building could affect indoor air quality.	Notification of these conditions was not required. DEP directed property owner to submit letter report of their actions as stated in DEP's December 18, 2006 acknowledgement letter regarding similar environmental hazard condition.	No additional hazard abatement action necessary.
Commercial Property 561-587 New Haven Avenue	12/8/2006	Polluted soil gas beneath an occupied building could affect indoor air quality.	DEP directed the property owner to characterize the extent of impact on groundwater and soil gas, assess the indoor air quality, propose controls to mitigate this impact, and conduct an inventory of water supply wells within 500 feet of the site.	No potable water supply wells identified within 500 feet. Investigations performed to characterize the degree and extent of groundwater pollution resulting from releases at site. Sub-slab soil vapor sampling and indoor air monitoring performed.
Devon Generating Station 734 Naugatuck Avenue	10/19/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post a sign, notify people with the potential for exposure to the surface soil, and maintain security around the site and the secondary containment around the tank to limit access to the surface soil.	Polluted soil removed; no additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Monroe

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Alpha Typesetting (former) 618 Main Street	7/6/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby identified wells for pollutants detected at the site.	9 wells were identified and 3 wells sampled (access was only granted for these 3 wells). Pollution was not detected. Petroleum hydrocarbons were not detected in groundwater collected from the on-site wells during two years of periodic monitoring.
BP Service Station # 1122 (former) 172 Main Street	12/11/2002	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to conduct long term sampling of polluted wells for pollutants detected at the site, or to provide a safe supply of drinking water.	Quarterly sampling of water supply wells was conducted from 2003 through 2006, concentrations were less than drinking water action level. Periodic sampling is ongoing.
Cyclone Car Wash, LLC 178 Main Street	6/30/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional data and determined pollution from this source is not affecting nearby wells.	No additional hazard abatement action necessary.
		Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP determined that the reported soil condition is exempted from the requirement for notification under the law.	Polluted soil is not exposed at the surface or located within the top two feet, which is the zone defined in the law as a potential hazard condition.
Main Street Area Main Street	11/29/2010	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide an alternate supply of potable water to the tenants. DEP retested the on-site supply well and sampled nearby wells for pollutants detected at the site.	Monitoring data shows threatened wells not affected. No additional abatement action necessary.
Residence 55 Sentry Hills Road	12/28/2007	Pollution detected in groundwater may threaten a drinking water well.	DEP directed the property owner to conduct a drinking water supply well inventory within a 500 ft radius of the property and sample on-site well and any at-risk wells for the pollutants detected at the property.	Source of pollution removed, and monitoring data shows on-site private well is not affected. No additional abatement action necessary.
Residence 9 Hillcrest Road	8/6/2013	Pollution was detected in a drinking water well but is below standards.	DEEP directed the property owner to resample the onsite supply well and identify nearby wells.	Onsite well sampled, pollution not detected. No additional abatement action necessary.
Residential Property 1068 Monroe Turnpike	9/9/2005	Pollution was detected in a drinking water well but is below standards.	DEP reviewed additional sampling data for the affected well and determined that the reported pollution was not confirmed as present, and the water is safe for human consumption.	Source of pollution removed, and monitoring data shows affected well is below standards. No additional abatement action necessary.
Route 25 Auto Collision 256 Main Street	8/7/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Monitoring program implemented

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Monroe

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Route 25 Auto Collision 256 Main Street	1/7/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well quarterly for the pollutants detected at the site and report the results to DEP and the local Health Director.	Monitoring program implemented.
Stevenson Hydroelectric Facility 1 Roosevelt Drive	2/14/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to cover the polluted soil, post warning signs, install fencing to restrict access to the polluted soil until the site is remediated, and inform persons with potential for exposure to the polluted soil.	Actions directed performed. Full remediation scheduled for 2012.

Montville

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Ash disposal site 128 Moxley Road	5/29/2007	Pollution detected in groundwater above standards may threaten a drinking water well. Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to fence the area, assess the potential for the contaminated surface water to impact an upgradient pond and water supply well, and develop a plan to abate impacted surface and ground water.	Nearby drinking water wells were sampled and were non-detect for the pollutants at the site. On-going evaluation of surface water body being conducted.
Bonville Brothers Property (former) 291 Maple Avenue	3/30/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Well inventory completed and 3 closest wells sampled for pollutants of concern. No pollutants were detected. DEP requested semi-annual monitoring of the 3 wells for a period of two years. No further monitoring necessary.
Shantok Motors 2246 Route 32	4/16/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the on-site supply well and to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Wells identified and sampled, pollution not detected. No additional hazard abatement action necessary.
Town of Montville 14 Bridge Street	4/25/2013	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is under pavement limiting the potential for contact. DEEP requested the property owner ensure the pavement remains in place until the site is remediated.	Soil is located beneath pavement. No current actions necessary other than ensuring that pollution remains isolated by pavement until remediation is performed.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Morris

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
East Morris XtraMart Thomaston Road (Route 63/109)	3/12/2004	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Source of pollution removed. Monitoring data shows potentially threatened wells have pollution significantly below standards or no pollution detected. No detection of pollutants in monitoring wells. No additional abatement action necessary.

Naugatuck

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Karo Manufacturing Site (former) 285 Great Hill Road	12/1/2003	Pollution was detected in a drinking water well above standards.	DEP installed water treatment systems at properties with polluted wells and threatened wells were monitored. Properties with polluted wells were subsequently connected to public water supply.	Properties with polluted wells on David Street (8,18,28,38,48,58,68), Ramsey Avenue (79,80), and Gail Drive (103) connected to public water supply. The Borough of Naugatuck implemented monitoring program for 7 closest wells. Pollution not detected.
Sarracco Mechanical Services, Inc. 71 Naugatuck Drive	9/29/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify wells within 1,000 ft of the site and to sample three identified nearby wells for pollutants detected at the site.	Wells sampled; pollution not detected or detected significantly below standards. No additional abatement action necessary.

New Britain

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Brothers Dry Cleaners & Dyers, Inc. 234 North Street	7/29/2005	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine the extent of the problem and provide a plan of action.	Proposed plan to vent area and take additional samples of soil gas has been implemented.
The Commercial Foundry Companies 326 South Street	6/3/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under a building and in a secure area, limiting the potential for contact.	No specific hazard abatement action necessary.

New Canaan

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
CT DoT Maintenance Facility 47 Gerdes Road	12/20/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement and in a secure and fenced area, limiting the potential for contact.	No specific hazard abatement action necessary.
Residence 807 Smith Ridge Road	10/29/2013	Pollution was detected in a drinking water well above standards.	DEEP reviewed additional sampling data for the affected well and determined that pollution is not in fact present in the well.	No additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

New Canaan

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence 1271 Oenoke Ridge	3/7/2013	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to sample the onsite and identified wells within 500 feet for pollutants detected at the site.	Source of pollution removed, and monitoring data shows threatened wells not affected or significantly below standards.

New Fairfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Druck Incorporated 3 Dunham Drive	12/20/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	10 wells identified/ 5 wells sampled. Pollution either not detected or detected below standards. 3-year monitoring program: Pollutants not detected in drinking water wells; groundwater did not exceed standards. No further abatement action necessary.
Druck Incorporated 3 Dunham Drive	6/3/2005	Pollution detected in groundwater above standards may threaten drinking water wells.	DEP directed the property owner to sample the onsite and nearby identified wells within 500 feet for pollutants detected at the site.	All wells sampled, pollution not detected or significantly below standards. No additional hazard abatement action necessary.
Druck, Inc. 4 Dunham Drive	8/7/2013	Pollution was detected in a drinking water well but is below standards.	DEEP reviewed sampling data: well pollution below standards, well has treatment system, and water safe for human consumption. DEEP directed owner to sample well annually for pollutants detected at the site and advise DEEP of any changes in occupancy.	4 wells identified and 4 sampled. Pollution below standards or not detected. Water treatment system installed on polluted well. Monitoring program implemented.
Fairwood Shopping Center / Candlewood Playho State Routes 37 & 39	8/23/2005	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to submit a plan to continue quarterly monitoring of at-risk supply wells and provided bottled water for private residences with pollution over applicable criteria.	Water treatment system installed at one well. Monitoring program implemented for groundwater and four threatened wells.
Mobil New Fairfield #01-E2E 94 State Route 37	10/12/2005	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample the onsite and nearby identified wells for pollutants detected at the site.	Monitoring program implemented for three supply wells and groundwater. Water treatment system already installed at the polluted on-site well.
New Fairfield Police Department 302 Ball Pond Road	11/29/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue sampling wells already monitored, and sample additional nearby supply wells, for pollutants detected at the site.	Six surrounding wells sampled three times; pollution not detected. Source of pollution removed. Wells re-tested, pollution not detected. No additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

New Fairfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Parcel 39 Route 39	10/14/2009	Pollution was detected in a drinking water well above standards.	DEP to follow up by confirmatory sampling of drinking water well. Resident has been notified to use bottled water until sample results are received.	DEP sampled well. Pollution not detected. No additional abatement action necessary.

New Haven

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Amtrack Cedar Hill Maintenance of Way Base 255 Welton Street (Rear)	2/17/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to continue proposed actions and to inform persons with potential for exposure, post warning signs and install a fence to limit access to the polluted soil until the site is cleaned up.	Warning signs posted, site secured, and fence installed to limit the potential for contact with polluted soil.
Dwight Street Elementary School (Former) 130 Edgewood Avenue	5/6/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area, limiting the potential for contact. Furthermore, the property owner is working with the US EPA and CTDEP to coordinate remediation of the site.	Warning signs posted, site secured and fence installed to limit the potential for contact with polluted soil.
East Shore Substation 600 Connecticut Avenue (aka 1 Waterfront Stree	1/6/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure to limit access to the polluted soil.	Disturbed soil has been removed and remaining contaminated soil has been covered by one foot of clean fill, limiting potential exposure.
Parcel 370 James Street	10/27/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to identify the extent of polluted soil and remove the polluted soil.	Impacted soils have been excavated. Property owner filing a deed restriction for low occupancy under the Toxic Substances Control Act to further limit exposure.
Quinnipiac Energy English Station 510 Grand Avenue	3/1/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined the polluted soil is in a secure area, limiting the potential for contact. DEP directed the property owner to post warning signs and inform persons with potential for exposure.	Site is under Cease and Desist Order # CDOWSUST-12-001, which prohibits any access to the site. Additionally, security measures now in place will prevent trespassers from illegally entering the site.
Rockwell Heat Treating 194 River Street	10/31/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area limiting the potential for contact. Per the notification, persons with potential exposure will be alerted, and warning signs will be posted.	Some polluted soil has been removed; the extent of the release area has been determined.

New Haven

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Simkins Industries, Inc. 260 East Street	11/18/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the soil pollution does not pose a significant threat because it is isolated under pavement.	No specific hazard abatement action necessary.
Troup Magnet Academy of Science 259 Edgewood Avenue	6/29/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to identify the extent of polluted soil and remove it.	Impacted soils were excavated in August/Sept 2006 and rendered inaccessible at the site as described in the Remedial Action Report prepared by consultant in January 2008. No additional hazard abatement action necessary.
Williams Terminals Holdings, LP 85 East Street	11/25/2002	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence or secure the area to limit access to the polluted soil.	Warning signs posted and fence installed to limit the potential for contact with polluted soil.

New London

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Coca-Cola Bottling Co. of Southeastern New En 951 Bank Street	3/28/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement, limiting the potential for contact.	Polluted soil removed; no additional abatement action necessary.

New Milford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Affordable Auto Motive 32 Executive Center Drive	9/21/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the eleven identified water supply wells within 500 feet of the site for pollutants detected at the site.	11 wells identified and 8 wells sampled (3 refused access). Pollution was not detected. Wells resampled in Feb/Mar 2013 due to another reported hazard. No contamination detected. Further monitoring pending.
B & W, LLC / Wetmores, Inc. 333 Danbury Road	5/20/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to re-sample the onsite supply well on a quarterly basis and to identify and sample nearby wells for pollutants detected at the site.	Well receptor survey found three wells within 500 feet of the site. Two of three wells were sampled (one is not in use) and pollution was not detected. An on-site monitoring program was implemented. Off-site wells were resampled in 2013.
Bulls Bridge Hydroelectric Station Route 7	4/13/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and to identify and sample wells up to 500 feet downgradient from the site for pollutants detected at the site.	On-site drinking water well and monitoring well resampled. Pollution was not detected. No additional hazard abatement action necessary.

New Milford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Candlewood Animal Hospital 117 Kent Road (Route 7)	5/17/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and nearby wells for pollutants detected at the site and to conduct an inventory of all drinking water supply wells at residences and businesses within 500 ft of the release.	Source of pollution removed. 6 wells identified and 6 wells sampled quarterly for one year. Pollution not detected. Groundwater monitoring shows pollution detected significantly below standards. No additional abatement action necessary.
Century Enterprise Center (former Century Brass) 12 Scoville Street	12/9/2004	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the polluted well quarterly for pollutants detected at the site, and advise DEP of any changes.	One well sampled. Pollution detected was significantly below standards. Monitoring program implemented.
Commercial Property 376 Danbury Road	4/20/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite and 3 nearest identified water supply wells for pollutants detected at the site. DEEP also directed the owner to further evaluate groundwater data.	2 of 3 nearby wells where owners allowed access were sampled. Results were non-detect for all constituents tested. Groundwater conditions no longer present hazard condition. No additional abatement action necessary.
Figliola Property 48 Wheaton Road	2/23/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the on-site water supply well and to identify and sample nearby water supply wells for pollutants detected at the site.	Well receptor survey conducted. On-site and two off-site wells sampled 2011-2012. Pollution not detected. Groundwater conditions no longer present hazard condition. No additional abatement action necessary.
Industrial Condominium 566 Danbury Road	12/6/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	All wells on-site and downgradient were sampled; pollution was not detected or was significantly below standards. One year of on-site monitoring shows that on-site well is not impacted. No additional abatement action necessary.
Medical Instill Technologies, Inc. 201 Housatonic Avenue	11/10/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional groundwater sampling data and determined the pollution is in fact below standards and does not pose a risk to supply wells.	No specific abatement action necessary; DEP requested notification if conditions change.
New Milford Plaza 164-180 Danbury Road	2/5/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the twelve identified water supply wells within 500 feet of the site for pollutants detected at the site.	Eight of the twelve wells (four refused access/didn't respond) sampled in Feb/Mar 2013. Results were non-detect for all constituents tested. Wells had been previously sampled in 2009 due to another reported hazard.
O & G Quarry 33 Boardman Road	5/24/2007	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and identified wells within 500 feet for pollutants detected at the site.	Five wells identified and four wells sampled, pollution either not detected or detected but below standards. Access denied to remaining well. No additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

New Milford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 53 Sawyer Hill Road	5/14/2004	Pollution was detected in a drinking water well but is below standards.	DEP determined that pollution in the well is below standards, and water is safe for human consumption.	Source of pollution removed. No additional hazard abatement action necessary. DEP recommended periodic monitoring.
Taylor's Cleaners 104 Danbury Road	3/13/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the four threatened wells identified in the significant hazard notification on a quarterly basis for the pollutants detected at the site.	Four wells sampled, pollution not detected or detected significantly below standards. Further action pending.

Newington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Cedar Street Station 16 Fenn Road	12/2/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to post warning signs and install a fence or secure the area to limit access to the polluted soil until the site is cleaned up.	The impacted soil was excavated on January 25, 2012 for offsite disposal. No further hazard abatement action necessary.
Willard Avenue Substation Route 173	5/18/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact with the polluted soil.	The top 2 feet of PCB-impacted soil was excavated. This hazard condition has been resolved.

Newtown

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence 70 Mile Hill Road South	12/30/2013	Pollution was detected in a drinking water well but is below standards.	DEEP reviewed sampling data and determined pollution in the well is below standards and the water is safe for human consumption. DEEP requested additional monitoring to determine if the concentrations detected are stable or increasing.	Potable wells in area being monitored due to nearby remediation. Pollution does not appear to be related to the nearby remediation. Re-sampling of wells in area does not show any pollution detected. Area wells will continue to be monitored annually.
Residential Property 53 Mile Hill Road South	12/5/2005	Pollution was detected in a drinking water well above standards.	DEP directed the residents to use bottled water until a filtration system could be installed. DEP to monitor drinking water at neighboring residences.	Drinking water wells in area identified and sampled. Two found with pollution above standards; filter systems installed. Monitoring program shows pollution in two affected wells significantly below standards since 2008. No additional abatement action
Rocky Glen Mill 75 Glen Road	12/28/2006	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the onsite supply well on a quarterly basis and to identify wells up to 500 feet away from the site.	Receptor survey completed. Monitoring program implemented. Pollution not detected in on-site well. No further abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Newtown

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Sandy Hook Automotive & Marine Corp. 9 Glen Road (Sandy Hook)	3/28/2008	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to re-sample the on-site supply well and to identify and sample wells within 500 feet of the site for pollutants detected at the site.	Site in foreclosure. Public water extended to the area; some but not all properties within 500 ft are connected. Some unconnected wells tested; no pollutants of concern present exceeding criteria. Sampling of other wells by town officials pending.
SCB Office Park 153 South Main Street	1/27/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence to limit access to the polluted soil. DEP also directed the property owner to submit a plan to investigate the area and clean up pollution.	Warning signs posted and fence installed to limit the potential for contact with polluted soil. The fence is being maintained annually. The extent of arsenic in soil above hazard criterion has been determined.

North Branford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Affordable Bus Charters Inc. 1071 Middletown Ave	8/3/2011	Pollution was detected in a drinking water well above standards.	DEEP advised the notifying party that they had no further obligation, since they were not the owner. DEEP is further reviewing its options and will act to assess and abate the condition as necessary.	The property owner completed improvements to the water supply system and re-sampled the supply well. Results from the re-sampling were non-detect for the constituents tested.

North Canaan

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Geer Nursing & Rehabilitation Center 99 South Canaan Road	9/25/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the groundwater and the two identified water supply wells within 500 feet of the site for pollutants detected at the site.	PCB impacted soil removed. Two identified off-site potable supply wells sampled quarterly; no pollution detected. 15 rounds of quarterly monitoring indicate no impact to the nearest supply wells. No further abatement action necessary.
John B. Hull, Inc. 10 Orchard Street	1/27/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened well quarterly for pollutants detected at the site, until clean up of pollution is complete.	One well identified. Well sampled for five quarters and pollution not detected. No further hazard abatement action necessary.
Residential Property 335 East Canaan Road	1/8/2003	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	No specific hazard abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

North Haven

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Morganite Crucible 345 Washington Avenue	2/26/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and install a fence to limit access to the polluted soil.	Polluted soil removed; no additional hazard abatement action necessary.
Pharmacia & Upjohn Company 41 Stiles Lane	2/28/2005	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to implement a proposed sampling program to evaluate the actual pollution concentration in the surface water.	Property owner has implemented controls to treat groundwater before discharging to surface water body.

North Stonington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Prestonwold, Inc. 154 Miller Road	4/17/2003	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide bottled water to the property with the polluted well.	DEP monitored affected wells for volatile organic chemicals; and the concentrations diminished to non-detect over time. Confirmation sampling was conducted in 2009 and the results remained non-detect. No further action required.

Norwalk

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Norwalk Compressor Company (former) 20 North Water Street	2/27/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under a building, limiting the potential for contact; and remediation to remove the soil is scheduled for 2008.	Site-wide remediation ongoing.
Residential Property 54 Nursery Street	10/13/2005	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to implement their proposed response, which is evaluation of additional sampling data to determine if treatment or additional monitoring is necessary.	On-site well sampled, pollution either not detected or detected but below standards. Source of pollution removed and passive remedial system installed. No additional hazard abatement action necessary.
The Fairfield County Savings Bank 26 Chestnut Hill Road	10/10/2003	Petroleum products in groundwater may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Additional sampling conducted, pollution not detected. Source of pollution removed.

Norwich

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
7-Eleven Store # 32524 152 Taftville Occum Road	6/24/2004	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to implement proposed quarterly sampling of the well for the pollutants detected at the site, and to provide a water treatment system if levels of pollution rise.	Further sampling to be conducted as part of public water supply monitoring as required by Department of Public Health.

Norwich

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Austins Garage 53 Taftville Occum Road	10/12/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site, and also to assess the potential for organic vapor intrusion at three addresses.	Nine wells were identified within 500 feet downgradient of the site. Volatile organic chemicals were not detected. Further evaluation of site data did not suggest a risk of vapor intrusion to nearby residences.
Norwich Fish & Game 44 Browning Road	10/28/2008	Pollution was detected in a drinking water well, but is below standards.	DEP requested that the City of Norwich evaluate potential impact to downgradient receptors in consultation with the DEP.	Well is sampled twice per year by the City of Norwich as part of its monitoring of groundwater in the vicinity of the Rogers Road landfill. Concentrations in water remain below maximum contaminant levels.
Rogers Road Landfill Rogers Road	10/15/2010	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data for the affected wells and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	Monitoring program implemented.
Thayer Building 16 Franklin Street	9/4/2002	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action.	Plan of action submitted. Building vacant. Plan of action to be implemented as part of redevelopment.

Old Lyme

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Bestway Citgo Gasoline Service Station 281 Shore Road (Route 156)	9/8/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Sampling conducted, only one well had pollution above standards. Property with polluted well is seasonal and has been connected to public water. Well is still present, but not used for drinking water.
Lyme - Old Lyme High School 69-2 Lyme Street	7/15/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Underground tank removed with no signs of a release. Wells located within 500 feet of tank grave have reportedly been disconnected and are no longer in use as water supply. On-going monitoring of groundwater to be performed.

Old Saybrook

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
CT DoT Maintenance Facility (former) 45 Ferry Road	10/11/2007	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide an alternate supply of potable water.	Bottled water provided pending connection to public water supply. DEP requested a technical report that analyzes potential for onsite pollution to affect the bedrock aquifer in vicinity.

Old Saybrook

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Grossman Chevrolet 300 Middlesex Turnpike	11/17/2005	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample the polluted well quarterly to ensure the installed filtration system is effectively removing contaminants of concern from the water supply.	Filter system was already installed on affected well. Source of pollution removed, further action including expanded onsite groundwater monitoring pending.
Grossman Chevrolet 300 Middlesex Turnpike	4/21/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data and determined that groundwater pollution is in fact below standards, and does not threaten a supply well.	Nearest supply well tested with no pollution detected. No additional hazard abatement action necessary.
Old Saybrook Bridge Maintenance Facility 441 Middlesex Turnpike	8/14/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed additional sampling data and determined pollution in the groundwater is below standards, and the water is safe for human consumption.	

Orange

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Mobil Service Station #01-355 Wilbur Cross Parkway (Northbound)	6/28/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the responsible party to identify and sample nearby wells for pollutants present on the site.	Gas station being remediated during reconstruction of facility.

Oxford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Quaker Farm Schools 30 Great Oak Road	12/20/2006	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the out-of-use onsite supply well and to identify and sample nearby wells for pollutants detected at the site.	Groundwater treatment system in operation. Pollution not detected in two years monitoring nearest three drinking water wells. Sampling of indoor air shows air pollution is not at levels that pose a significant risk.

Plainfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
CT Property (Griswold Rubber Co. lease) 1 River Street	2/8/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and implement a proposed removal of the polluted soil.	Warning signs posted and mulch cover installed to limit the potential for contact; removal of soil pending.
Frybrook Substation 18 Community Avenue Extension	8/31/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is restricted because it is in a fenced electrical substation; no specific hazard abatement action necessary.

Plainfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Griswold Rubber Company, Inc. 1 River Street	3/15/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure, post warning signs and secure the area to limit access to the polluted soil until the site is cleaned up.	Engineered cap installed under DEEP approved plan. Long-term O&M to be performed under approved plan.
Hendel's, Inc. 600 Norwich Road	9/10/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby wells for pollutants detected at the site.	Well survey complete. Nearby wells sampled and were non-detect. Several requests for access were denied.
Parcel 154-156 Plainfield Pike	12/6/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to identify the extent of polluted soil, limit access to the polluted soil, and test a nearby well for the pollutants present on the site.	Polluted soil excavated and removed from site. Also, on-site well and two nearest off site wells were sampled for pesticides, volatile organic chemicals, and metals including arsenic. None of the wells were found to be polluted.
Plainfield XtraMart 705 Norwich Road (Route 12)	11/22/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample wells on adjacent properties for pollutants detected at the site.	Four nearby drinking water wells tested; pollution was not detected. On-site drinking water well abandoned. Monitoring program implemented.
Residence 484 North Main Street	11/20/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and downgradient supply wells for pollutants detected at the site pursuant to a remediation plan developed in consultation with the DEP and concurrent with the notification.	Remediation completed; nearby wells sampled, no pollution detected. Filter system installed on the on-site well. Subsequent monitoring of on-site well indicated pollution no longer present. No further action necessary.

Plainville

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
General Electric Company (North Plant) Woodford Avenue	5/23/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample identified drinking water wells within 500 feet for pollutants detected at the site.	One well was sampled by DEP and pollution was not detected. For precaution DEP supplied, and later discontinued, bottled water. Hydrogeological study performed at the site shows groundwater does not flow to that well. No further action is required.
Getty Station #688 (former) 301 East Street	10/18/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample identified wells for the pollutants detected at the site.	A sensitive receptor survey was conducted. Two properties have potable water supply wells. One well is regulated by and routinely monitored for the Dept. of Health. Another well was sampled and no pollution was detected.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Plainville

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Pressmation Inc. (former) 5 Northwest Drive	4/17/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed additional sampling data for the threatened wells and determined pollution present was significantly below standards. DEEP requested a quarterly monitoring program for the impacted well.	Three wells identified and sampled, pollution either not detected or detected but below standards.
Valley Water Systems 161 Woodford Avenue	8/27/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed the groundwater sampling data and requested Valley Water Systems to continue to monitor the supply wells and monitoring wells.	The monitoring of 5 monitoring wells and two supply wells has been completed; petroleum and volatile organic chemicals were not detected. Two supply wells are on company's routine monitoring program.

Plymouth

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
FM 329 699 Main Street	11/8/2013	Pollution was detected in an onsite drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the threatened and polluted wells on the proposed sampling frequency for the pollutants detected at the site, and advise DEEP of any changes.	One onsite potable well and four offsite potable wells were sampled. Pollution was detected in onsite potable well but was below standards. Pollution was not detected in offsite potable wells. Monitoring program has been implemented.
Grimes Aerospace Facility (former) 50 Altair Avenue	7/28/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample 17 nearby wells for pollutants detected at the site.	All wells were sampled. Pollution were not detected in the wells sampled. Monitoring program has been implemented at the site.
Iseli Company 651 Greystone Road	5/3/2012	Chloroform was detected in a drinking water well but is below standards.	DEEP reviewed the sampling data and determined pollution in the well is below standards, and the water is safe for human consumption. The Department requested that the well in question be resampled.	The well was resampled and chloroform was not detected. No further abatement action is necessary pertaining to this notification.
J. T. Mac Dermid Group 400 Harwinton Avenue	12/16/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 1000 feet from the site for pollutants detected at the site.	Risks to the downgradient residents are resolved as all downgradient potable wells are connected to public water. This hazard notification has been resolved.
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to evaluate the threat to surface water and aquatic life.	
Proposed High School Site 564 Main Street	10/17/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP indicated it is already aware of and is evaluating this condition; and that the party submitting the notification was not required to do so under the law.	DEP evaluating site.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Plymouth

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Woodworking Design & Supply 284 Town Hill Road	9/25/2002	Pollution was detected in a drinking water well but is below standards.	DEP reviewed information provided and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	Bottled water is being provided voluntarily by property owner, who will periodically resample the well. No specific hazard abatement action necessary.

Portland

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
271-277 Marlborough Street 271-277 Marlborough Street	8/6/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed the well receptor survey report and determined that there is no potential exposure since no potable well is identified within 500 feet of the site.	Well receptor survey has been completed and no potable well was identified with 500 feet of the site. Proposed for soil excavation and natural attenuation.
Residential Property 37 Maple Road	6/11/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells adjacent to both sides of the property	Property owner tested wells requested by the department and found no contamination above applicable standards in 2007. DEEP will sample these wells in December 2013 or January 2014.

Preston

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Norwich State Hospital Route 12	2/9/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure, patrolled area, limiting the potential for contact.	Access is restricted; no specific hazard abatement action necessary.

Prospect

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Sunoco Gasoline Service Station 68 Waterbury Road	12/6/2012	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Survey in September 2012 identified wells. Samples were reported as none detected for volatile organic chemicals and petroleum. The on-site potable well has MTBE below standards. A monitoring program has been initiated and is ongoing.

Putnam

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Gomes Total Chrysler 157 Providence Pike	6/23/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Sampling conducted, pollution below standards. No additional monitoring required for hazard abatement.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Putnam

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Interstate Shell 647 School Street	2/17/2009	Pollution was detected in a drinking water well, but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	On-site well sampled. Trace level volatile organic chemicals present. Ongoing monitoring to be performed. No other drinking water wells within 500 feet downgradient.
Kars of Putnam, LLC 181 Killingly Avenue	2/1/2006	Pollution detected in groundwater above standards may threaten drinking water supply wells.	DEP directed the property owner to sample the onsite supply wells and identify and sample nearby wells for pollutants detected at the site.	Wells identified and sampled, pollution not detected. No additional hazard abatement action necessary.
Putnam Precision Moulding, Inc. 11 Danco Road	11/19/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened wells semi-annually for the pollutants detected at the site, and advise DEP of any changes.	Monitoring program implemented.

Ridgefield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Commercial Property Ethan Allen Highway	10/1/2007	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide the results of the receptor survey to the DEP.	According to the property owner, a charcoal filter has been installed on the drinking water supply system and a receptor survey has been initiated.
Exxon Service Station #3-6047 (former) 626 Danbury Road	4/8/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and also identified supply wells up to 750 feet away from the site for pollutants detected at the site.	Source of pollution removed, and monitoring data shows tested wells are non-detect or below standards. No additional abatement action necessary.
Residence 78 Picketts Ridge Road	8/26/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the on-site well and the eight (8) identified wells located adjacent to the property for pollutants detected at the site.	Source of pollution removed and monitoring data shows threatened wells not affected. No additional abatement action necessary.
Ridgefield European Moters, Inc. 746 Danbury Road	3/18/2008	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to maintain an existing treatment system, and also required identification and sampling of supply wells within 500 feet for pollutants detected at the site.	Site being remediated.
Shell Facility #136367 130 Danbury Road	10/12/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite well and to sample all identified drinking water supply wells within 500 feet of the site for the reported pollutants detected at the site.	Groundwater monitoring samples collected from site and neighboring potable well since SEHN report indicate that concentrations of compounds detected are less than applicable criteria.

Rocky Hill

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Dividend Partners LLC 145 Dividend Road	3/16/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure, post warning signs and install a fence or secure the area to limit access to the polluted soil, and to submit a plan to evaluate and mitigate the hazard condition.	The hot spot PCB-impacted soil was removed. An Engineered Control will be approved soon to address on site remaining PCB problem.
Royal Clothing Care 825P Cromwell Avenue	8/22/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	One well was monitored quarterly and target compounds were not detected. Access was attempted multiple times but could not be obtained to the other potable well. Active remediation is completed and groundwater is monitored on an annual basis.

Roxbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
DL Property Trust 212 Good Hill Road	8/13/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to provide the sample results for the two onsite supply wells and to identify and sample wells within 500 feet of the site for pollutants detected at the site.	One offsite well identified; offsite and 3 onsite wells tested and pollution not detected in 4 quarters of testing. Contaminated soils were removed and impacted groundwater remediated. No further abatement action necessary.

Salem

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Maple Shade General Store 428 Hartford Road	4/11/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample potable water supply wells up to 500 feet away from the site for pollutants detected at the site.	Several drinking water wells identified and sampled. Pollution not detected in drinking water wells. Air sparging/soil vapor extraction system installed 2006. Ground water sampling during 2013 indicates pollution not migrating offsite.

Salisbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence 433 Salmon Kill Road	10/25/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite supply well and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	On-site and eight surrounding water supply wells sampled. Pollution not detected. Monitoring program implemented.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Salisbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 396 Sharon Road (Lakeville)	5/25/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to re-sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Source of pollution removed. One drinking water well identified and sampled; pollution not detected. Owner re-tested well to confirm that there is no impact to the well. Pollution was not detected. No further abatement action necessary.

Seymour

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Comcast 80 Great Hill Road	12/3/2007	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to re-sample the onsite supply wells and to identify and sample nearby wells for pollutants detected at the site.	18 wells identified/15 wells sampled. Pollution either not detected or detected below standards. Onsite well is DPH regulated and has a treatment system. Monitoring program implemented on-site and for nearest drinking water well.
Diversified Electric 130-150 Silvermine Road	4/28/2008	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to re-sample the on-site supply well and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Well receptor survey found two off-site drinking water wells within 500 feet of the site. Quarterly monitoring program implemented (on & off-site). For all wells sampled, pollution either not detected or detected but below standards.

Sharon

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Sharon Hospital 50 Hospital Hill Road	6/15/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened well quarterly for the pollutants detected at the site.	Source of pollution removed from soil and groundwater. Pollution not detected in supply well in four rounds of quarterly monitoring. No additional abatement action necessary.
Sharon Xtramart 17 Gay Street	11/14/2011	Migrating vapors may pose an explosion risk.	DEEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	Source of pollution abated. Sampling of indoor air quality shows that air pollution is not at levels that pose significant risk. No additional abatement action necessary.

Shelton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Crabtree Autobody (former) 409 Bridgeport Avenue	4/25/2012	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and sample the 4 nearest supply wells for pollutants detected at the site.	Supply well impacted with benzene and toluene below standards. Off-site supply wells within 500 feet of site not impacted. Additional quarterly potable supply wells sampling results pending.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Shelton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Industrial Building 710 Bridgeport Avenue	9/7/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, and install a fence or otherwise secure the area to limit access to the polluted soil until the site is cleaned up.	Warning signs posted and fence installed to limit the potential for contact with polluted soil.
Viking Tool, Inc. 445 Access Road	9/1/2011	Pollution was detected in a drinking water well at levels that require further evaluation.	DEEP directed the property owner to sample an onsite supply well, identify supply wells within 500 feet of the site, sample nearby wells for pollutants detected at the site, and post warning signs at locations where onsite well water may be consumed.	4 wells identified and 2 wells sampled (on-site well and one off-site well). Pollution not detected. Access was denied for sampling of 2 wells. No additional abatement action necessary.

Sherman

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Rizzo's Garage 2 Route 39 North	12/2/2011	Pollution was detected in a drinking water well above standards.	DEEP directed the property owner to provide an alternate supply of potable water to the site and to re-test the on-site well and nearby wells for pollutants detected at the site.	Bottled water being provided by owner although resampling of on-site well did not detect any pollution. 7 adjacent properties identified and 3 wells sampled. Results were non-detect for all constituents tested. Other wells to be sampled as available.
Rizzo's Garage 2 Route 39 North	11/28/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite and nearby identified wells within 500 feet for pollutants detected at the site and to provide an alternate supply of water if pollutants detected in drinking water wells above standards.	Bottled water being provided by owner although resampling of on-site well did not detect any pollution. 7 adjacent properties identified and 3 wells sampled. Results were non-detect for all constituents tested. Other wells to be sampled as available.

Simsbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Mobil Service Station No., 01-QQC 955 Hopmeadow Street	6/9/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to confirm if a neighboring supply well exists and, if so, sample the well for pollutants detected at the site.	The nearby potable wells were sampled and no contaminants of concern were detected.
Shell Facility #136370 12 Albany Turnpike	4/15/2004	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data, which showed pollution was below standards, and recommended additional sampling of well.	Filter was provided to the impacted well. Subsequent samples from the impacted well have indicated that petroleum hydrocarbons are not detected.

Simsbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Shell Facility #136370 12 Albany Turnpike	12/29/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site. DEP reviewed the additional data, which showed pollution below standards, and required additional sampling of the well.	Additional sampling conducted, pollution detected above standards. Additional hazard notification submitted 04/15/2004. Treatment system installed and subsequent samples indicate pollution not detected.

Somers

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
495 Springfield Road 495 Springfield Road	8/8/2008	Fuel Oil detected in groundwater may threaten a drinking water well.	DEP directed the property owner to conduct quarterly monitoring of on-site and adjacent potable water supply wells and to continue monitoring an installed sub-slab depressurization system.	2/09 groundwater monitoring did not detect volatile organic substances or petroleum hydrocabons. Monitoring continuing.
Conval, Inc. 265 Field Road	7/16/2003	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Sampling conducted at one well, pollution not detected. Reports are provided to DEP and DPH. Looking to complete 1 year monitoring in 2009 with compliance to be to background
Somers Xtramart 169 Main Street	11/23/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby potable supply wells for pollutants detected at the site.	Potable supply wells were sampled and did not contain petroleum or benzene. The potable supply wells will continue to be sampled for contaminants of concern.

South Windsor

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Ful-Line Auto 1546 John Fitch Boulevard	8/24/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue to sample the onsite supply well and identify wells up to 500 feet away from the site.	No drinking water supply wells identified within 500 ft. Onsite drinking water well sampled with no detections of volatile organic compounds.
Mobil #01-QQA 249 Oakland Road	6/11/2007	Petroleum products in groundwater threaten a drinking water well. A surface water body is impacted by free product migrating from the site.	DEP directed the property owner to implement a proposed plan to install a product recovery system, monitor potable water supply wells and continue to treat and monitor the impacted stream.	Installed product recovery system and sampled downgradient supply wells with no detection of petroleum products.
Spelucin Property 1708 Ellington Road	5/13/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to continue to monitor onsite groundwater condition and submit annual reports.	Downgradient drinking water wells sampled multiple times and contained no contaminants of concern

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Southbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
KAN-PAK 425 Main Street North	11/4/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional information provided and determined the pollution does not pose a risk to supply wells.	No specific hazard abatement action necessary.
Regal Cleaners 220 Main Street South	5/14/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample wells identified within 200 feet of the site for pollutants detected at the site.	Wells sampled, one well was polluted above action level in 2005 and treatment was provided but it has been below the action level for over a year. Groundwater monitoring shows pollution below standards.
Shell Station #136373 121 Main Street North	12/3/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed property owner to identify and sample nearby wells for pollutants detected at the site.	All water supply wells sampled once. Access denied for on-going supply well monitoring. No significant pollution detected. Source of pollution removed. Monitoring program for groundwater implemented.
Shepaug Hydroelectric Station 2225 River Road	4/5/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data for the threatened on-site well and determined that pollution is not, in fact, present in the well.	On-site well was sampled, and pollution was not detected. Bottled water is used for drinking water purposes. Long term monitoring is in place until site remediation complete. No additional abatement action necessary.
Space Swiss 238 Reservoir Road	10/25/2004	Pollution was detected in drinking water wells, and some have pollution above standards.	DEP directed the property owner to identify and sample additional wells up to 1000 feet away from the site for pollutants detected at the site, and to provide bottled water or treatment to property with polluted wells above standards.	Water line extension completed. All contaminated wells closed. No further hazard abatement action necessary.
Space Swiss 238 Reservoir Road	10/6/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Three wells sampled, two had pollution above standards, bottled water provided pending long-term solution. Water supply line installed and affected residences connected. No further hazard abatement necessary.
Space Swiss 238 Reservoir Road	11/25/2003	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	All nearby residences now connected to public water. No further hazard abatement action necessary.

Southington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Marion Mall XtraMart 2201 Route 322 (Meriden-Waterbury Turnpike)	9/3/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	All potable wells within 1,000 ft of the site were connected to public water. No further abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Southington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Milldale XtraMart 1611 Route 322 (Meriden-Waterbury Turnpike)	9/3/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	One drinking water supply well identified within 500 feet of the site. The location was vacant and as a result no sample was collected. Ongoing investigation.
New Star Dry Cleaners / Carriage Trade Cleaner 415 North Main Street	5/20/2003	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution does not in fact pose a significant threat to indoor air quality.	No specific hazard abatement action necessary.
Southington Water Pollution Control Facility 12 Maxwell Noble Drive	5/20/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to expand the barrier fence perimeter, install a temporary cover over highly PCB impacted soil (above 30 ppm), and provide a plan for short term and long term soil removal actions.	The area of elevated PCBs is located within the fenced facility. The majority of the area of elevated PCBs is isolated by a perimeter barrier.

Sprague

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Pautipaug Country Club 7 Dows Lane	5/3/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site, and to provide a plan to remove the source of the contamination.	On-site and nearby wells sampled and were non-detect for pollution present at the site. Source remediated. No further abatement action necessary. Arsenic determined to be naturally occurring.
Taylor Site 40 Hanover-Versailles Road	10/31/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Action pending.

Stafford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence 194 East Street	10/2/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to submit a plan to identify the extent of polluted soil, notify site occupants, and remove or limit access to the polluted soil.	Local health department provided documentation indicating that surface soil was covered with plastic cover and mulch layer. Additional abatement pending under supervision of local health department.
TTM Technologies 4 Old Monson Road	11/13/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure, post warning signs and install a fence or otherwise secure the area to limit access to the polluted soil until the site is cleaned up.	Polluted soil removed; no additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Stamford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
120 Long Ridge LLC, Parcel B-R 120 Long Ridge Road	6/19/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample private supply wells up to 500 feet away from the site for pollutants detected at the site and provide an alternative supply of potable water if necessary.	Eight drinking water wells sampled, pollution not detected. No additional abatement action necessary.
120 Long Ridge LLC, Parcel B-R 120 Long Ridge Road	9/25/2008	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not in fact significantly threaten aquatic life.	No specific hazard abatement action necessary
Antares Gateway SPE, LP 424 Washington Boulevard	5/2/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and established that the polluted soil is in a secure and fenced area, limiting the potential for contact. DEP requested this security be maintained, and a report be submitted when planned remediation is completed.	No direct exposure pathway to polluted soil exists, and this security will be maintained until site is remediated. Remediation will be completed during re-development activities proposed for the site.
Antares Walter Wheeler Drive 69 Walter Wheeler Drive & 25 Washington Blvd.	7/5/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to delineate the extent of polluted soil and post warning signs, inform persons with potential for exposure, and maintain fence and asphalt cover to limit access to the polluted soil until the site is cleaned up.	Remediation initiated.
City Carting and Recycling 39 and 42 Woodward Avenue	10/17/2012	Pollution detected in groundwater above standards may threaten a drinking water well. Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP reviewed the well receptor survey information and determined that supply wells are not located in the area and directed the property owner to investigate the extent and degree of groundwater pollution to evaluate the threat to surface water.	No wells were found to be within 500 feet of the groundwater pollution; groundwater threat to surface water evaluated for site-specific conditions and determined to not significantly impact surface water body or aquatic life.
Commercial Property 860 Canal Street (aka 390 Ludlow Street)	1/22/2013	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact. Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed the property owner to identify the extent of polluted soil and secure the area to limit access to polluted soil until the site is cleaned up and to sample groundwater to further evaluate the threat to surface water and aquatic life.	Area of polluted soil already paved, warning sign posted. Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.
Long Ridge Service Station 1095 Long Ridge Road	2/5/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite and identified wells within 500 feet for pollutants detected at the site.	33 wells identified and 20 wells sampled from all owners granting permission. Pollution from site not detected. No additional hazard abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Stamford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Pitney Bowes Facility 23 Barry Place	3/10/2006	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure, post warning signs and maintain the pavement limiting access to the polluted soil until the site is cleaned up.	Polluted soils are covered by asphalt pavement and site is secured, limiting potential contact with polluted soil.
Residential Parcel (Source Unknown) Diamondcrest Lane	7/7/2009	Pollution was detected in a drinking water well above standards.	DEP required additional sampling of the private well for total petroleum hydrocarbons (TPH) 3 months after the initial sampling event to confirm that pollution is not in fact present in well.	Two samples were collected 2 to 3 weeks after the initial sample, and pollutants were not detected above the analytical detection limit. Additional samples collected 9 & 12/2009 and 3/2010 indicated that TPH is not present in the supply well.
Residential Property 351 Erskine Road [North Stamford]	12/18/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the two onsite wells and the private supply wells located immediately adjacent to the property for pollutants detected at the site and to submit a plan to monitor groundwater quality on site.	Action pending.
Residential Property 216 East Middle Patent Road	9/6/2002	Pollution by fuel oil was detected in a drinking water well.	DEP directed the property owner to sample nearby wells for pollutants detected at the site, and to properly abandon the old on-site supply well.	Source of pollution removed. New well installed, and testing of it found no pollution. Additional sampling conducted, no pollution detected. Old well abandoned as required.
Residential Property 75 Partridge Road	8/5/2004	Pollution was detected in a drinking water well above standards, and other pollution detected in groundwater above standards may threaten a drinking water well.	Homeowner uses bottled water and has a water treatment system. DEP directed the property owner to identify and sample the onsite well and any wells located up to 500 feet from the site for pollutants detected at the site.	Source of pollution remediated, five nearby wells tested for pollutants detected on site, concentrations below analytical detection limit.
Residential Property 267 Thunder Hill Drive	12/23/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional information and determined that the pollution release was limited, and that the threatened well was tested, with no pollution detected.	No additional hazard abatement action necessary. DEP recommended periodic sampling of the well.
Residential Property 90 Wellington Drive	3/23/2005	Pollution was detected in a drinking water well above standards.	DEP reviewed additional sampling data for affected wells and determined that pollution in the wells was not confirmed. DEP recommended additional sampling to verify actual water quality in the wells.	Source of pollution removed, DEP will coordinate further sampling to more conclusively determine water quality in the wells.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Stamford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Stamford Industrial Park/Yale & Towne Complex Market, Henry, Canal & Pacific Streets	1/3/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to identify the extent of polluted soil, inform persons with potential for exposure, post warning signs, and maintain the fence and bituminous concrete to limit access to the polluted soil.	Remediation initiated.
Stamford Industrial Park/Yale & Towne Complex Market, Henry, Canal & Pacific Streets	3/13/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to delineate the extent of polluted soil and inform persons with potential for exposure, post warning signs, and maintain the concrete slab to limit exposure to the polluted soil.	Remediation initiated.

Sterling

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 703 Margaret Henry Road	4/15/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the threatened wells periodically for the pollutants detected at the site, and advise DEP of any changes.	Source of pollution removed, and monitoring data shows threatened wells not affected. No additional abatement action necessary.

Stonington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Densmore Oil Company 38 Old Stonington Road	10/30/2009	Pollution was detected in groundwater above standards and may threaten a drinking water well.	DEP directed the company to sample the on-site well for the pollutants present at the site.	Onsite well sampled. All contaminants of concern were non-detect. The site is being remediated via soil removal and in situ chemical oxidation.
Mon Ami French Cleaners (former) 11-13 Cottrell Street	12/5/2006	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to 1) determine if indoor air quality is being affected and, if so, recommend a course of action; 2) perform a water well inventory; and 3) assess impacts to surface water quality.	No nearby drinking water wells identified. Sub-slab ventilation system was installed and operating to mitigate any potential vapors beneath the building. Potential impacts to nearby surface water body still being evaluated.

Stratford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Airport Property part of Raymark OU 6 1000 Great Meadow Road	12/13/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, and secure the area to limit access to the polluted soil until the site is cleaned up.	Access restricted; remediation pending.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Stratford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Numet, Inc. 50 Century Drive	4/16/2012	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed the property owner to resample the groundwater to further evaluate the threat to surface water and aquatic life.	Resampled monitoring wells, concentrations below standards; no potable wells identified within 500 feet of the groundwater pollution; no additional abatement action necessary.
U.S. Chrome Corporation 175 Garfield Avenue	2/5/2004	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to investigate the extent and degree of groundwater pollution, and to evaluate the threat to surface water and aquatic life.	Monitoring program implemented, groundwater concentrations decreasing, closest surface water body located over 0.5 miles away.

Suffield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 1117 North Grand Street	8/15/2005	Pollution by fuel oil was detected in a drinking water well.	DEP directed property owner to continue to sample potable water supply wells and maintain treatment systems.	Treatment systems have been installed. Long-term monitoring and maintenance is conducted by responsible party under Order SRD-197.

Thomaston

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 655 Fenn Road	1/5/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well for four consecutive quarters and to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Pollution not detected for three consecutive quarters. Additional sampling completed for potable and monitoring wells demonstrates the absence of polluted groundwater within 500 feet of the supply well and in the potable well.
Route 8 Gasoline Spill Route 8	9/29/2011	Pollution associated with a gasoline release may threaten a drinking water well, pose a direct exposure risk, threaten surface water quality and pose an explosion risk.	Risk of explosion handled by DEEP Spill Response Division at time of spill. DEEP requested information on soil removal. DEEP directed the property owner to sample the six nearby wells and evaluate the threat to surface water.	Source area remediated. Six closest wells sampled and all results were either non-detect for all constituents tested or the constituents detected were not associated with the tanker release. Sampling plan implemented and on-going.

Thompson

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Johnson Corrugated Products 720 Thompson Road	2/23/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	Water treatment system installed. House subsequently demolished and well no longer in service. No additional abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Thompson

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Norampac Thompson Inc. 720 Thompson Road	7/13/2004	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to conduct sampling of additional wells and install a water treatment system if pollution is confirmed.	Water treatment system installed. House subsequently demolished and well is no longer in use. No additional abatement action necessary.

Tolland

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Mobil Service Station #01-328 56 Merrow Road	1/3/2003	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to conduct periodic well sampling for pollutants detected at the site.	Additional sampling conducted, pollution remains below standards.
Tolland XtraMart 153 Hartford Turnpike	9/22/2005	Pollution was detected in a drinking water well but is below standards, and other pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed the data provided and concluded water in the supply well is potable. DEP directed the property owner to implement their proposed plan to study groundwater on-site and re-sample nearby supply wells to confirm groundwater quality.	Wells identified and sampled, pollution either not detected or detected but below standards.

Torrington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
D'Angelo Property 981 Toringford Street	8/4/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed information provided and determined that the property with the threatened well is vacant and the well is disconnected from the house.	Well not in use; no specific hazard abatement action necessary.
Federal Business Products, Inc. 368 Ella T. Grasso Avenue	11/1/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed groundwater sampling data and determined the pollution is not resulting in significant impact to soil and groundwater quality.	Conducting quarterly sampling of groundwater monitoring wells. Owner is conducting site investigation and remediation under the property transfer program.
Getty Service Station No. 6817 1294 East Main Street	4/24/2013	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to submit a plan to abate the hazard condition.	Abatement action plan submitted and nearby supply wells sampled were non-detect for the contaminant of concern.
IMI Cornelius Wilshire Facility (former) 2788 Winsted Road	8/22/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil has been removed, eliminating the exposure risk.	Polluted soil removed; no additional hazard abatement action necessary.
Northside Drive Area Northside Drive	4/23/2004	Pollution was detected in a drinking water well above standards.	DEP provided bottled water and conducted additional sampling. DEP reviewed additional sampling and determined the well's water is not polluted above standards.	Reported problem is not caused by pollution. No additional hazard abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Torrington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Northside Drive Area 60 Northside Drive	6/9/2004	Pollution was detected in a drinking water well above standards.	DEP provided bottled water and conducted additional sampling. DEP reviewed additional sampling and determined the well's water is not polluted above standards.	Reported problem is not caused by pollution. No additional hazard abatement action necessary.
Northside Drive Area Northside Drive	5/14/2004	Pollution was detected in a drinking water well above standards.	DEP provided bottled water and conducted additional sampling. DEP reviewed additional sampling and determined the well's water is not polluted above standards.	Reported problem is not caused by pollution. No additional hazard abatement action necessary.
Residence 52 Cook Street	6/25/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to conduct the abatement action which includes removing the top few inches of soil.	Soil to be removed following house restoration
Residence 30 Apter Drive	10/20/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify wells within 500 feet and sample the closest downgradient potable water supply well.	No volatile organic compounds detected in identified and sampled downgradient wells; impacted soil removed and passive venting system installed for remediation. No additional hazard abatement action necessary.
Residence 41-43 James Street	7/26/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to conduct the abatement action which includes removing the top few inches of soil.	Soil to be removed following house restoration.
Residential Dwelling 84 Pearl Street	2/23/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to complete the abatement plan proposed in the Significant Environmental Hazard Notification to remove and replace the contaminated soil.	Soil to be removed following house restoration.
Torrington Company Standard Plant (former) 59 Field Street	4/8/2004	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action.	Additional sampling showed pollution does not pose a significant risk to indoor air quality.
Wilson Dodge & Nissan 1530 East Main Street	2/26/2003	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	All identified wells that granted access were sampled for the contaminants of concern. Lead identified in the first sampling round was determined to be due to sampling error. All sampled supply wells were non-detect for the contaminants of concern.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Union

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Union School 18 Kinney Hollow Road	5/21/2008	Pollution was detected in a drinking water well above standards. Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to maintain an existing filter and identify and sample nearby wells. DEP directed the property owner to post warning signs, install a fence to limit access to polluted soil, and submit a surface soil removal plan.	Fence installed; subsequently pesticide impacted soil removed and new well drilled away from remediated area. No further abatement action necessary.

Vernon

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Mobil #01-QQQ 1292 Hartford Turnpike	2/15/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue to monitor offsite monitoring wells and to sample residential drinking water wells if the monitored wells become impacted.	Continuing to sample on-site and off-site monitoring wells. Latest report received in 6 /09 and 2/09.
Texaco Facility #100037 (former) 444 Hartford Turnpike	2/18/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample nearby wells for pollutants detected at the site.	Additional sampling conducted, no site-related pollutants detected. Other pollutants were detected but are below standards. No further hazard abatement action necessary.

Voluntown

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Hartikka Tree Farm 262 Wylie School Road	6/20/2006	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	On-site and nearby wells identified and sampled, pollution either not detected or detected but below standards. No further action necessary.
Voluntown Shell 251 Main Street	10/9/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	11 wells sampled, pollution either not detected or detected but below standards. Monitoring program implemented.

Wallingford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Barberino Property (former) Pent Road	6/9/2005	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to resample the groundwater to further evaluate the threat to surface water and aquatic life.	The property owner redeveloped and resampled the well and the levels of copper and zinc were below standards. No further abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Wallingford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Century Fireplace Furnishings 856 North Main Street Ext.	9/29/2006	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP reviewed sampling data and determined that the groundwater pollution could pose a significant threat to indoor air quality.	A sensitive receptor study will be completed and a subslab depressurization system will be installed. Contaminated soils were removed and injection was done.
CYTEC Industries South Cherry Street	4/7/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to identify the extent of polluted soil, notify site occupants, and limit access to the polluted soil.	PCB containing soils from the impacted area were excavated and removed from the site for disposal.
Marquette Medical Systems/Corometrics Facility 61 Barnes Industrial Park North	5/18/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet from the site for pollutants detected at the site.	A Sensitive Receptor Survey was completed in July 2004. Identified wells were sampled; these wells were last sampled in 2012. All samples were reported as non-detect for pesticides.
Masonic Healthcare Center 22 Masonic Avenue	12/19/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and inform persons with potential for exposure.	Access is restricted; no specific hazard abatement action necessary.

Washington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Washington Depot (former) 1 Green Hill Road	4/1/2008	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby wells for pollutants detected at the site.	Petroleum impacted soil removed. All five downgradient water supply wells sampled; pollution was not detected. Wells determined not to be hydraulically downgradient. No further abatement action necessary.
Washington Substation Route 47	5/12/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is restricted because it is in a fenced electrical substation.
Washington Supply Company, Inc. Property 2 Calhoun Street	12/23/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Judea Water Co Water Supply Well #2 and 2 existing private drinking water supply wells sampled. All results were "non-detect" for contaminants of concern. No additional hazard abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Waterbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Chase Collegiate School 565 Chase Parkway	10/5/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP determined that polluted soil is under pavement and extent of polluted soil is delineated. DEP directed property owner to submit plan to notify persons with potential for exposure, to install fence, and to remove polluted soil.	Polluted soil removed; no additional hazard abatement action necessary.
Commercial Property 1713 Thomaston Avenue	4/14/2009	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP reviewed information provided and determined that the groundwater pollution does not in fact significantly threaten aquatic life.	Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.
Everybody's Market (former) 1200 South Main Street	7/8/2011	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed the property to supply additional information to further evaluate the threat to surface water and aquatic life.	Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.
Haydon Switch & Instrument, Inc. 1500 Meriden Road	10/26/2005	Polluted groundwater and soil vapor beneath an occupied building could affect indoor air quality.	DEP directed the property owner to identify private drinking water wells up to 1/4 mile away from the site; and to submit a plan to monitor groundwater, to characterize the impact on indoor air quality, and to develop a remedy to limit the impact.	No wells were found to be within 500 feet of the groundwater pollution. Vent system installed to prevent impact on indoor air quality. Groundwater monitoring ongoing. No additional hazard abatement action necessary.
ITW Waterbury Buckle 952 South Main Street	3/2/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact. Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed property owner to inform persons with potential for exposure and to limit access to soil until the site is cleaned up. DEP reviewed groundwater data and determined that pollution does not pose a significant indoor air quality threat.	Access to polluted soil is restricted by asphalt. Groundwater data shows that pollution is not at levels that pose a significant risk to indoor air quality. Monitoring program implemented.
Jonathan E. Reed School 33 Griggs Street	4/10/2012	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed the property owner to provide additional information pertaining to the hazard condition.	Groundwater threat to surface water evaluated for site specific conditions and determined that identified threat was due to false positive results during groundwater sampling.
Lot 6, Waterbury Industrial Commons 1917 Thomaston Avenue	12/9/2013	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed the property owner to perform proposed groundwater monitoring and source investigation.	Groundwater threat to surface water evaluated for site specific conditions and does not appear to significantly impact surface water and aquatic life. Further actions to evaluate groundwater conditions and pollution sources are pending.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Waterbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Nelson Heat Treating 2046 North Main Street	3/28/2011	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP directed the property owner to submit a plan to investigate the extent and degree of groundwater pollution, and to evaluate the pollution migration and the threat to surface water and aquatic life.	DEEP staff led a source removal and mitigation action at the site. Groundwater from the locations that originally triggered the hazard condition were resampled and found to be non-detect. No additional abatement action necessary.
PGP Industries, Inc. (former) 46 Municipal Road	9/25/2002	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement and in a fenced area, limiting the potential for contact.	Access to polluted soil is limited by pavement; no specific abatement required. Property is unoccupied and secured. Hazard condition is controlled by Engineered Control Cap approved for the site in May 2011.
Residence 2259 North Main Street	7/20/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP directed the property owner to inform persons with potential for exposure, post warning signs, and install a temporary fence to limit access to the polluted soil until the site is cleaned up.	Lead abatement action performed under public health program. Management plan implemented to monitor lead surfaces and control exposures during any maintenance projects.
UConn Waterbury Campus (former) 32 Hillside Avenue	6/8/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure by posting warning signs and installing a fence to limit access to polluted soil until the site is cleaned up and to submit a plan to identify the extent of polluted soil.	Polluted soil removed; no additional abatement action necessary.
W.D. Stanley Co. (former) 3821 East Main Street	3/15/2013	Pollution was detected in a drinking water well above standards. Polluted groundwater beneath an occupied building could affect indoor air quality.	DEEP directed the property owner to: provide a schedule for monitoring two water supply wells with treatment systems; test eight nearby supply wells; evaluate vapor impact to buildings; and provide a plan of action to limit vapor impacts.	Water supply wells with treatment systems and 4 nearby supply wells sampled (no access to 2 wells and 2 homes connected to public water). No pollution found in drinking water. No on-site vapor impact found. Off-site vapor impact being evaluated.
Yankee Gas Former Waterbury North MGP Jackson Street	9/13/2013	Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEEP directed property owner to evaluate nature, extent and degree of groundwater pollution to determine the threat to surface water and aquatic life near the site by providing site-specific dilution calculation and groundwater monitoring information	Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life. Further actions to evaluate groundwater conditions are pending.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Waterbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Yankee Gas Former Waterbury North MGP Jackson Street	3/7/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area, limiting the potential for contact. DEP directed the owner to post warning signs to further limit exposure to soil until the site is cleaned up.	Warning signs posted, site secured, and fenced to limit the potential for contact with polluted soil.
Yankee Gas Work Center 47 Eagle Street	3/31/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform site workers, post warning signs, and install a fence or secure the area to limit access to the polluted soil.	All soils exceeding hazard criteria have been remediated. No additional abatement action necessary.
Yankee Gas Work Center 47 Eagle Street	9/2/2003	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is in a secure and fenced area, limiting the potential for contact. DEP directed the property owner to post warning signs.	Warning signs posted, area secured, and fence installed to limit the potential for contact with polluted soil.

Waterford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Cumberland Farms, Inc. Station #850636 47 Norwich-New London Turnpike (Norwich Roa	4/25/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample nearby identified wells for pollutants detected at the site.	Sampled four nearby wells. All wells were non-detect for the pollutants at the site. Two properties refused access and were not sampled.
Hendel's, Inc. 35 Great Neck Road	8/30/2010	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite groundwater well and sample the three closest drinking water wells for the pollutants detected at the site.	3 wells sampled, pollution either not detected or detected but below standards. Monitoring program implemented.

Watertown

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Eyelematic Manufacturing Corp. Inc. 1 Seemar Road	10/18/2005	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to identify private drinking water wells up to 1/4 mile away from the site; and to submit a plan to characterize the impact on indoor air quality and develop a remedy to limit the impact.	No drinking water wells identified within 1/4 mile. Monitoring wells installed at downgradient property line. Sub-slab depressurization system installed to limit vapor migration into building. Monitoring is ongoing.

Watertown

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Polk Elementary School 435 Buckingham Street	3/7/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to post warning signs and maintain security of the area to limit access to the polluted soil until the site is cleaned up. DEP directed the property owner to identify potable wells up to 500 feet away from the site.	Polluted soil removed; no additional abatement action necessary. One well was identified within 500 feet and sampled, with no detection of the pollutants reported at the site.
Residential Property 1650 Litchfield Road	3/28/2006	Pollution was detected in a drinking water well but is below standards.	DEP reviewed the sampling data for the contaminated well and determined pollution in the well is at trace levels, significantly below standards, and that the water is safe for human consumption. Additionally, a water treatment system is in operation.	Source of pollution removed and soil vapor extraction and water treatment systems already in place. Monitoring data shows affected well is significantly below standards. No additional hazard abatement action necessary.
Ten Acre Mall 595 Straits Turnpike	6/19/2009	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to submit a plan to delineate the extent of the groundwater plume and to evaluate the potential impact on nearby residences.	Sampling of sub-slab soil vapor shows pollution levels are below those that pose a significant risk to indoor air. Annual monitoring program implemented for on-site and off-site wells to evaluate dissolved phase volatile organic pollution.
Winchester Electronics Facility 400 Park Road	8/10/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 1000 feet from the site for pollutants detected at the site.	Potentially impacted supply wells were sampled. No pollutants were detected. Investigation and remediation (if needed) of site continues under Property Transfer Program.

West Hartford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Goodrich Pump & Engine Control Systems 1 Charter Oak Boulevard	11/10/2005	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement, limiting the potential for contact.	Access to polluted soil is limited; no specific hazard abatement action necessary.
Goodrich Pump & Engine Control Systems 1 Charter Oak Boulevard	7/25/2005	Polluted groundwater beneath an occupied building could affect indoor air quality.	DEP directed the property owner to determine if indoor air quality is being affected and provide a plan of action.	Recent groundwater monitoring data does not show vinyl chloride present at concentrations exceeding the significant environmental hazard threshold.
Jacobs Manufacturing (former) 176 Newington Road	6/22/2006	Polluted groundwater near or beneath an occupied building could affect indoor air quality.	DEP directed the responsible party to submit a schedule for the necessary work to address the groundwater contamination issue and determine if there are any downgradient receptors impacted by the release.	Soil vapor under building tested, and found to be below criteria.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

West Hartford

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Jacobs Manufacturing site (former) 176 Newington Road	12/6/2007	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to assess the extent and degree of PCB contamination within the impacted areas and conduct soil removal and disposal were necessary in accordance with current standards and regulations.	Impacted soil removed; no further abatement action necessary.

West Haven

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Baker Properties 351 Morgan Lane	7/25/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to submit a plan to identify the extent of polluted soil and remove the polluted soil.	Fence installed to limit the potential for contact with polluted soil.
Proposed Magnet School 506 Boston Post Road	7/2/2013	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is in a secure and fenced area limiting the potential for contact.	The site has been secured and fencing installed to limit the potential for contact with polluted soil.
Seaboard Metal Finishing Company, Inc. 50 Fresh Meadow Road	7/16/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite monitoring wells and identify and sample nearby wells if onsite wells have detections of pollutants above criteria.	Three downgradient wells identified and sampled. Pollution not detected in the wells.
Superior Cleaners 900 Orange Street	5/23/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Two residential water supply wells identified with solvent pollution above action levels. Carbon filters installed at both homes, with quarterly monitoring.
Superior Cleaners 900 Orange Street	2/6/2006	Pollution was detected at a level above standards in a drinking water well.	DEP directed the property owner to provide an alternate supply of potable water to affected property, and to provide an inventory of all drinking water supply wells within 500 feet, test results for these wells, and status of any untested wells.	Inventory completed and carbon filter installed.

Westbrook

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residential Property 31 Grove Beach Road North	2/19/2010	Pollution was detected in a drinking water well, above standards, in the course of monitoring conducted for a nearby remediation site.	After reviewing information provided in the hazard notification, and historical information, the DEP concurs with the notifier that the nearby remediation site is not the contamination source.	DEP sampled the impacted well (3/31/10) and found the water is potable. DEP sent letters to the property owners informing them of the analytical results. The letter also recommended that the property owners sample their wells on a regular basis.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Westbrook

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Superior Auto Body (Former) 39 Grove Beach Road North	11/12/2013	Pollution was detected in a drinking water well but was below standards. Subsequent sampling did not detect pollution in the well.	DEEP advised the property owner to sample the onsite supply well periodically for the pollutant previously detected in the well.	No specific abatement action necessary, but periodic monitoring recommended as a best practice.
Westbrook XtraMart 130 Boston Post Road	2/11/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the responsible party to submit an already completed sensitive receptor survey, analytical results for two potable water supply wells already sampled, and proof that a third potable water supply well did not exist.	All wells sampled, pollution either not detected or detected but below standards.

Weston

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence 34 Ladder Hill Road South	9/28/2011	Pollution (an oil sheen) was observed but not chemically detected in a drinking water well.	DEEP directed the property owner remove free oil from the on-site well, to sample the on-site supply well periodically for the pollutants detected at the site, and to identify supply wells within 500 feet of the property.	Source of pollution removed, and monitoring data shows affected well is significantly below standards, no other supply wells identified within 500 feet of the property. No additional abatement action necessary.
Residence 6 Old Orchard Drive	2/2/2009	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to sample the onsite well for pollutants detected at the site.	Oil impacted materials removed. Former water supply well sampled, pollution identified. Well bailed, re-sampled no pollution detected. No pollution detected in active supply well. No additional abatement action necessary.
Residential Property 20 Old Stage Coach Road	10/24/2002	Pollution was detected in a drinking water well but is below standards.	DEP reviewed sampling data and determined pollution in the well is significantly below standards, and the water is safe for human consumption.	A water treatment system is installed; no specific hazard abatement action necessary.
Residential Property 200 Steep Hill Road	12/21/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to continue monitoring potentially at risk wells, and to propose further monitoring focused by increased understanding of the pollution problem.	Monitoring program continuing; remediation of source completed.

Westport

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Embalmers Supply Company/Dorr-Oliver Lab (fo 25 Ford Road	1/7/2010	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that the polluted soil is under pavement limiting the potential for contact.	No additional abatement action necessary at this time.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Westport

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Metro North Station 1727+28	9/19/2012	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEEP reviewed information provided and determined that the polluted soil is located on a fenced active railroad line, limiting the potential for contact.	Warning signs will be posted and soil will be properly managed when disturbed during construction.

Wethersfield

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Wilkus Farm 138 Willow Street	7/9/2009	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	4 wells identified and 4 wells sampled. Pollution not detected. No additional abatement action necessary.
William Street Regulator Station 23 Williams Street	1/29/2004	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP reviewed information provided and determined that warning signs are posted and the polluted soil is in a secure and fenced area, limiting the potential for contact.	Access to polluted soil is restricted because it is in a fenced utility station; no specific hazard abatement action necessary.

Willington

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
I-84 TravelCenter 327 Ruby Road	9/4/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data and determined that pollution in the water supply system water, as delivered to the tap, meets applicable standards.	Further sampling to be conducted as part of public water supply monitoring as required by Department of Public Health. On-going groundwater monitoring being performed.
Mobil Station # 13693 (01-GL1) 470 River Road	5/26/2010	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	All wells sampled, pollution either not detected or detected but below standards. Monitoring program implemented.

Wilton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Calitri Revocable Trust 46 Danbury Road	2/23/2011	Pollution was detected in a drinking water well above standards.	DEP directed the property owner to provide an alternate supply of potable water to the impacted building.	Building connected to public water and well abandoned.
Mobil Service Station No. 01-340 932 Danbury Road	4/14/2010	Pollution was detected in a drinking water well but is below standards. Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite supply well and sample 4 nearby wells for pollutants detected at the site and provide results of the proposed tank removal activities.	Underground tanks removed 7/10. Some supply wells sampled 6/10 for pollutants of concern. Pollution detected onsite but below standards. Pollution not detected in tested offsite wells; but access to some offsite residential wells not provided.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Wilton

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Residence 37 Kellogg Drive	6/26/2012	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to resample the on-site supply well and monitoring wells and identify and sample nearby wells for pollutants detected at the site.	Source of pollution removed, monitoring program implemented.
Residence 30 Quail Ridge Road	12/16/2008	Pollution was detected in a drinking water well above standards.	DEP directed the local Health Department to provide an alternate supply of potable water to the property owner and resample the well. DEP also directed the Health Department to identify and samples wells up to 0.75 miles from the Wilton Landfill.	All wells sampled, pollution triggering the hazard notification was not detected in subsequent testing (three rounds) of the well at 30 Quail Ridge Road . Monitoring program implemented and continues at the closed Wilton Landfill.
Residential Property 23 Rossimur Court	11/22/2002	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional sampling data for the threatened well and determined that the presence of pollution was not confirmed.	A water treatment system is installed; no additional hazard abatement action necessary. DEP recommended periodic well testing.
Residential Property 26 Pond Road	3/22/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well for pollutants detected at the property, determine the extent of groundwater impacts detected on the property, and identify supply wells within 500 feet of the property.	Monitoring found no impact to supply wells is associated with the release. Polluted soil was treated and removed to the extent practical. No further active abatement or monitoring necessary.
Residential Property 68 Pipers Hill Road	11/22/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the on-site supply well and sample any water supply well within 500 feet of the site for pollutants detected at the site and investigate groundwater quality downgradient of the release location.	Source of pollution removed, and monitoring data shows affected well and groundwater are below standards. No additional hazard abatement action necessary.

Winchester

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
New England Bark Mulch 167 Torrington Road	10/20/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Onsite supply well contained no contaminants above standards. Pollution source was removed and site is undergoing groundwater monitoring. No off-site wells identified as at-risk. No additional hazard abatement action necessary.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Winchester

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Winchester XtraMart 102 Colebrook River Road	1/11/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify the nearest downgradient offsite well and test it for volatile organic compounds and petroleum, and also to provide a map of groundwater flow directions.	Groundwater flow direction determined and no downgradient drinking water wells identified within 500 ft. Scope of work submitted indicating that further investigation of pollution is pending.

Windsor

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Konica Minolta Business Solutions USA, Inc. 550 Marshall Phelps Road	9/5/2008	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to implement a proposed action plan that includes removal of impacted soil and collection of post remedial soil samples.	550 gallon underground tank and 20-30 cubic yards of soil were removed in 12/08.

Windsor Locks

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Camp Hartel 580 North Street	6/7/2011	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to implement the abatement plan included with the hazard notification and to sample identified threatened drinking water wells	The sampled wells did not have detectable concentrations of the target petroleum compounds.
Wood Group Power, Inc. 523 Halfway House Road	10/14/2009	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to maintain fencing around site and erect a sign warning of PCB contamination until hazard condition is abated.	Fencing surrounds site to prevent site access other abatement actions pending.

Wolcott

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Commercial Building 1496 Wolcott Road	1/29/2014	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP directed the property owner to sample the onsite supply well and the identified nearby wells for pollutants detected at the site.	Action pending.
Eagle Cleaners 372 Wolcott Rd	1/17/2007	Pollution was detected in a drinking water well but is below standards.	DEP directed the property owner to resample the onsite supply well and identify and sample wells up to 500 feet away from the site for pollutants detected at the site.	Property connected to municipal water 4/07. Additional investigation results submitted 5/16/07. Only two wells sidegradient to pollution are still unsampled.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Wolcott

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Max's Wolcott Gulf 685 Wolcott Road	1/11/2005	Pollution was detected in a drinking water well but is below standards.	See above response for 1/3/2005 significant environmental hazard notification.	Remediation on-going. Pollution largely contained and has significantly decreased in concentration and extent. Bottled water/treatment provided where supply wells polluted. Currently, all nearby supply wells connected to municipal water supply.
Max's Wolcott Gulf 685 Wolcott Road	1/3/2005	Pollution was detected in a drinking water well above standards; and in another drinking water well pollution was detected but was below standards.	DEP directed the property owner to continue providing bottled water to property with polluted wells above standards, and continue the current monitoring program for other wells in the area.	Remediation on-going. Pollution largely contained and has significantly decreased in concentration and extent. Bottled water/treatment provided where supply wells polluted. Currently, all nearby supply wells connected to municipal water supply.

Woodbridge

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Parcel 60 Woodfield Road	9/23/2009	Pollution was detected in a drinking water well above standards.	DEP acknowledges receipt of this SEHN and will follow up with the property owner regarding actions that have been, and must still be, taken.	Mr. Merith Rozner, real estate agent for current owner of 60 Woodfield Road, called to inform DEP that his client installed a filter system, at the site, upon purchase of the property from Woodbridge Country Club, Inc.
Residential Property 78 Ansonia Road	1/30/2006	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to resample the onsite supply well and identify and sample nearby wells for pollutants detected at the site.	Underground tank removed, soil and groundwater remediated. Contaminant levels below all applicable criteria.
Town of Woodbridge Dog Pound 135 Bradley Road	1/14/2003	Pollution was detected in a drinking water well but is below standards.	DEP reviewed additional sampling data and determined that pollution in the well is significantly below standards, and the water is safe for human consumption. DEP determined the well had already been resampled and results indicated water was potable.	Supply well was retested. Pollution was consistently detected significantly below standards. No additional hazard abatement action necessary.
Town of Woodbridge Public Works 15 Meetinghouse Lane	9/20/2002	Pollution was detected in a drinking water well but is below standards.	DEP determined that pollution in the well is significantly below standards, and the water is safe for human consumption.	Source of pollution remediated; no additional hazard abatement action necessary. Monitoring ongoing.
Woodbridge Country Club 50 Woodfield Road	4/1/2011	Pollution in the top two feet of soil may pose a risk to human health as a result of direct contact.	DEP directed the property owner to inform persons with potential for exposure, post warning signs and secure the area to limit access to the polluted soil until the site is cleaned up.	Signage has been posted and area has been secured limiting access to the polluted soil.

List of Significant Environmental Hazards Reported to the DEP

Period covering 8/01/2002 through 2/28/2014

Woodbury

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Connecticut Tube Products 194 Old Town Farm Road	3/27/2007	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample nearby wells.	Wells sampled, pollution detected below standards. No additional abatement action necessary.
		Pollution detected in groundwater that discharges to a surface water body may pose a risk to aquatic life.	DEP also requested resampling of the groundwater to further evaluate the threat to surface water and aquatic life.	Groundwater threat to surface water evaluated for site specific conditions and determined to not significantly impact surface water and aquatic life.
Dom's Lynn's Corner Deli 1633 Main Street North	6/21/2005	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP directed the property owner to identify and sample wells onsite and up to 500 feet away from the site for pollutants detected at the site.	Six drinking water wells and site's well sampled. Pollution was either not detected or was detected significantly below standards. No further abatement action necessary.
Residence 1181 Main Street North	1/16/2014	Pollution detected in groundwater above standards may threaten a drinking water well.	DEEP reviewed sampling data for the threatened wells and determined pollution is not present in the wells. DEEP requested a plan for investigation and potential remediation of soil along with further monitoring of threatened wells, if necessary.	13 wells identified and 12 wells sampled, pollution not detected. Plan for further investigation and potential remediation of soil being developed. If necessary, further monitoring of threatened wells will be required.
Woodbury Mobil 718 Main Street South	3/19/2004	Pollution detected in groundwater above standards may threaten a drinking water well.	DEP reviewed additional actions taken and determined that they adequately address the reported hazard conditions.	At-risk wells sampled with no pollution detected, except in a well already with a treatment system. Vent system operated to prevent impact on indoor air quality until 2006 when groundwater quality improved. No additional abatement action required.
		Polluted groundwater beneath an occupied building could affect indoor air quality.		

Woodstock

<i>Site/location</i>	<i>Date Notified</i>	<i>Type of Hazard</i>	<i>Response</i>	<i>Action</i>
Woodstock Department Public Works Garage 215 Coatney Hill Road	5/19/2006	Pollution other than a substance for which the commissioner has established a ground water protection criterion was detected in a drinking water well.	DEP directed the property owner to sample the onsite supply well and identify and sample wells up to 1000 feet away from the site for sodium and chloride.	Nearby wells identified and sampled. Monitoring program implemented.



Appendix E: City of Meriden File Review Information



CITY OF MERIDEN


GIS Services

PROPERTY CARD

Property Information:	Address: 84 GROVE ST Map/Lot: 0102-0010-0036-0000 Card Number: 1																							
Owner Information:	MERIDEN CITY OF Owner Address: 142 E MAIN ST MERIDEN, CT 06450																							
Building Information:																								
Special Features:	No special features																							
Appraisal Information:	Tax District: 2 District Name: INNER DISTRICT District Mill Rate: 37.09 <hr/> <table border="0"> <tr> <td>Current Building Value: \$0</td> <td>PrevYear: 2012</td> </tr> <tr> <td>Current Yard Items: \$0</td> <td>PrevBuildingValue: \$0</td> </tr> <tr> <td>Current Land Value: \$88,100</td> <td>PrevYardItems: \$0</td> </tr> <tr> <td>Current Total: \$88,100</td> <td>PrevLandValue: \$88,100</td> </tr> <tr> <td>Assessment: \$61,670</td> <td>PrevTotal: \$88,100</td> </tr> </table> <p>Assessment is 70% of appraised value.</p> <hr/> Special Land Value: \$0						Current Building Value: \$0	PrevYear: 2012	Current Yard Items: \$0	PrevBuildingValue: \$0	Current Land Value: \$88,100	PrevYardItems: \$0	Current Total: \$88,100	PrevLandValue: \$88,100	Assessment: \$61,670	PrevTotal: \$88,100								
Current Building Value: \$0	PrevYear: 2012																							
Current Yard Items: \$0	PrevBuildingValue: \$0																							
Current Land Value: \$88,100	PrevYardItems: \$0																							
Current Total: \$88,100	PrevLandValue: \$88,100																							
Assessment: \$61,670	PrevTotal: \$88,100																							
Land Information:	<table border="1"> <thead> <tr> <th>Type</th> <th>Land Use</th> <th>Lot Size</th> <th>Lot Unit</th> <th>Neighborhood</th> <th>Zoning*</th> </tr> </thead> <tbody> <tr> <td>Tax Exempt</td> <td>Bowling Alley</td> <td>9147.00000</td> <td>SF</td> <td>INNER CITY AREA</td> <td>R-2</td> </tr> </tbody> </table> <p>Total Acreage:0.21 *Confirm zoning with Planning Office. Zoning map is the official document.</p>						Type	Land Use	Lot Size	Lot Unit	Neighborhood	Zoning*	Tax Exempt	Bowling Alley	9147.00000	SF	INNER CITY AREA	R-2						
Type	Land Use	Lot Size	Lot Unit	Neighborhood	Zoning*																			
Tax Exempt	Bowling Alley	9147.00000	SF	INNER CITY AREA	R-2																			
Sales Information:	<table border="1"> <thead> <tr> <th>Book</th> <th>Page</th> <th>Grantor</th> <th>Sale Date</th> <th>Sale Price</th> <th>Deed Type</th> </tr> </thead> <tbody> <tr> <td>4242</td> <td>111</td> <td>ASSEMBLY OF CHRISTIAN CH</td> <td>4/23/2008</td> <td></td> <td></td> </tr> <tr> <td>2269</td> <td>78</td> <td></td> <td>6/6/1997</td> <td></td> <td></td> </tr> </tbody> </table>						Book	Page	Grantor	Sale Date	Sale Price	Deed Type	4242	111	ASSEMBLY OF CHRISTIAN CH	4/23/2008			2269	78		6/6/1997		
Book	Page	Grantor	Sale Date	Sale Price	Deed Type																			
4242	111	ASSEMBLY OF CHRISTIAN CH	4/23/2008																					
2269	78		6/6/1997																					
Assessor's Permit History:	<table border="1"> <thead> <tr> <th>Date</th> <th>Permit Number</th> <th>Notes</th> <th>Type</th> </tr> </thead> <tbody> <tr> <td>4/8/2009</td> <td>965</td> <td>SERVICE UPGRADE TO 200A AND POOL WIRING UPGRADE</td> <td></td> </tr> <tr> <td>1/1/1900</td> <td>1761</td> <td>WIRE NEW CHURCH</td> <td>C</td> </tr> <tr> <td>1/1/1900</td> <td>3257</td> <td>UPGRADE KITS, MISC REPAIR</td> <td>RA</td> </tr> </tbody> </table>						Date	Permit Number	Notes	Type	4/8/2009	965	SERVICE UPGRADE TO 200A AND POOL WIRING UPGRADE		1/1/1900	1761	WIRE NEW CHURCH	C	1/1/1900	3257	UPGRADE KITS, MISC REPAIR	RA		
Date	Permit Number	Notes	Type																					
4/8/2009	965	SERVICE UPGRADE TO 200A AND POOL WIRING UPGRADE																						
1/1/1900	1761	WIRE NEW CHURCH	C																					
1/1/1900	3257	UPGRADE KITS, MISC REPAIR	RA																					

Property Images

--	--

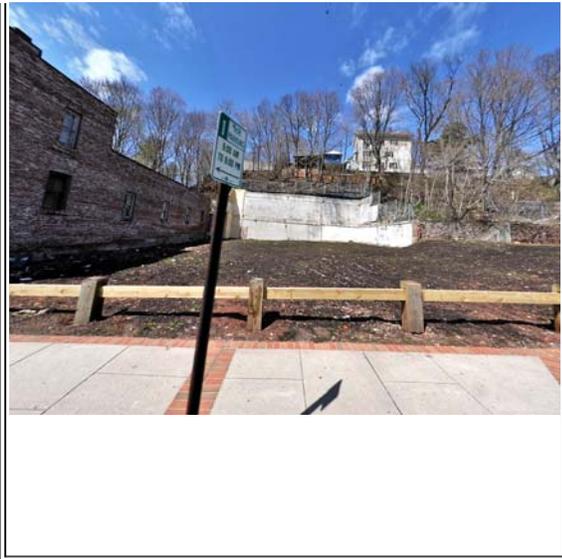

Unsketched SubAreas:
BAS: 17888,
BMT: 8788,



CITY OF MERIDEN

GIS Services

PROPERTY CARD

Property Information:	Address: 88 GROVE ST Map/Lot: 0102-0010-0037-0000 Card Number: 1																							
Owner Information:	MERIDEN CITY OF Owner Address: 142 E MAIN ST MERIDEN, CT 06450																							
Building Information:																								
Special Features:	No special features																							
Appraisal Information:	Tax District: 2 District Name: INNER DISTRICT District Mill Rate: 37.09 <hr/> Current Building Value: \$0 Current Yard Items: \$0 Current Land Value: \$27,600 Current Total: \$27,600 Assessment: \$19,320 Assessment is 70% of appraised value. <hr/> Special Land Value: \$0																							
Land Information:	<table border="1"> <thead> <tr> <th>Type</th> <th>Land Use</th> <th>Lot Size</th> <th>Lot Unit</th> <th>Neighborhood</th> <th>Zoning*</th> </tr> </thead> <tbody> <tr> <td>Tax Exempt</td> <td>Res - Subd(4 Family)</td> <td>0.10000</td> <td>AC</td> <td>S OF I-691 N OF E&W MAIN ST</td> <td>R-2</td> </tr> </tbody> </table> Total Acreage:0.10 *Confirm zoning with Planning Office. Zoning map is the official document.						Type	Land Use	Lot Size	Lot Unit	Neighborhood	Zoning*	Tax Exempt	Res - Subd(4 Family)	0.10000	AC	S OF I-691 N OF E&W MAIN ST	R-2						
Type	Land Use	Lot Size	Lot Unit	Neighborhood	Zoning*																			
Tax Exempt	Res - Subd(4 Family)	0.10000	AC	S OF I-691 N OF E&W MAIN ST	R-2																			
Sales Information:	<table border="1"> <thead> <tr> <th>Book</th> <th>Page</th> <th>Grantor</th> <th>Sale Date</th> <th>Sale Price</th> <th>Deed Type</th> </tr> </thead> <tbody> <tr> <td>3604</td> <td>126</td> <td>ASSEMBLY OF CHRISTIAN CH</td> <td>6/29/2005</td> <td>\$0</td> <td></td> </tr> <tr> <td>2436</td> <td>268</td> <td></td> <td>2/10/1999</td> <td>\$0</td> <td></td> </tr> </tbody> </table>						Book	Page	Grantor	Sale Date	Sale Price	Deed Type	3604	126	ASSEMBLY OF CHRISTIAN CH	6/29/2005	\$0		2436	268		2/10/1999	\$0	
Book	Page	Grantor	Sale Date	Sale Price	Deed Type																			
3604	126	ASSEMBLY OF CHRISTIAN CH	6/29/2005	\$0																				
2436	268		2/10/1999	\$0																				
Assessor's Permit History:	<table border="1"> <thead> <tr> <th>Date</th> <th>Permit Number</th> <th>Notes</th> <th>Type</th> </tr> </thead> <tbody> <tr> <td>1/1/1900</td> <td>4323</td> <td>DEM 4FAMILY WOOD STRUCT</td> <td>RA</td> </tr> </tbody> </table>						Date	Permit Number	Notes	Type	1/1/1900	4323	DEM 4FAMILY WOOD STRUCT	RA										
Date	Permit Number	Notes	Type																					
1/1/1900	4323	DEM 4FAMILY WOOD STRUCT	RA																					

Property Images







Mystic Air Quality Consultants, Inc.

1204 North Road (Rt. 117) Groton, Connecticut 06340

December 21, 2005

Ms. Jeannine Fitzgerald
Purchasing Department
City of Meriden
City Hall Room 210
142 East Main Street
Meriden, Connecticut 06450-8022

Re: Asbestos Abatement Site Monitoring (December 15 & 19, 2005)
88 Grove Street
Meriden, Connecticut

Dear Ms. Fitzgerald:


Mystic Air Quality Consultants performed industrial hygiene services pertaining to an asbestos abatement project at the location noted above on December 15 & 19, 2005.


These services were rendered in full accordance with the State of Connecticut Department of Health Services Standards for Asbestos Abatement, as found in the Regulations for Connecticut State Agencies Section 19a-332a-1 to 16.

As required in section 19a-332a-12 the applicable post abatement procedures to ascertain satisfaction of re-occupancy criteria were performed.

In addition, the terms of the approved Alternative Work Practice for simultaneous abatement and demolition was monitored. As the work progressed and at the end of the work, visual monitoring and inspections affirmed that the asbestos containing materials in the construction debris as well as dust or debris residue from the work were all cleaned from the site and containerized for disposal as set forth in the Alternative Work Practice, as required by subsection 19a-332a-12(b).

Sincerely,

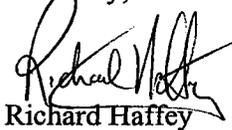
Richard Haffey
President

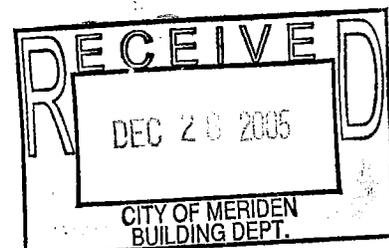

Communications (24 hours):

Office: (860) 449-8903

website: www.mysticair.com

FAX: (860) 449-8860

e-mail: maq2@aol.com

Toll Free: 1 (800) 247-7746



MYSTIC AIR QUALITY CONSULTANTS

1204 North Road (Rt. 117) Groton, Connecticut 06340

TELECOMMUNIC

NS

Office: 860-449-8903
Nights & Weekends: 860-464-2050
FAX: 860-449-8860

Toll Free: 1-800-247-7746

CLIENT: City of Meriden SITE LOCATION: SP Grove St
PURPOSE FOR MONITORING: DEMOGRAPHIC CONTAINMENT LOCATION: DEMOGRAPHIC

TEMPERATURE: _____ RELATIVE HUMIDITY: >20% ACM MATERIAL ABATED: _____

CASSETTE SIZE: 25 FILTER AREA: 380 mm² ROTOMETER#: _____

ANALYSIS METHOD: PCM-NIOSH 7400 A-RULES MICROSCOPE FIELD AREA: 0.00785 MICROSCOPE FACTOR: 48.4

LOG NUMBER	SAMPLE NUMBER	SAMP DATE	SAMPLE LOCATION	TIME (minutes)			PUMP FLOW RATE Liters/Min	SAMPLE VOLUME Liters	LAB RESULTS Fibers/Fields	FINAL RESULTS Fibers/CC	ANALYST Print Initials
				Start	Stop	Total Min					
264078	A1	12/19	Fence	830	1440	870	2.5	888	5/100	50:0059	JS
264079	B1		Blank								JS
264080	B2		Blank								A
			BLANK								
			REPLICATE SAMPLE#								

QC DATA: Book 26 Page 100 Calculator

REMARKS: _____
SIGNATURES:
Samples Collected By: [Signature]
Samples Analyzed By: [Signature]
Calculation QC'd By: [Signature]
Date of Sample Analysis: 12/19/2007



Mystic Air Quality Consultants

1204 North Road (Rt. 117)
Groton, CT 06340

Date 12/15/2005

DAILY JOB LOG

Page of

Client Town of Mendon Site supervisor ANGEC

Site Location 27 Grove St Mendon

GENERAL OBSERVATIONS Containment Location

MANNING BROTHERS CREW DEMOLISHING BLDG,
SELECTED AMT OF TRANSITE SIDING AND HAN ROOF
MATERIALS TO DEMOLITION.
SEGREGATING OUT WOOD FROM SUSPECT AREA
TRUCK LOADS REMOVED & LOADED OUT.

Telecommunications
Office: 860 449 8903
Nights &
Weekends: 860 464 2050
FAX: 860 449 8860
TOLL FREE: 1 800 247 7742

HYGIENIST'S NAME STEWART B. DAKES HYGIENIST'S SIGNATURE [Signature]

TIME ON SITE: TIME OFF SITE:



Mystic Air Quality Consultants

1204 North Road (Rt. 117)
Groton, CT 06340

Date 12/19/85

Page ___ of ___

DAILY JOB LOG

Client City of Mendon

Site Supervisor _____

Site Location 88 Grove St. Mendon Ct.

GENERAL OBSERVATIONS

Containment Location Demolition

Operator and Supv on site -
Set out Ambient Sample
As sprayed - Toxicity - Heavy Rain


HYGIENIST'S
NAME Stewart Barnes

HYGIENIST'S
SIGNATURE [Signature]

TIME ON SITE: _____

TIME OFF SITE: _____

Telecommunications
Office: 860 449 8903
Nights &
Weekends: 860 464 2050
FAX: 860 449 8860
Toll Free: 1 800 247 7716

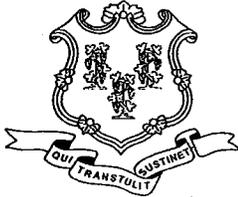

STATE OF CONNECTICUT

DEPARTMENT OF PUBLIC HEALTH

October 21, 2005

Christopher Eident
Mystic Air Quality Consultants, Inc.
1204 North Road
Groton, CT 06340

Re: Alternative Work Practice for 88 Grove Street, Meriden

Dear Mr. Eident:

The Department of Public Health has approved your application of October 21, 2005 for the demolition of the referenced structurally unsound facility. An order from the Meriden Building Inspector is included in this application.

In lieu of §§§§§19a-332a-5(b, c, d, e, and h) and §19a-332a-7(c), the contractor shall establish a regulated area around the perimeter of the building. The contractor shall conform to the requirements of 40 CFR, Part 61, Subpart M, the asbestos NESHAP. This approval requires onsite supervision by a CT licensed asbestos inspector/project monitor during the demolition by the asbestos abatement contractor. All generated waste, shall be disposed of as asbestos-containing debris. A licensed inspector/project monitor shall inspect the work area for visible debris following completion of the demolition and abatement activity (§§19a-332a-5(g), 19a-332a-5(c)).

Except as noted in this letter, all other work practices specified in the Standards for Asbestos Abatement regulation are mandatory. This approval is specific to the identified facility and does not relieve the contractor or facility owner from any other federal, state or municipal regulations. The Department reserves the right to rescind this approval should it determine that equivalent means of asbestos emission control are not maintained.

Please feel free to contact me with any questions.

Sincerely,

Lesley Giovannelli, Environmental Sanitarian II
Asbestos Program
Division of Environmental Health

MAQC-demo-unsound-Meriden10-21



Phone: (860) 509-7367 fax: (860) 509-7378
Telephone Device for the Deaf: (860) 509-7191
410 Capitol Avenue - MS # 51 Air
P.O. Box 340308 Hartford, CT 06134

Affirmative Action / An Equal Opportunity Employer

State Use Only

Date:

Check #

Trans. #


Application for Alternative Work Practices

Please provide the following information as required by the Regulations of Connecticut State Agencies, Section 19a-332a-11. Please note any attachments.

Date Prepared: 10/21/2005

Notification filed? if yes, date:

Discussed with Leslie Giovanelli

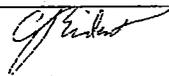1.	Applicant: (CT Licensed Project Designer):		Christopher J. Eident, CIH, CSP, RS		
	License Number:	00015	Signature:		
	Address:	1204 North Road			
	City, State:	Groton CT	Zip Code:	06340	
	Phone:	8604498903	License Expiration Date:	10/31/2005	
2.	Facility Owner:	City of Meriden			
	Address:	Town Hall, 32 Liberty Street, Meriden, CT 06450			
	Phone:	203 630 4120	Contact Person:	Wilma Petri	
3.	Address of Facility:	88 Grove Street			
	City, State and Zip Code:	Meriden, CT			
4.	Asbestos Abatement Contractor:	Either Manafort or LaRosa (to be determined)		CT License #:	000053
	Address:				
	City, State :			Zip Code	
	Phone:			Contact Person:	
5.	Project start date (if known):	Pending AWP approval			
6.	Nature of Abatement:	Renovation	<input checked="" type="checkbox"/>	Demolition	<input type="checkbox"/>
7.	Type of Asbestos Abatement:	Removal	<input checked="" type="checkbox"/>	Enclosure	<input type="checkbox"/>
8.	Type and Amount of Asbestos Material Pertaining to AWP:	<i>Floor Tile (FT²)</i>	unknown	<i>Pipe Insulation (LF)</i>	unknown
		<i>Linoleum (FT²)</i>	unknown	<i>Pipe Fittings (each)</i>	unknown
	(use additional attachment if necessary)	<i>Transite (FT²)</i>	unknown	<i>Other Friable</i>	unknown
		<i>Window door Caulking</i>	unknown	<i>Other Non-Friable</i>	unknown

DESCRIPTION OF FACILITY

9.	Size:	3200 ft ²	Age:	>50	Use:	Vacant blighted building unsafe for entry
10.	Section(s) and Subsections of the Standards for Asbestos Abatement regulation for which alternative work practice(s) is/are proposed:					
	Section 19a-332-5(b)(c)(d)(e)(h)-7(c)					
11.	Description of Alternative Work Practice(s): Please provide additional information such as drawings, photographs, work plans or similar information in order to provide an accurate review. Please identify the specific work area/s of the facility.					
	In Lieu of the requirements listed in Section 11 above, the work will be conducted as described as follows:					
	<p>The building was been deemed unsafe for entry and a Public Health Hazard by the City of Meriden. The building is filled with human waste, insect infestation, and illegal activities). (HUD is even concerned about the tenants in the adjacent properties). The City of Meriden has deemed the Building an "Emergency Demolition". The entire building will be demolished and disposed of as asbestos waste. The demolition of the building will be conducted with both a licensed asbestos abatement contractor and licensed asbestos project monitor on-site. During demolition the materials will be continuously sprayed with water to prevent visible emissions and the waste will be placed directly into waste containers lined with two layers of 6 mil poly. A licensed Asbestos Project Monitor from Mystic Air Will be on-site during the work and to ensure adequate wetting and proper disposal of all waste and to conduct down wind ambient air monitoring. Mystic Air Quality will be monitoring on site continually. There will be no Final Air Tests so there will be no re-occupancy. All asbestos waste will be disposed of by licensed asbestos hauler in a lined and labeled waste container</p>					

For Department of Public Health Use Only:

Reviewed by _____

Date of Review _____

<i>Approved</i>	<i>Set Aside</i>	<i>Denied</i>

Revision date December 23, 2002

State of Connecticut, Department of Public Health

Approved Environmental Laboratory

THIS IS TO CERTIFY THAT THE LABORATORY DESCRIBED BELOW HAS BEEN APPROVED BY THE STATE DEPARTMENT OF PUBLIC HEALTH PURSUANT TO APPLICABLE PROVISIONS OF THE PUBLIC HEALTH CODE AND GENERAL STATUTES OF CONNECTICUT, FOR MAKING THE EXAMINATIONS, DETERMINATIONS OR TESTS SPECIFIED BELOW WHICH HAVE BEEN AUTHORIZED IN WRITING BY THAT DEPARTMENT.

Mystic Air Quality Consultants

LOCATED AT 1204 North Road IN Groton, CT 06340
AND REGISTERED IN THE NAME OF Christopher J. Eident

THIS CERTIFICATE IS ISSUED IN THE NAME OF Christopher J. Eident WHO HAS BEEN DESIGNATED BY THE REGISTERED OWNER AUTHORIZED AGENT TO BE IN CHARGE OF THE LABORATORY WORK COVERED BY THIS CERTIFICATE OF APPROVAL AS FOLLOWS:


ASBESTOS

Examination For:

Air - Fiber Counting (PLM)
Bulk Materials - Identification (PCM)

SEE COMPUTER PRINT-OUT FOR SPECIFIC TESTS APPROVED

THIS CERTIFICATE EXPIRES June 30, 2006 AND IS REVOCABLE FOR CAUSE BY THE STATE DEPARTMENT OF PUBLIC HEALTH
DATED AT HARTFORD, CONNECTICUT, THIS 17th DAY OF June, 2004

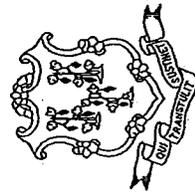

PH - 0630

Evan J. Blaschinski

DIRECTOR, DIVISION OF ENVIRONMENTAL HEALTH



The American Industrial Hygiene Association

acknowledges that

Mystic Air Quality Consultants, Inc.

1204 North Road, Route 117, Groton, CT 06340
Laboratory ID: 100129

has fulfilled the requirements of the AIHA Laboratory Quality Assurance Programs (LQAP), thereby, conforming to the ISO/IEC 17025:1999 international standard, *General Requirements for the Competence of Testing and Calibration Laboratories*. The above named laboratory, along with all premises from which key activities are performed, as listed above, have been accredited by AIHA in the following:

ACCREDITATION PROGRAMS

- INDUSTRIAL HYGIENE
- ENVIRONMENTAL LEAD
- ENVIRONMENTAL MICROBIOLOGY
- FOOD

Accreditation Expires: 12/01/2007
Accreditation Expires:
Accreditation Expires:
Accreditation Expires:

Specific Field(s) of Testing (FoT)/Method(s) within each Accreditation Program for which the above named laboratory maintains accreditation is outlined on the attached Scope of Accreditation. Continued accreditation is contingent upon successful on-going compliance with LQAP requirements. This certificate is not valid without the attached Scope of Accreditation.

Larry S. Pierce, PhD, CIH
Chairperson, Analytical Accreditation Board

Roy M. Buchan, DrPH, CIH
President, AIHA

Date Issued: 12/13/2005

CELEBRATING
30
Thirty Years
of AIHA
Accrediting Labs
SOUND DATA |
SMARTER DECISIONS
1974 - 2004

Certificate of Training

AWARDED TO
STEWART OAKES
 For successful completion of an 8 (eight)-hour
Asbestos Project Monitor Refresher Course
 SEPTEMBER 15, 2005
 This training was awarded in accordance with
 Regulations promulgated by the State Agencies in
 RCSA 2b-400-100 and 2b-400-100a and meets the
 requirements for the EPA Revised WAF under TSCA Title II of 4/4/94

Mystic Air Quality Consultants, Inc.
 1204 North Road, Groton, CT 06340 (800) 247-7746
 Certificate Number: APM/R13554
 Exam Date: 09/15/2005
 Expiration Date: 09/15/2006
George Williams
 George Williams, Training Director

MYSTIC AIR QUALITY CONSULTANTS, INC.
 1091 Buddington Road • Groton, Connecticut 06340

certifies that
STEWART B. OAKES
 282-40-8997
 has successfully completed an intensive course of instruction
 including a written examination in

Principles and Practices of Asbestos Abatement

for
Asbestos Workers and Supervisors

intended to meet the EPA, AHERA and OSHA requirements for a five-day training course
 for asbestos workers and site supervisors of asbestos abatement operations

Christopher J. Eident
 Training Director

186 FRP
 Certificate Number
 8-12 May 1989
 Date of Course

STATE OF CONNECTICUT
 DEPARTMENT OF PUBLIC HEALTH
 PURSUANT TO THE PROVISIONS OF THE GENERAL STATUTES OF CONNECTICUT
 THE INDIVIDUAL NAMED BELOW IS LICENSED
 BY THE DEPARTMENT AS A
ASBESTOS CONSULTANT - PROJECT MONITOR
 STEWART OAKES
 LICENSE NO. 000089
 CURRENT THROUGH 06/30/05
 VALIDATION NO. 031097764

Christopher J. Eident
 COMMISSIONER

Stewart B. Oakes
 SIGNATURE

This certifies that
STEWART B. OAKES
 282-40-8997

fathfully attended and successfully completed an
 intensive course of instruction and practical examination in

ASBESTOS SAMPLING AND ANALYSIS (NIOSH 582 COURSE)

Frederick C. Davis
 Frederick C. Davis, Instructor

Christopher J. Eident
 Christopher J. Eident, Citi, President

May 30 - June 2, 1989
 Mystic Air Quality Consultants
 1091 Buddington Road, Groton, CT 06340

Certificate Number: 5627107



Mystic Air Quality Consultants, Inc.

1204 North Road (Rt. 117) Groton, Connecticut 06340

ASBESTOS ABATEMENT PROJECT PERSONNEL CERTIFICATION CHECK LIST

This sheet serves the purpose of summarizing the information presented at the job site in the form of actual copies of training and medical certification papers. The papers are part of the permanent file. This check list is retained by Mystic Air Quality as an indication that papers were available and were reviewed and were found to be in order.

NAME: Ansel M. Laurencio Signed _____

Social Security # or other distinct ID# _____

Training Certifications are for Asbestos () Supervisor () Worker

State of Connecticut Asbestos Certification Card data:

Certification # 00378 Validation # 03-140339

Date of Expiration 1/31/06
(Three months grace period acceptable as long as training has not expired)

Training Certifications:

Initial Training

Training Provider The AULSON Company INC.

Training Dates 10/11-15/99 Certificate # 1374

Current Refresher Training

Training Provider ENV. COMPLIANCE SERVICES INC.

Training Date 9/23/2005 Certificate # 80068.0026-3814

Current Medical Exam Date: 9/27/05 Provider: OCHEM-CFA

Current Fit Test Date(s): 1/24/2005 MANHART Brothers

Communications (24 hours): _____

Office: (860) 449-8903

FAX: (860) 449-8860

Toll Free: 1 (800) 247-7746

website: www.mysticair.com

e-mail: maqc2@aol.com



Appendix F: CTDEEP Natural Diversity Data Base Map – City of Meriden, CT

Natural Diversity Data Base Areas

MERIDEN, CT

December 2013

 State and Federal Listed Species & Significant Natural Communities

 Town Boundary

NOTE: This map shows general locations of State and Federal Listed Species and Significant Natural Communities. Information on listed species is collected and compiled by the Natural Diversity Data Base (NDDB) from a number of data sources. Exact locations of species have been buffered to produce the general locations. Exact locations of species and communities occur somewhere in the shaded areas, not necessarily in the center. A new mapping format is being employed that more accurately models important riparian and aquatic areas and eliminates the need for the upstream/downstream searches required in previous versions.

This map is intended for use as a preliminary screening tool for conducting a Natural Diversity Data Base Review Request. To use the map, locate the project boundaries and any additional affected areas. If the project is within a shaded area there may be a potential conflict with a listed species. For more information, complete a Request for Natural Diversity Data Base State Listed Species Review form (DEP-APP-007), and submit it to the NDDB along with the required maps and information. More detailed instructions are provided with the request form on our website.


www.ct.gov/deep/nddbrequest

This file has PDF Layers. Look for the Layers tab on the left. Expand the layers and use the "eye" icons to change visibility.

QUESTIONS: Department of Energy and Environmental Protection (DEEP)
79 Elm St., Hartford CT 06106
Phone (860) 424-3011



Connecticut Department of Energy & Environmental Protection
Bureau of Natural Resources
Wildlife Division

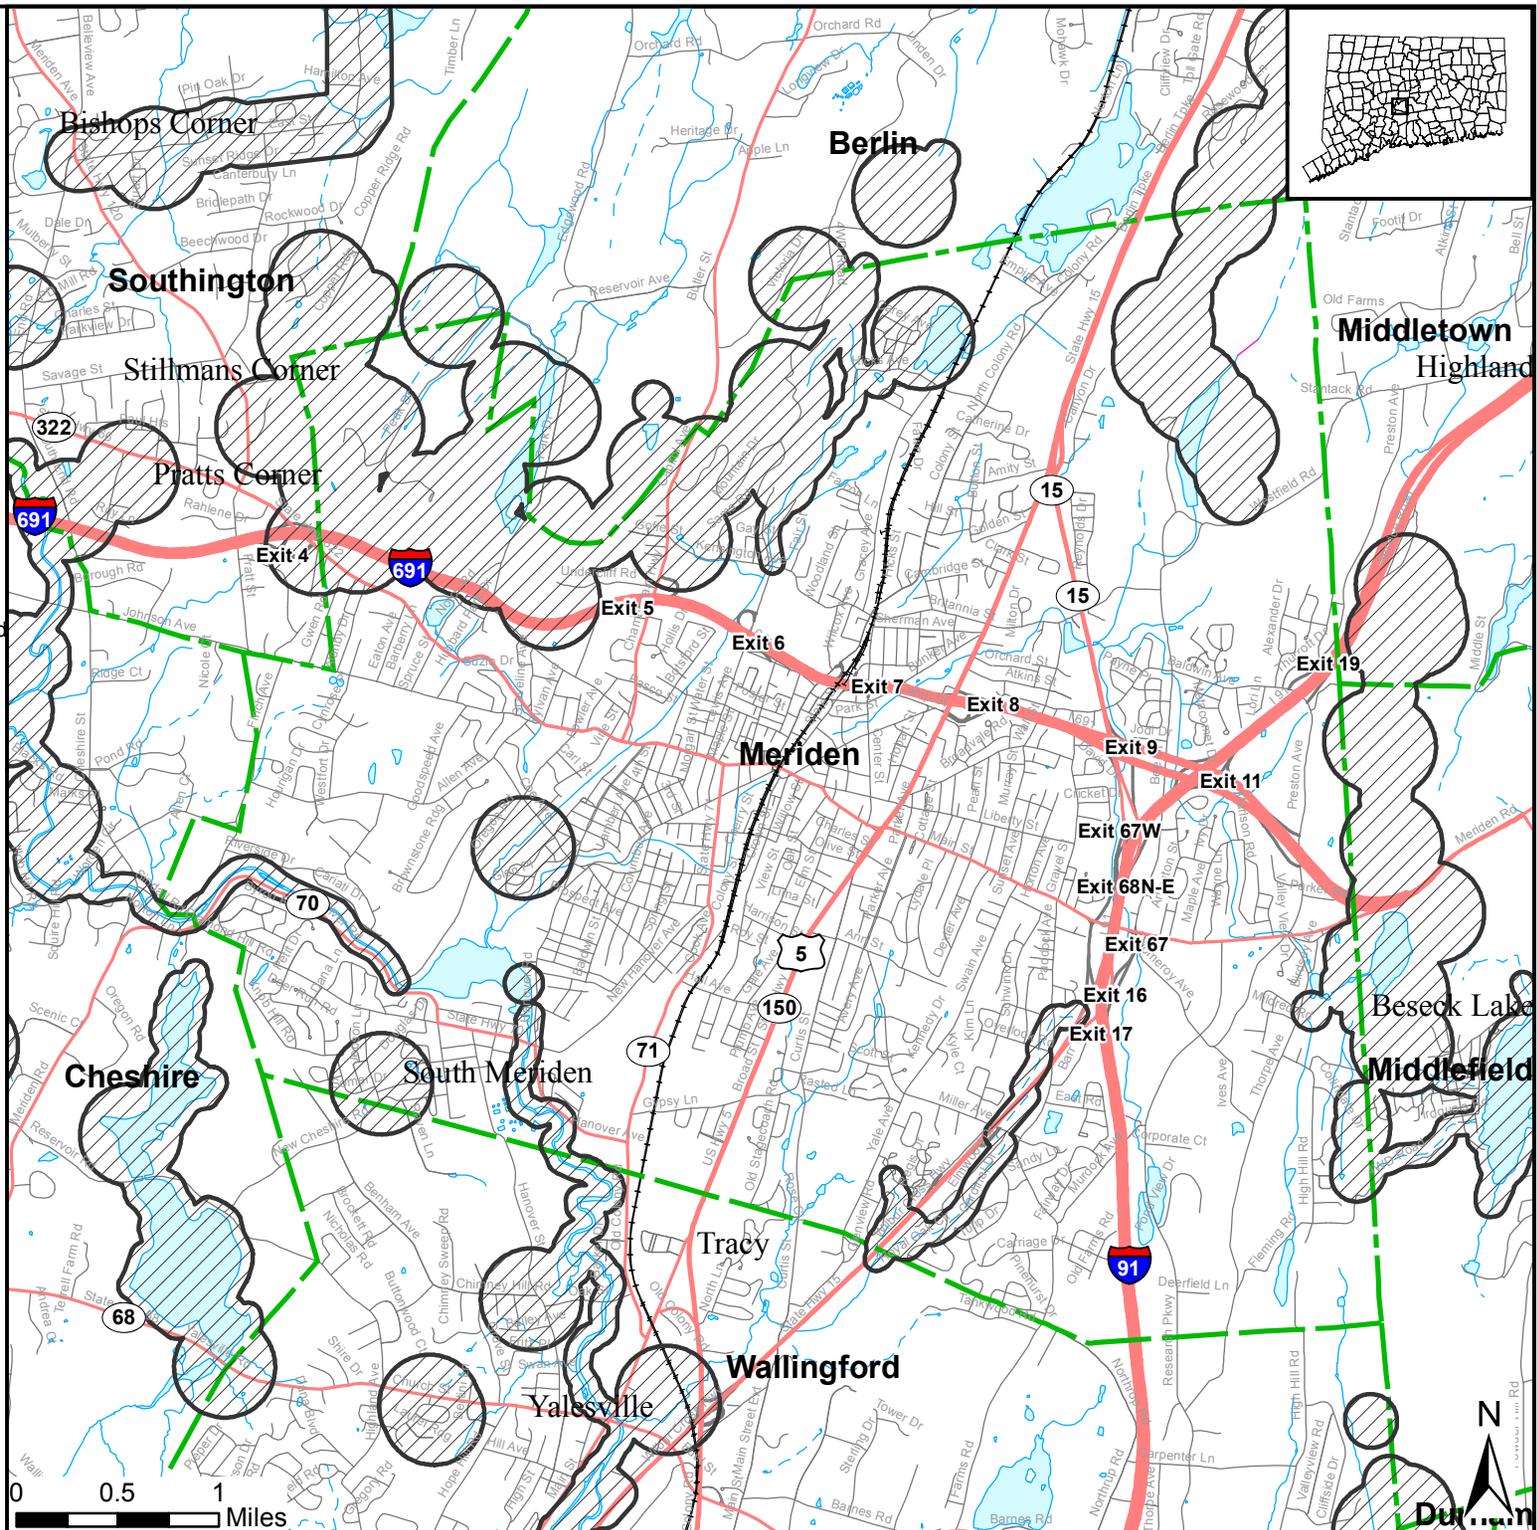



Appendix G: EDR Certified Sanborn® Map Report

88 Grove Street

88 Grove Street

Meriden, CT 06451

Inquiry Number: 3907845.17

April 10, 2014

Certified Sanborn® Map Report



6 Armstrong Road, 4th Floor
Shelton, Connecticut 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

4/10/14

Site Name:

88 Grove Street
88 Grove Street
Meriden, CT 06451

Client Name:

Vanasse Hangen Brustlin, Inc.
100 Great Meadow Road
Wethersfield, CT 06109-0000



EDR Inquiry # 3907845.17

Contact: Shelby Miller

The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Vanasse Hangen Brustlin, Inc. were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Site Name: 88 Grove Street
Address: 88 Grove Street
City, State, Zip: Meriden, CT 06451
Cross Street:
P.O. # 81649.14
Project: NA
Certification # 402B-4164-B27A



Sanborn® Library search results
Certification # 402B-4164-B27A

Maps Provided:

1971 1884
1953
1950
1901
1896
1891

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Vanasse Hangen Brustlin, Inc. (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2014 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1971 Source Sheets



Volume 1, Sheet 9



Volume 1, Sheet 10



Volume 1, Sheet 17



Volume 1, Sheet 18

1953 Source Sheets



Volume 1, Sheet 9



Volume 1, Sheet 10



Volume 1, Sheet 17



Volume 1, Sheet 18

1950 Source Sheets



Volume 1, Sheet 9



Volume 1, Sheet 10



Volume 1, Sheet 17



Volume 1, Sheet 18

1901 Source Sheets




Volume 1, Sheet 9



Volume 1, Sheet 10



Volume 1, Sheet 17

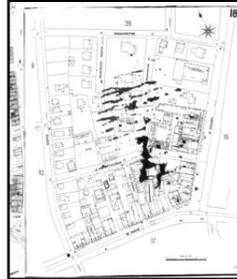


Volume 1, Sheet 18

1896 Source Sheets




Volume 1, Sheet 15

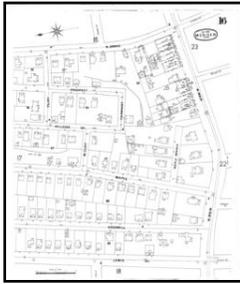

Volume 1, Sheet 16



Volume 1, Sheet 17

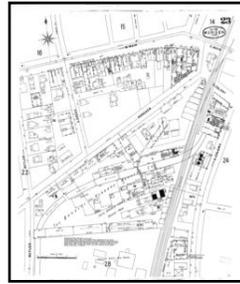

Volume 1, Sheet 23

1891 Source Sheets



Volume 1, Sheet 11



Volume 1, Sheet 12



Volume 1, Sheet 18


1884 Source Sheets



Volume 1, Sheet 8



Volume 1, Sheet 9

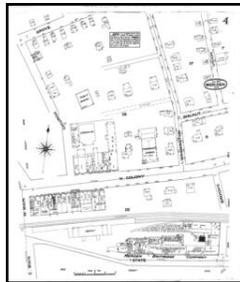

Volume 1, Sheet 4

1971 Certified Sanborn Map

Site Name: 88 Grove Street
 Address: 88 Grove Street
 City, ST, ZIP: Meriden CT 06451
 Client: Vanasse Hangen Brustlin, Inc.
 EDR Inquiry: 3907845.17
 Order Date: 4/10/2014 12:11:01 PM
 Certification #: 402B-4164-B27A
 Copyright: 1971




The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification #
 402B-4164-B27A



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

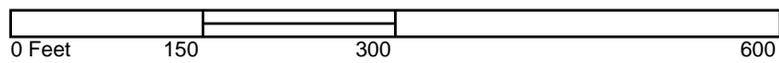

- Volume 1, Sheet 9
- Volume 1, Sheet 10
- Volume 1, Sheet 17
- Volume 1, Sheet 18



1953 Certified Sanborn Map

Site Name: 88 Grove Street
 Address: 88 Grove Street
 City, ST, ZIP: Meriden CT 06451
 Client: Vanasse Hangen Brustlin, Inc.
 EDR Inquiry: 3907845.17
 Order Date: 4/10/2014 12:11:01 PM
 Certification #: 402B-4164-B27A
 Copyright: 1953





The certified Sanborn Map search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 402B-4164-B27A



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

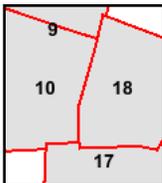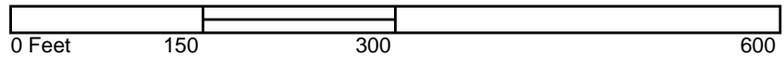

- Volume 1, Sheet 9
- Volume 1, Sheet 10
- Volume 1, Sheet 17
- Volume 1, Sheet 18




1950 Certified Sanborn Map

Site Name: 88 Grove Street
 Address: 88 Grove Street
 City, ST, ZIP: Meriden CT 06451
 Client: Vanasse Hangen Brustlin, Inc.
 EDR Inquiry: 3907845.17
 Order Date: 4/10/2014 12:11:01 PM
 Certification #: 402B-4164-B27A
 Copyright: 1950





The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 402B-4164-B27A

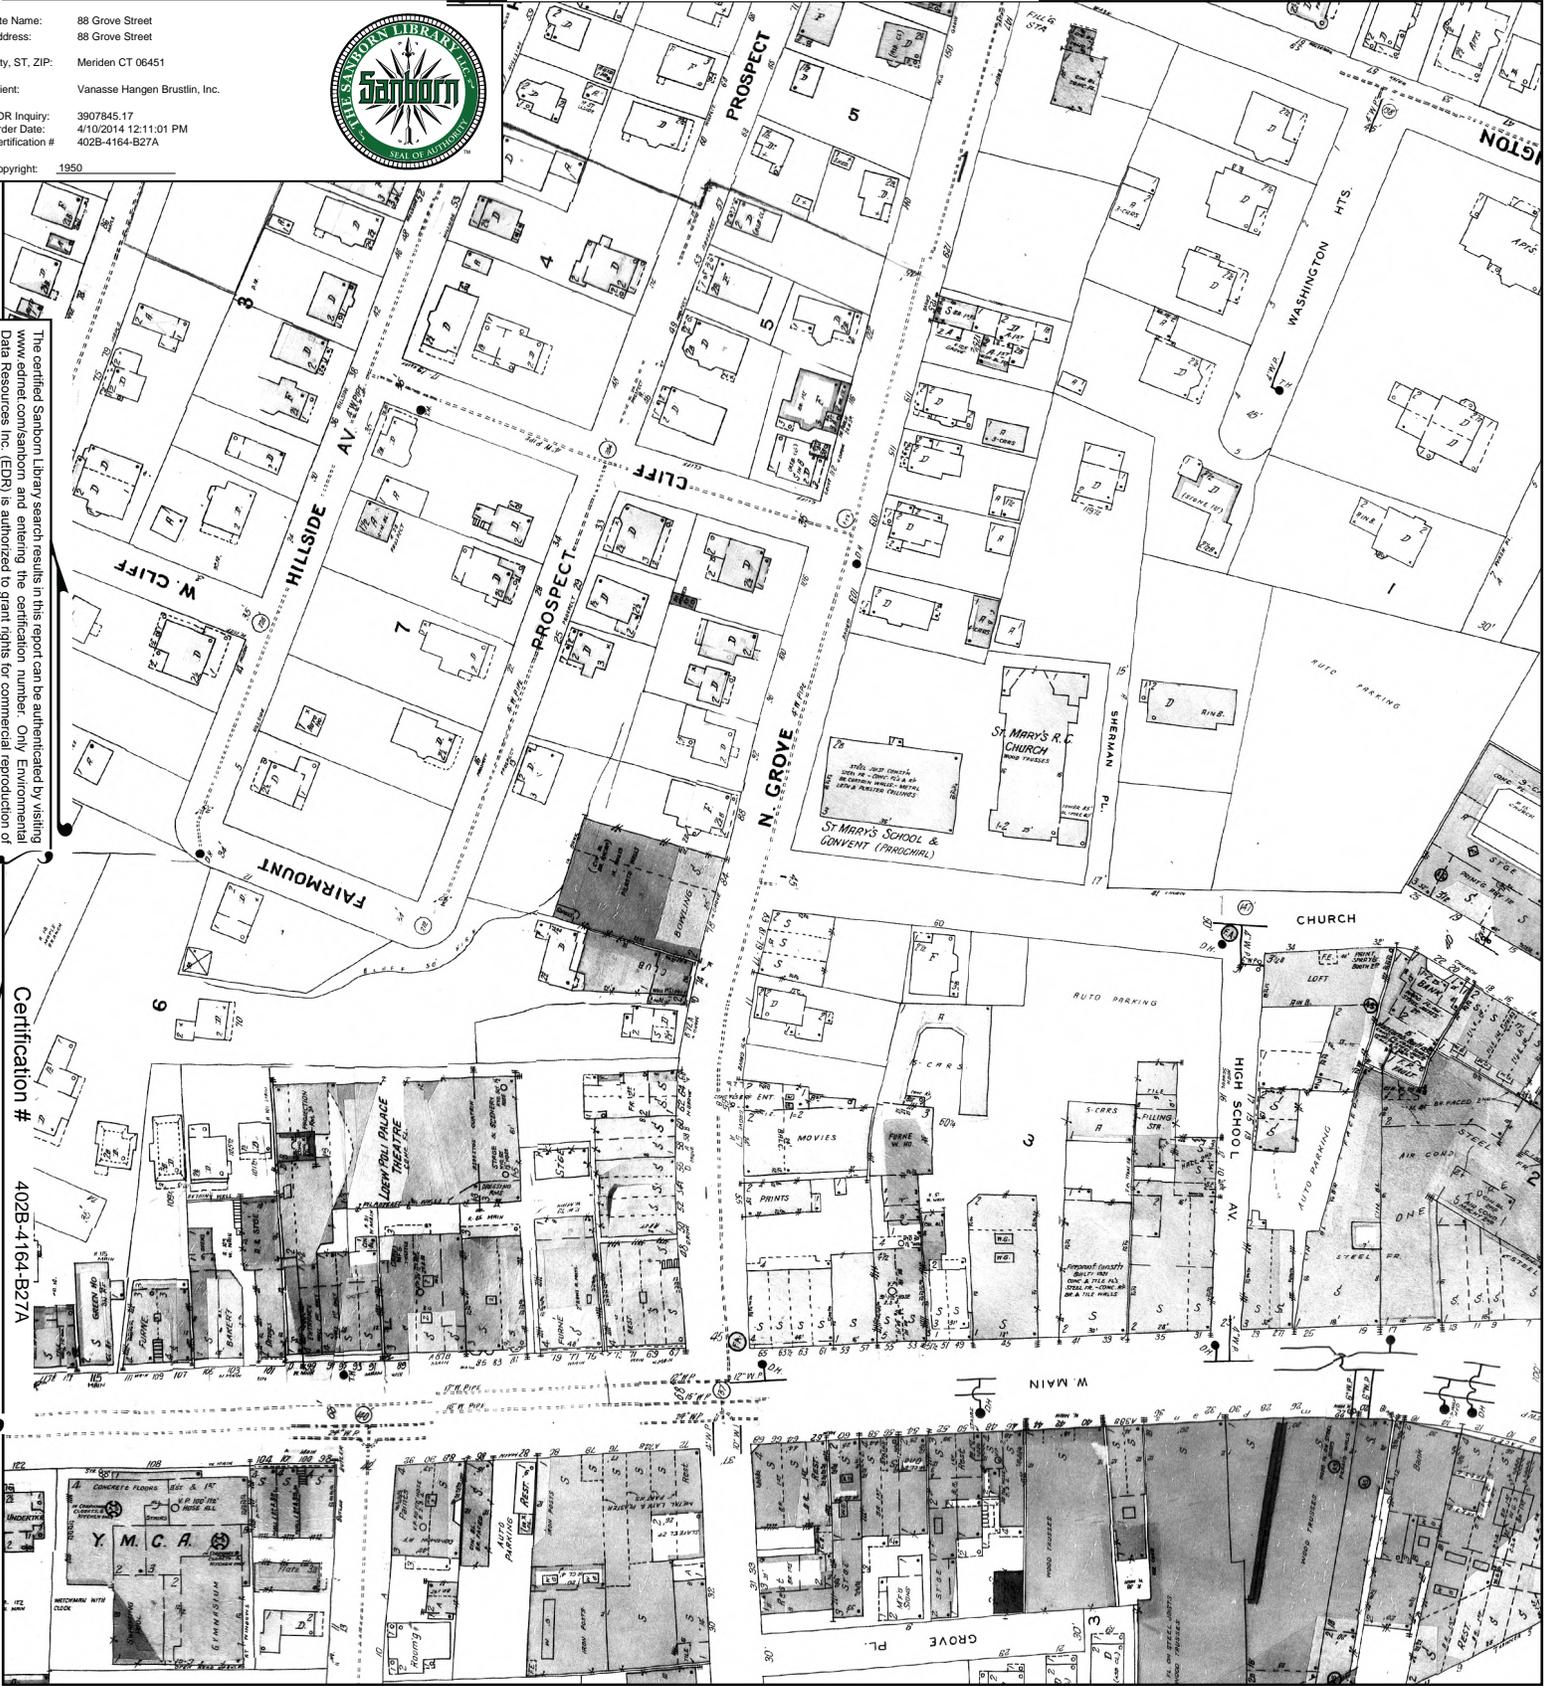

This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

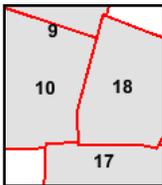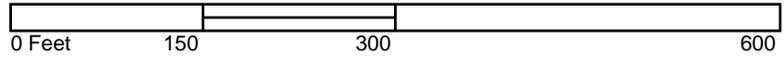

- Volume 1, Sheet 9
- Volume 1, Sheet 10
- Volume 1, Sheet 17
- Volume 1, Sheet 18



1901 Certified Sanborn Map

Site Name: 88 Grove Street
 Address: 88 Grove Street
 City, ST, ZIP: Meriden CT 06451
 Client: Vanasse Hangen Brustlin, Inc.
 EDR Inquiry: 3907845.17
 Order Date: 4/10/2014 12:11:01 PM
 Certification #: 402B-4164-B27A
 Copyright: 1901





The certified Sanborn Map search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 402B-4164-B27A



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

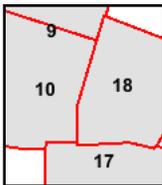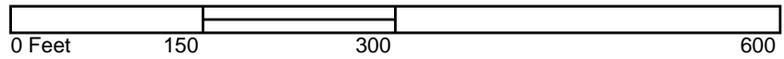

- Volume 1, Sheet 9
- Volume 1, Sheet 10
- Volume 1, Sheet 17
- Volume 1, Sheet 18



1896 Certified Sanborn Map

Site Name: 88 Grove Street
 Address: 88 Grove Street
 City, ST, ZIP: Meriden CT 06451
 Client: Vanasse Hangen Brustlin, Inc.
 EDR Inquiry: 3907845.17
 Order Date: 4/10/2014 12:11:01 PM
 Certification #: 402B-4164-B27A
 Copyright: 1896




The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 402B-4164-B27A



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

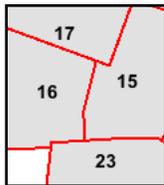

- Volume 1, Sheet 15
- Volume 1, Sheet 16
- Volume 1, Sheet 17
- Volume 1, Sheet 23




1891 Certified Sanborn Map

Site Name: 88 Grove Street
 Address: 88 Grove Street
 City, ST, ZIP: Meriden CT 06451
 Client: Vanasse Hangen Brustlin, Inc.
 EDR Inquiry: 3907845.17
 Order Date: 4/10/2014 12:11:01 PM
 Certification #: 402B-4164-B27A
 Copyright: 1891





The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 402B-4164-B27A

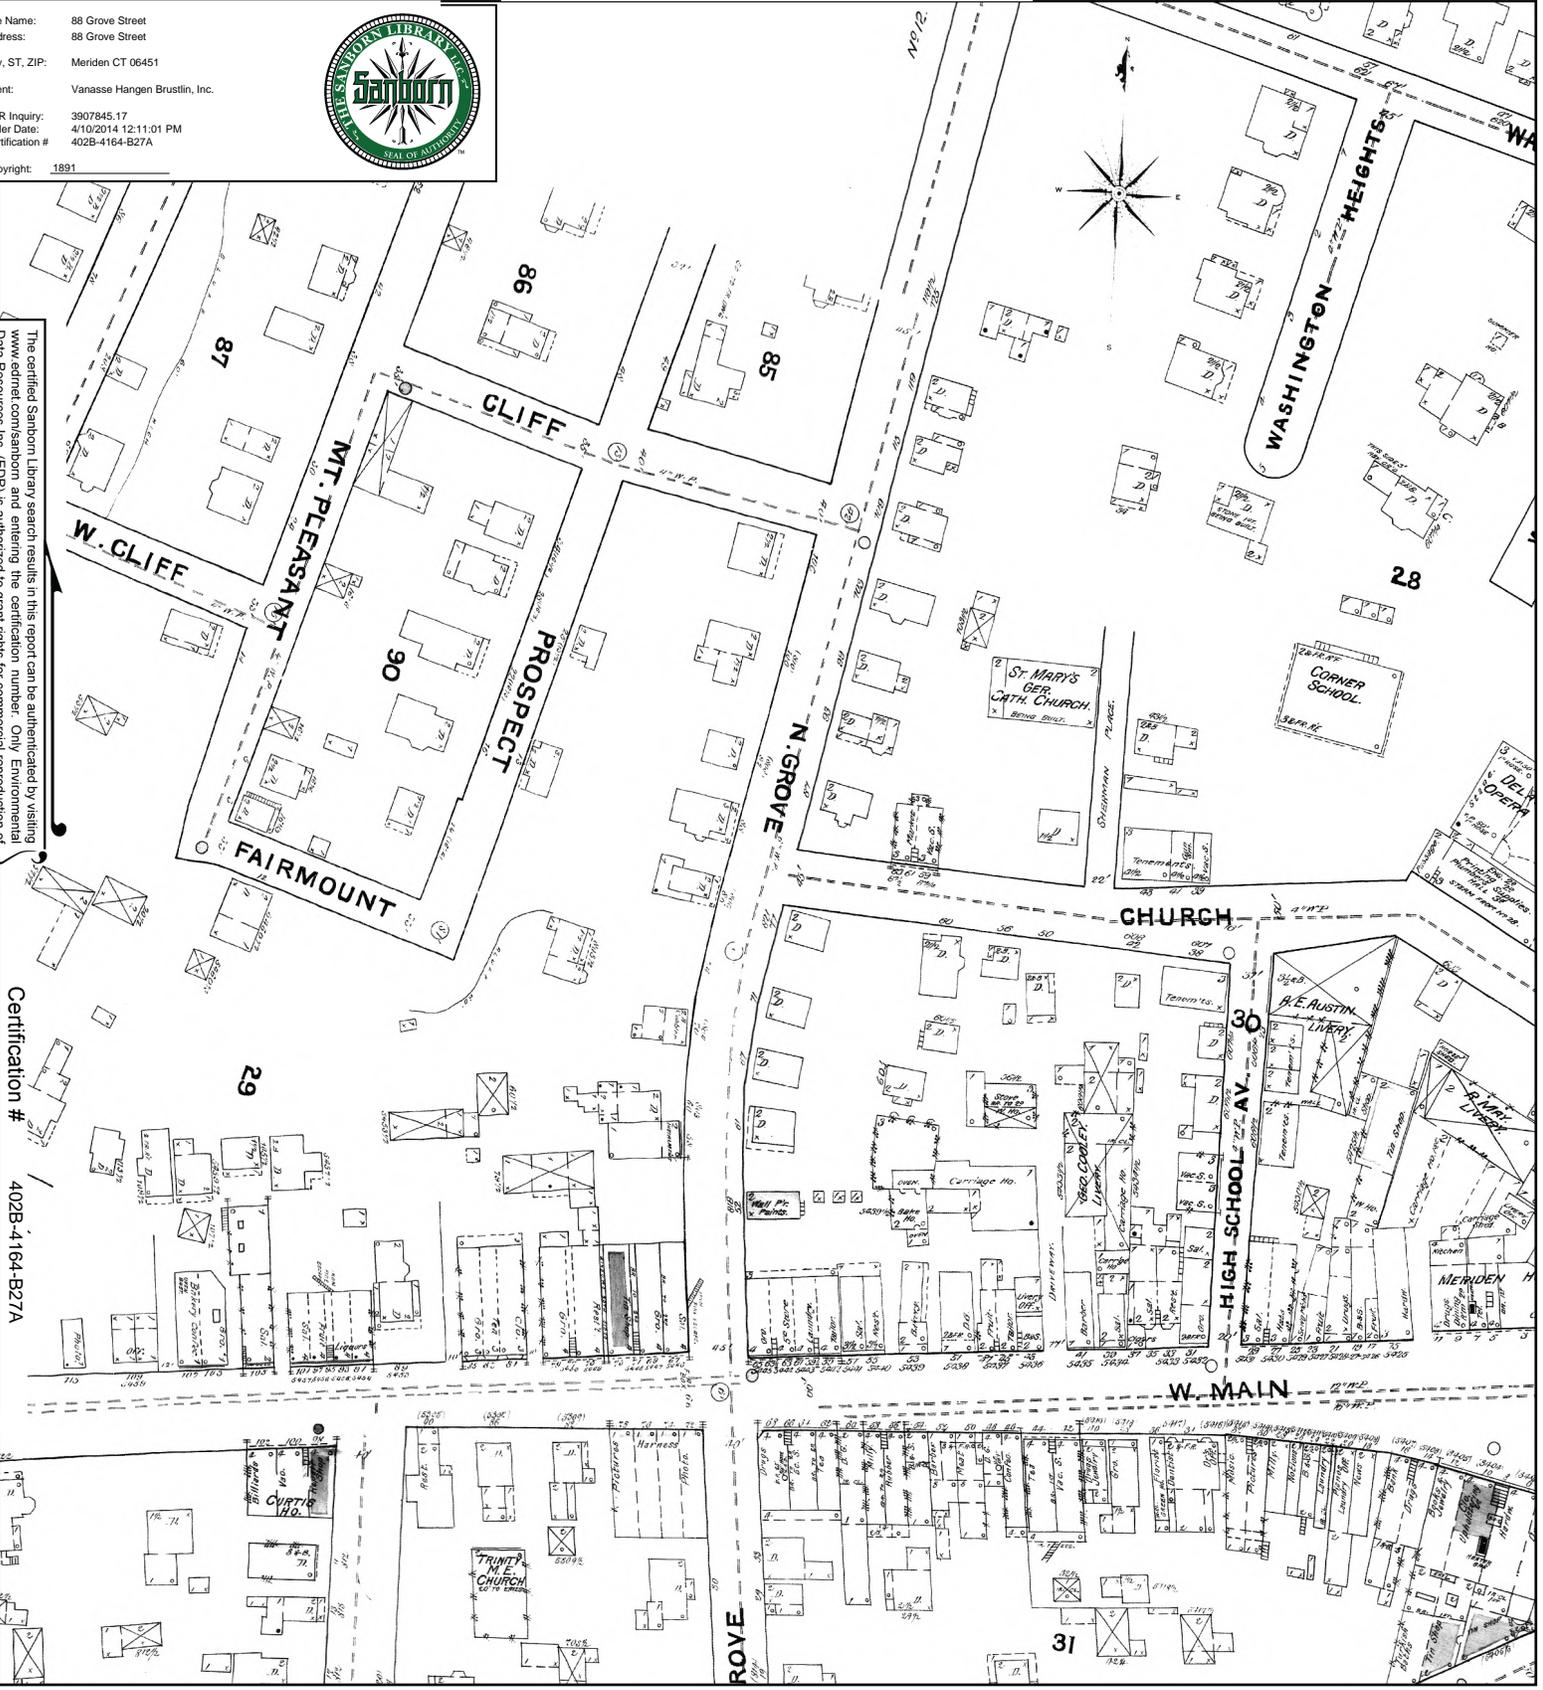

This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

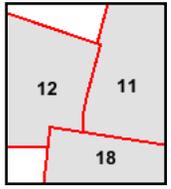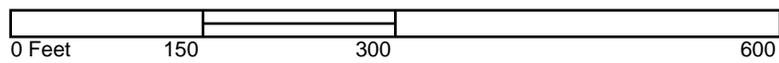

- Volume 1, Sheet 11
- Volume 1, Sheet 12
- Volume 1, Sheet 18



1884 Certified Sanborn Map

Site Name: 88 Grove Street
 Address: 88 Grove Street
 City, ST, ZIP: Meriden CT 06451
 Client: Vanasse Hangen Brustlin, Inc.
 EDR Inquiry: 3907845.17
 Order Date: 4/10/2014 12:11:01 PM
 Certification #: 402B-4164-B27A
 Copyright: 1884





The certified Sanborn Map search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # 402B-4164-B27A



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

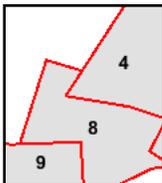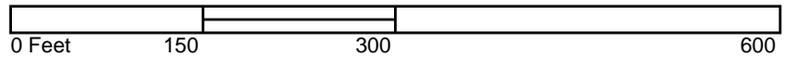

- Volume 1, Sheet 8
- Volume 1, Sheet 9
- Volume 1, Sheet 4





Appendix H: EDR City Directory Image Report

88 Grove Street

88 Grove Street
Meriden, CT 06451

Inquiry Number: 3907845.19
April 11, 2014

The EDR-City Directory Image Report

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2013 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available city directory data at 5 year intervals.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

<u>Year</u>	<u>Target Street</u>	<u>Cross Street</u>	<u>Source</u>
2013	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Information Services
2008	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Information Services
2003	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Information Services
1999	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Cole Information Services
1990	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Johnson's City Directory
1977	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Price & Lee's City Directory
1970	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Price & Lee's City Directory
1963	<input checked="" type="checkbox"/>	<input type="checkbox"/>	Price & Lee's City Directory

RECORD SOURCES

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer. Reproduction of City Directories without permission of the publisher or licensed vendor may be a violation of copyright.

FINDINGS

TARGET PROPERTY STREET

88 Grove Street
Meriden, CT 06451

<u>Year</u>	<u>CD Image</u>	<u>Source</u>
-------------	-----------------	---------------

GROVE ST

2013	pg A1	Cole Information Services
2008	pg A2	Cole Information Services
2003	pg A4	Cole Information Services
1999	pg A5	Cole Information Services
1990	pg A6	Johnson's City Directory
1977	pg A7	Price & Lee's City Directory
1977	pg A8	Price & Lee's City Directory
1970	pg A10	Price & Lee's City Directory
1970	pg A9	Price & Lee's City Directory
1963	pg A11	Price & Lee's City Directory
1963	pg A12	Price & Lee's City Directory

FINDINGS

CROSS STREETS

No Cross Streets Identified

City Directory Images

GROVE ST 2013

55	ROTEM EIZENBERGER
60	MIGUEL MEDINA RICKY CORDERO
72	DANIEL CLARK MELISSA DEPAULO ROBERT LEVESQUE SAMANTHA BEEBE
92	EDWIN NARVAEZ MARIA RUIZ
97	ST MARYS SCHOOLS
100	JAMES LOCKHART PHILLIP FULKE
109	RAYMOND GARCIA YAZLEEN VAZQUEZ
115	DAVID CARTEGENA JEREMY RIEDEL RIEDEL JEREMY
116	ANTONIO FERNANDEZ ERNEST BOYD ROBERT VICKERY SUSAN RILEY
119	CHRISTA TERRY
122	GINA SPADA LISA WHITE RUTH SETTLE WENDY BARCOMB
141	NATIONAL CABINET & MILLWORK
150	BLANCA CASTRO ELIZABETH HUTCHINSON NANCY BEMIS-VITALE
168	BRENDA MEADOWS BRENDA SHORT CHRISTINE AGULIAR JOHN BALTAS NATHANNEL LOPEZ
169	AMANDA FOLEY IZELL MCKENZIE J BORN J MAENZA JAMES KASZULA JENNIFER BETHKE JERRY FORBES JOSEPH LASKOWSKI R DOMINGEZ

GROVE ST 2008

55	KELVIN BRUNO
60	SILVIA IRIZARRIS
72	ANGEL AVILES SAMANTHA BEEBE
92	WINDY BURTASKET
96	ANGELA SPAIN
97	ST MARYS SCHOOL
100	CAROLYN ROWAN GERARD ROCCAPRIORE L GOMEZ VONDA VELIU
109	CHRISTOPHER PIZZI
115	CYNTHIA RAYMOND GEORGE LEVESH JENNIFER DANDELSKI LIZMARIE BERRIOS
116	ANA VARGAS ANALESVIA PAGAN ANTONIO FERNANDEZ DAVID MIRANDA E BOYD ERIK MARTINEZ LASHAUN DICKERSON MIGUEL RODRIGUEZ
119	A ALBERT AL HAYTON C WOODWARD NICKEYA ROBINSON
122	BRANDY EDDINS LISA WHITE
140	CARMINE DEANGELIS KARIN DYSON LINDA STRNO PENNY MARTORELLI RAYMOND GREENWELL
141	NATINAL CABINET & MILLWORK PRIME CARPENTRY LLC
150	AMY LUKASIK ANTHONY ALLEN STANFORD HAMMIE SYLVIA ALCOCER VANESSA TILLMAN VLADIMIR ZHITNITSKY
168	ANTHONY PELLEGRINO C SOBOSLAI DUANE DIMOCK JESSE PERRY JILL BALOGH JOHN BALTAS SARAH GLADKOSKY



-

GROVE ST 2008 (Cont'd)

169 AMY DEGRIS
J BORN
JOSEPH LASKOWSKI
M MACDONALD
RHIANNON DOMINGUEZ
ROBERT LEMIRE
STACEY TARANTELLI

GROVE ST 2003

60	JOES PLACE CAFE
62	OCCUPANT UNKNOWN
72	JOHN CARDINI
74	OCCUPANT UNKNOWN
92	JOCELYN SPIVEY LYNDAS FROST
96	DAVID PLUNSKA
97	OCCUPANT UNKNOWN ST MARYS SCHOOL
100	CARLOS LOPEZ
115	EFRAIN LOPEZ GEORGE LEVESH
116	ANTONIO FERNANDEZ E BOYD ERIK MARTINEZ ERIK MARTINEZ
119	AL HAYTON R SMITH
122	MARIA BAEZ RIVERA JOSE
140	PENNY MARTORELLI
141	OCCUPANT UNKNOWN PEMCO INC PEMCO OF CONNECTICUT INC
150	EARL HUTCHINSON
156	JAMES SIMER
168	CHRISTOPHER MCGIRL JILL BALOGH
169	DAVID RUBINO J RASCOE MARIE THEIRAULT YVETTE DEMPSEY

GROVE ST 1999

70	OCCUPANT UNKNOWN
88	OCCUPANT UNKNOWN
92	OCCUPANT UNKNOWN
96	WILLIAM PLUNSKE
97	ST MARYS SCHOOL
100	CAROLYN ROWAN T STEWARD
106	OCCUPANT UNKNOWN
109	DOMENIC RUSSO
115	GEORGE LEVESH
116	C SPIVEY
122	GARY NYE KERRY ASZKLAR
123	OCCUPANT UNKNOWN
125	OCCUPANT UNKNOWN
140	OCCUPANT UNKNOWN
141	PEMCO
150	MARIA CLARK
168	JILL BALOGH M DELLAVECCHIA
169	ANTONIO ORLANDO FRED GULLO
171	OCCUPANT UNKNOWN UNIDOS GROCERY

GROVE ST 1990

GROVE	
FROM 65.7 W MAIN N TO 120	
COLUMBIA ZIP CODE 06450	
60	COURTHOUSE CAFE634-4697
60	(#1)No Information
60	(#2)SERATE Jesus M.....235-7402
63	No Information
70	No Information
72	No Information
74	No Information
77	No Information
79	No Information
83	No Information
84	No Information
CHURCH ST ENDS	
88	TORRES Manuel237-9946
92	RUIZ Jesus634-3805
96	SOTO Ruben238-0258
97	StMARY'S SCHOOL237-2931
100	(#2)BALOGH John F.....238-9052
100	(#3)HUMMEL Raymond G238-4095
106	No Information
CLIFF ST BEGINS	
109	No Information
112	No Information
115	GILBERT Larry238-7654
115	LEVESH George630-1536
116	(2ndflr)DOMINELLO M G235-9235
116	(2ndflr)ROBERTSON Dawn M235-9235
119	(2ndflr)ZALER Walter S Jr238-7770
125	No Information
140	MORALES Marisol238-4384
141	PEMCO634-4550
150	LACKMAN Jack N237-3248
156	No Information
PROSPECT ST ENDS	
WASHINGTON ST ENDS	
168	BELANGER Mark634-0501
169	ORLANDO Antonio R®237-9252
169	ORLANDO Rosario235-3669
UNION ST ENDS	
173	No Information
SPRINGDALE AV BEGINS	
186	No Information
188	No Information
190	FORTE'S RESTAURANT238-2252
192	No Information

GROVE ST 1977

 GROVE FR 65 3/4 W MAIN N TO 120
 COLUMBIA /RIGHT ODD/
 /IRREGULARLY NUMBERED/

54	VACANT	
55	LACOURCIERE J CO	235-1631
	THE PAINTERS	
60	DENNY S DEN REST	
61	CAPITOL THEATRE	235-7651
62	RICH ADVERTISING CO	
68	VACANT	
72	GUIDANCE MARIE C MRS	
		* 235-9380
	VETERANS BARBER SHOP	
	BURTON MAE MRS	
74	MERIDEN	634-9507
	INDEPENDENT CLUB INC	
77	ARROW WINDOW	
	SHADE MFG	
	CO OF MERIDEN INC	
		237-8000
78	84 EZZO BDG	235-5741
	84 MERIDAN LANES	235-5741
	BOWLING ALLY	
79	LIMON STUDIO PHOTOS	
	MORSE DENTAL	
	LABORATORY	
	RICCI L A REAL EST	
		237-8060
79	LIMON HARVEY	235-0826

GROVE ST 1977

81	YESZ B APPLIANCE INC	235-0100
83	MARY LOU BEAUTY SALON	235-1405
- 85 CHURCH ST ENDS		
88	VACANT	
	TORRES ISMAEL	238-2784
	BOUDREAU JANINE A	237-8177
	TORRES RAYMON	
92	ABELE DORIS M MRS	* 235-9676
	QUA ROXANNA V MRS	235-3756
96	CERUTI JAMES L	237-7338
97	SISTERS DE NOTRE	237-2931
	DAME GERMAN CATHOLIC	
	ST MARYS CONVENT	237-2931
100	ROBINSON ABRAM	
	RUMANEKO IVAN	
	RIFFLE BEN	
	I REYES JUAN A JR	
106	VACANT	
	VACANT	
	PADGETT EDWIN L	
	GIRARD KATHLEEN R	
- 108 CLIFF ST BEGINS		
109	VACANT	
	REFUSED INFO	
112	VACANT	
	VACANT	
	MEDRINA AGAPITO	
115	DONNELLY BETTY	235-4702
	SALAMONE CARMINE A	* 235-0698
116	BAIRD CARL	
	MASON GERTRUDE MRS	235-3135
	DOMINELLO	235-4627
	MADLINE G MRS	
	AINSLIE ROBERTA MRS	237-6144
119	CORDERO BERNARDO	
	VACANT	
	LORENZO RUBIN	
122	JOHNSON CLARENCE M JR	* 634-1076
125	ONTEGA CHRISTOFRE T	235-2266
	RUPERTI LUIS	238-0059
	R VACANT	
	R VACANT	
	R VACANT	
140	MUCCI THOMAS L	238-1898
	TURGEON BARBARA E MRS	
	DUBEREK LARRY J	
141	VACANT	
150	VACANT	
	VACANT	
	ZACAROLA FRANK	
	PERCOPE ERNEST J	* 634-0002
156	MEADOWS JOHN L	
	VACANT	
	WALKER WILLIAM E	
	VACANT	
- 162 PROSPECT ST ENDS		
- 163 WASHINGTON ST ENDS		
168	ROSA ANTONIO	
	AGOSDINI HECTOR L	
169	FAZZIO A J BARBER	
	HALLIWELL MARIE	
169	ORLANDO ANTONIO R	* 237-9252
	CARABETTA TERESA MRS	237-7062
	ORLANDO ROSARIO	235-3669
169	WRIGHT LLOYD	
	CARABETTA DOMINICK	
- 169 1/2 UNION ST ENDS		
171	VACANT	
172	VACANT	
173	ILUMINADA VEGO	
	FONTANES CARMEN MRS	238-4686
	VACANT	
- 176 SPRINGDALE AV BEGINS		

GROVE ST 1970

	VACANT		1

	GROVE FR 65 3/4 W MAIN N TO 120		1
	COLUMBIA /RIGHT ODD/		1
	/IRREGULARLY NUMBERED/		
50	OLYMPIA SANDWICH SHOP		
		235-2445	
52	MERIDEN VACUUM CLEANER		
	CO	235-0039	1
54	VACANT		
55	LACOURCIERE J CO THE		
	PAINTERS	235-1631	
56	VACANT		
58	VACANT		
60	OXBOW RESTAURANT	237-6980	
61	CAPITOL THEATRE /MO-		
	TION PICTURES/	235-7651	
68	VACANT		1
72	GUIDACE MARIA C MRS		
		□ 235-9380	1
	BRUZZESE R BARBER		
		237-8028	

GROVE ST 1970

74	ANCIENT ORDER OF HIBERNIANS	237-9922
	LIBBY PEGGY DANCE STUDIO	235-8832
77	ARROW WINDOW SHADE MFG CO OF MERIDEN INC	237-8000
78-		
84	EZZO BDG MERIDEN BOWLING ALLEYS	235-5741
79	LIMON H PHOTOGRAPHER	235-0826
	MORSE DENTAL LABORATORY	237-3649
	RICCI L A REAL EST	237-8060
81	YESZ B APPLIANCE INC	235-0100
83	MARY LOU BEAUTY SALON	235-1405
85 CHURCH ST ENDS		
88	DESROCHERS ANNA TUPAY JEANNETTE MRS GERVAIS RUDOLPH VACANT	235-5869
92	ABELE DORIS M MRS	235-9676
	QUA JOHN C	235-3756
96	RIVERA WILFREDO	
97	SISTERS DE NOTRE DAME /GERMAN CATHOLIC/	235-5310
	ST MARYS CONVENT	
100	RANKINS WILLIE J APT 3 KIRKLAND EDWARD	235-6237
	4 BROUNSON ALFANDO	
103	LOTZ KARL	235-0221
	VACANT	
106	BAILEY JAMES CANNEY JOANN LOPEZ CARLOS VACANT	
108 CLIFF ST BEGINS		
109	NAWAIRSKI THOMAS S VACANT	
112	CARDONA GILBERTO C CROSADO MIGUL VACANT	
115	LOPEZ FRANCESCO SALAMONE CARMINE A	235-0698
116	SMITH MARY J MRS	237-5971
	MASON GORDON H	235-3135
	DOMENELLI MADELINE G MRS	237-9476
	AINSLIE ROBERTA MRS	235-3046
119	TERRANOVA MARGARET MRS	237-8074
	WARNER NOREEN MRS	238-3657
	LOPEZ MANUEL	
122	BANKS GEORGE	235-3757
125	FAVREAU DELOR JAKIELA MARY G MRS	237-8622
125R	SHIBETTA HENRY	235-3566
	STANHOPE CHARLES	238-1847
	AZZOLINA JOSEPH	235-7142
140	MUCCI THOMAS L MARSHALL WILLIE DUBEREK LARRY J	237-0391
141	PARCEL POST ANNEX 6 GARAGE	
150	MAIETTA IDA MRS	235-4876
	POST MILFRED M	237-3325
	FELIX GRACE M MRS	
	PERCOPE ERNEST J	238-1324
156	RODRIGUEZ NEY FAZZIOS APizza REST	235-1963
	RIVERA MIGUEL SANTIAGO RAMON	238-0437
162 PROSPECT ST ENDS		
163 WASHINGTON ST ENDS		
168	ROSA ANTONIO LOPEZ RUBIN	
169	FAZZIO A J BARBER HALLIWELL MARIE ORLANDO ANTONIO R	237-9252

GROVE ST 1963

GROVE fr 65¹/₂ W Main N to 120 Columbia (Right odd) (Irregularly numbered)

- 50 Olympia Sandwich Shop
 ☱ BE 7-9862
- 52 Vacant
- 54 Joe's News Shop
- 55 Lacourciere J Co The painters
 ☱ BE 5-1631
- 56 Vacant
- 58 Vacant
- 60 Oxbow Restaurant ☱ BE 7-9917
- 61 Capitol Theatre ☱ BE 5-7651
- 68 Thrift Shop ☱ BE 7-7958
- 72 Fahr Jennie M Mrs ☱ BE 7-4623
- ☉ Guidace Maria C Mrs
 ☱ BE 5-9380
 Capitol Barber Shop
 ☱ BE 7-8028
- 74 Ancient Order of Hibernians
 ☱ BE 7-9922
 Libby Peggy Dance Studio
 ☱ BE 5-8832
- 77 Arrow Window Shade Mfg Co of
 Meriden Inc ☱ BE 7-8000
- 78-84 Ezzo Bdg
- 78 Meriden Bowling Alleys
 ☱ BE 5-5741
- 79 Vacant
 Limon H photos ☱ BE 5-0826
 Meriden Beauty Salon
 ☱ BE 7-3606
 Morse Dental Laboratory
 ☱ BE 7-3649
- 81 Yesz B Appliances Repair
 ☱ BE 5-0100
- 83 Vacant
- 84 Automatic Music Co Inc
 ☱ BE 5-5741
- 85 Church st ends
- 88 Cullen Clara D Mrs
 ☉ Desrochers A G ☱ BE 5-5869
 Johnston Willis N ☱ BE 7-1525
 Mirabello Louis J Jr
 ☱ BE 5-5143
- 92☉ Abele Lester P ☱ BE 5-9676
 Vacant
- 96☉ Qua John C ☱ BE 5-3756

GROVE ST 1963

97	School Sisters de Notre Dame (German Catholic) St Mary's Convent
100	Vacant Arocho Jose M Δ BE 7-4802 Rigoulet Harry A Δ BE 7-5708
103	Lotz Charles G Δ BE 5-0221 Vacant
106	Argiro A M Mrs Δ BE 7-9034 DelFavero K N Hayes Helen R Mrs Δ BE 7-4785 Adamski Stanley E Δ BE 7-1657
	108 Cliff st begins
109	Vacant Boland Thomas W Δ BE 5-4903
112	Dominello R J Δ BE 7-4053 Fowler George J Δ BE 7-8048 Ramos Juanita Mrs Vacant store
115	Salamone C A Δ BE 5-0698 Wing Cleon A Δ BE 5-5655
116	Smith Mary J Mrs Δ BE 7-5971 Mason Gordon H Δ BE 5-3135 Domenelli Joseph Δ BE 7-9476 Selvaggi Albert Δ BE 7-7167
119	Mancino Armand Δ BE 7-7910 Casala Frank Δ BE 7-5174 Choinard Marie Mrs
122	D'Agostino Mary F Mrs Δ BE 7-9241
125	Puglisi Salvatore Δ BE 5-7268 Urbanski Thaddeus J Δ BE 7-5667
125r	Grisonich Peter Δ BE 7-8371 Shibetta Henry Δ BE 7-9273 Santoni Roland Δ BE 5-6501
140	Gianakos Gustave J Δ BE 7-4707 Busselato Leo Δ BE 7-7671 Vacant
141	Parcel Post Annex & Garage
150	Maietta Ida Mrs Δ BE 5-4876 Lavertu Joel P Noiles Wendell E Post Wilfred H
156	Roma's Apizza Δ BE 7-6423 Gratta Joseph Δ BE 7-4220 Cioffi Domenico Δ BE 5-8881



Appendix I: Site Photographs

Photos:

Photo #: 1



Description: View of Site looking south from the 88 Grove Street parcel towards the 84 Grove Street parcel.

Photo #: 2



Description: Stone/brick wall or former building foundation on the 88 Grove Street parcel.

Photo #: 3



Description: View of former building foundation on the 84 Grove Street parcel.

Photo #: 4



Description: View of northeast corner of the Site looking east. Small pieces of trash and debris can be observed.